

OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL



KEMP QUARRIES / RIVER VALLEY BACKBONE **WL079**

Component Hydraulic System

MOBIL DELVAC 1300 SUPER15W40 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition


The condition of the oil is acceptable for the time in service.

·-/				,		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0108633	PCA0084829	PCA0085843
Sample Date		Client Info		28 Jun 2024	28 Dec 2023	13 Oct 2023
Machine Age	hrs	Client Info		49459	48609	48226
Oil Age	hrs	Client Info		1200	383	1200
Oil Changed		Client Info		Changed	Not Changd	Changed
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	NEG
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	8	8	7
Chromium	ppm	ASTM D5185m	>10	<1	<1	<1
Nickel	ppm	ASTM D5185m	>10	0	<1	0
Titanium	ppm	ASTM D5185m		<1	<1	<1
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>10	4	3	4
Lead	ppm	ASTM D5185m	>10	0	<1	<1
Copper	ppm	ASTM D5185m	>75	2	2	2
Tin	ppm	ASTM D5185m	>10	0	<1	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	<1	<1
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	1	0	0
Barium	ppm	ASTM D5185m	0	0	0	9
Molybdenum	ppm	ASTM D5185m	0	8	2	1
Manganese	ppm	ASTM D5185m		0	<1	0
Magnesium	ppm	ASTM D5185m	0	115	8	8
Calcium	ppm	ASTM D5185m		267	98	87
Phosphorus	ppm	ASTM D5185m		456	385	367
Zinc	ppm	ASTM D5185m		556	455	451
Sulfur	ppm	ASTM D5185m		1392	1055	947
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	8	8	11
Sodium	ppm	ASTM D5185m		2	0	0
Potassium	ppm	ASTM D5185m	>20	<1	2	2
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG



OIL ANALYSIS REPORT

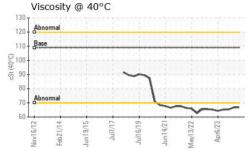

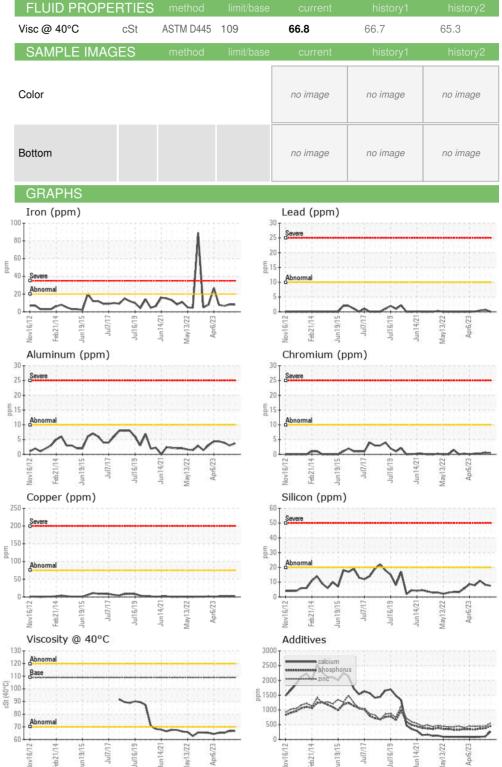





Certificate 12367

Sample No.

Lab Number : 06230970 Unique Number : 11114463

Test Package : MOB 1

: PCA0108633

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 08 Jul 2024 **Tested**

: 10 Jul 2024 Diagnosed

: 10 Jul 2024 - Sean Felton

5600 S Hwy 253 Huntington, AR US 72940

Kemp Quarries - River Valley - Backbone

Contact: backbone@rivervalleyquarries.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: KEMHUN [WUSCAR] 06230970 (Generated: 07/10/2024 14:45:01) Rev: 1

Submitted By:

T:

F: