



CONSTRUCTION EQUIPMENT

347504 VOLVO L120H 632927 - TRANSMISSION (AUTO)



Sample No: VCP352952
Oil Type: VOLVO EXTRA AUTOMATIC FLUID
Job No: 347504



SAMPLE INFORMATION

Sample Number	VCP352952	---	---	---
Sample Date	07 Dec 2022	---	---	---
Machine Hours	4258	---	---	---
Oil Hours	0	---	---	---
Oil Changed	Changed	---	---	---
Sample Status	NORMAL	---	---	---

STRONGCO EQUIP (AB)
 6 - 38403 BURNT LAKE TRAIL
 RED DEER COUNTY, AB
 CA T4S 2L4
 Contact: Perry Doyle
 pdoyle@strongco.com
 T: (403)391-3520
 F: (403)346-3487



OIL CONDITION

Visc @ 40°C	cSt	█ 28.3	---	---	---
-------------	-----	--------	-----	-----	-----



CONTAMINATION

Water	%	NEG	---	---	---
Silicon	ppm	█ 10	---	---	---
Sodium	ppm	█ 3	---	---	---
Potassium	ppm	█ <1	---	---	---

Diagnosis

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the fluid. The condition of the fluid is acceptable for the time in service.



WEAR METALS

Iron	ppm	█ 46	---	---	---
Copper	ppm	█ 13	---	---	---
Lead	ppm	█ <1	---	---	---
Tin	ppm	█ 0	---	---	---
Aluminum	ppm	█ 3	---	---	---
Chromium	ppm	█ 0	---	---	---
Molybdenum	ppm	█ <1	---	---	---
Nickel	ppm	█ 0	---	---	---
Titanium	ppm	0	---	---	---
Silver	ppm	█ 0	---	---	---
Manganese	ppm	█ 3	---	---	---
Vanadium	ppm	0	---	---	---



ADDITIVES

Calcium	ppm	█ 88	---	---	---
Magnesium	ppm	█ 4	---	---	---
Zinc	ppm	█ 16	---	---	---
Phosphorus	ppm	█ 219	---	---	---
Barium	ppm	█ 4	---	---	---
Boron	ppm	█ 77	---	---	---

Depot: VOLVO9652
Unique No: 5501691
Signed: Wes Davis
Report Date: 14 Dec 2022




CONSTRUCTION EQUIPMENT



GRAPHS


Iron (ppm)

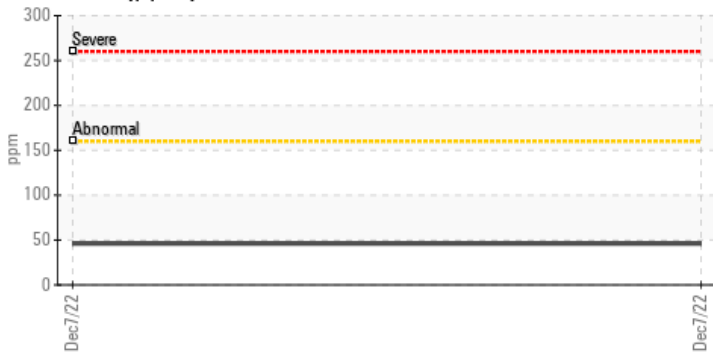


Lead (ppm)




Aluminum (ppm)

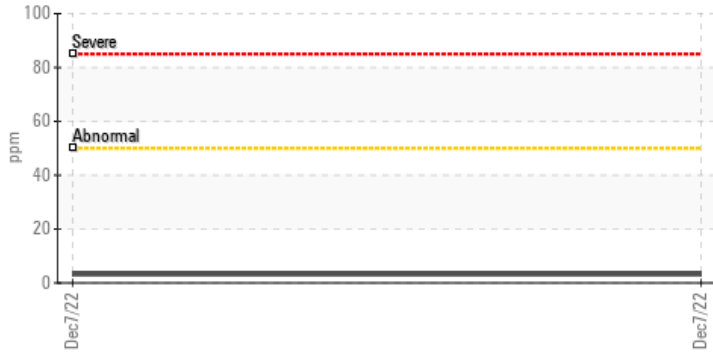


Chromium (ppm)

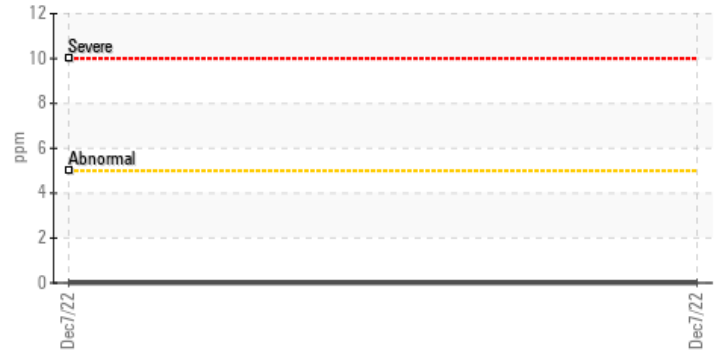

Copper (ppm)

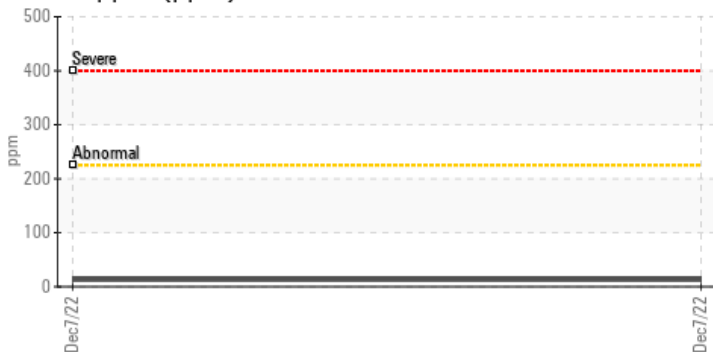

Silicon (ppm)

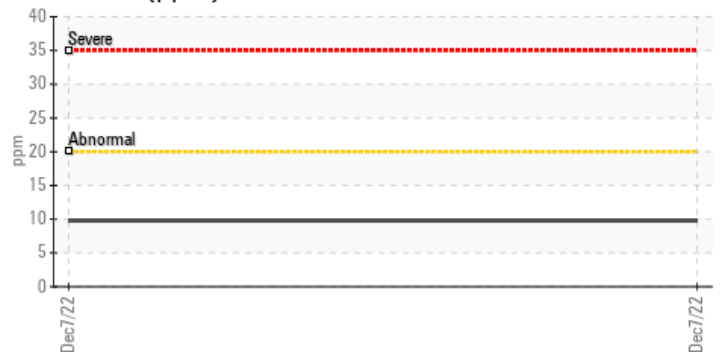

Viscosity @ 40°C



Additives

