Sample No: VCP430188 Oil Type: VOLVO WB 102 Job No: 391698

Boron

VOLVO

	E INFORMATION				
Sample Number		VCP430188	 		
Sample Date		16 Jan 2024	 		STRONGCO EQUIPME
Machine Hours		2117	 		1051 Heritage Rd.
Oil Hours		0	 		Burlington, ON
Oil Changed		Not Changd	 		CA L7L 4Y1
Sample Status		NORMAL	 		Contact: Sue Hooton
Sumple Status					shooton@strongco.co
VOLVO					T: (905)331-3835
OIL CON	IDITION				F: (905)643-6077
Visc @ 40°C	cSt	40.5	 		
	MINATION				Diagnosis
			 -	-	Resample at the next
Water	%	NEG	 		to monitor.All compo
Silicon	ppm	1 4	 		are normal. There is n
Sodium	ppm	1 0	 		any contamination in condition of the oil is
Potassium	ppm	2	 		the time in service.
VOLVO					
WEAR I	METALS				
Iron	ppm	124	 		
Copper	ppm	3	 		
Lead	ppm	0	 		
Tin	ppm	0	 		
Aluminum	ppm	1	 		
Chromium	ppm	4	 		
Molybdenum	ppm	3	 		
Nickel	ppm		 		
Titanium	ppm	0	 		
Silver	ppm	0	 		
Manganese	ppm	6	 		
Vanadium	ppm	0	 		
Vanadian	ppiii	U			
VOLVO					
	VES				
Calcium	ppm	4021	 		
Magnesium	ppm	12	 		
Zinc	ppm	1593	 		
Phosphorus	ppm	1355	 		
Barium	ppm	0	 		
		- 113			

IENT (CE)

om

t service interval onent wear rates no indication of n the oil. The s acceptable for

Depot: VOLVO0252 Unique No: 5710558 Signed: Wes Davis Report Date: 17 Jan 2024

113


ppm

CONSTRUCTION EQUIPMENT



GRAPHS

VOLVO

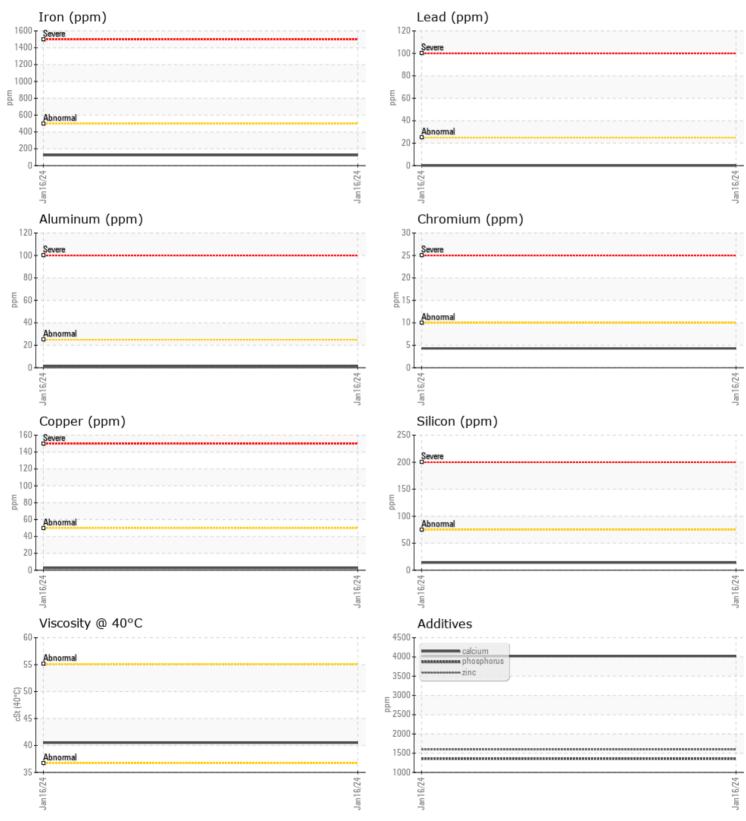

Report Id: VOLVO0252 [WCAMIS] 02609472 (Generated: 01/17/2024 17:53:44) Rev: 1

Contact/Location: Crane - Sue Hooton - VOLVO0252