CONSTRUCTION EQUIPMENT W1218005002 TMT VOLVO L220G 12565 - COOLANT



Sample No: VCP147882

VOLVO

Oil Type: VOLVO COOLANT VCS (YELLOW)

Job No:

Coolant Color

W1218005002 TMT

Yllow

Sample Number	-	VCP147882	VCP150694	
Sample Date		02 May 2019	07 Nov 2015	
Machine Hours		8698	1880	
Sample Status		NORMAL	NORMAL	
COOLANT	CONDITION			
pН	Scale 0-14	7.12	7.20	
Reserve Alkalinity	Scale 0-20			
Nitrites	ppm	0	0	
Percentage Glycol	%	51	53	
Freezing Point	°C	-41	-36	
CONTAMI	NATION			
Coolant Appearance		normal		

Yllow



ALTA EQUIPMENT

5985 COURT STREET ROAD SYRACUSE, NY US 13206 Contact: JIM STRIGLE JIM.STRIGLE@ALTG.COM T: (315)437-2611 F: (315)434-9471

Diagnosis

The fluid is suitable for further service. There is no indication of any contamination in the component. The carboxylate level of this fluid is acceptable. The glycol level is acceptable. The pH level of this fluid is within the acceptable limits.

Depot: VOLVO0142 Unique No: 8591652 Signed: Jonathan Hester Report Date: 10 May 2019 Contact/Location: JIM STRIGLE - VOLVO0142

CONSTRUCTION EQUIPMENT



GRAPHS

e mqq

2

0

14

12

10

핌

ß

2

0

Nov7/15

Nov7/15


pН

Abnorma

Abnorm

Iron/Tin/Silver

VOLVO

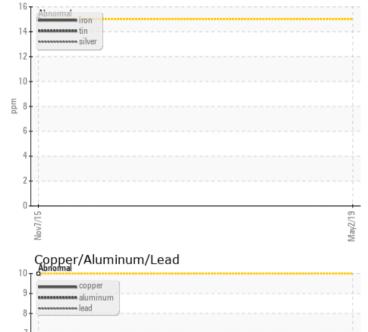

Reserve Alkalinity

May2/19

May2/19.

