CONSTRUCTION EQUIPMENT SPM248741 VOLVO L60H 622097 - REAR RIGHT FINAL DRIVE

Sample No:VCP308329Oil Type:VOLVO WET BRAKE TRANSAXLE OILJob No:SPM248741

SAMPLE INFORMATION

ADDITIVES

ppm

ppm

ppm

ppm

ppm

ppm

Calcium

Zinc

Barium

Boron

Magnesium

Phosphorus

VOLVO

Sample Number		VCP308329				
Sample Date		28 Apr 2021				
Machine Hours		4016				
Oil Hours		0				
Oil Changed		Changed				
Sample Status		NORMAL				
OIL CONDITION						
Visc @ 40°C	cSt	40.1				
CONTAMINATION						
Water	%	NEG				
Silicon	ppm	11				
Sodium	ppm	6				
Potassium	ppm	2				
WEAR MET	TALS					
Iron	ppm	173				
Copper	ppm	5				
Lead	ppm	<1				
Tin	ppm	<1				
Aluminum	ppm	0				
Chromium	ppm	3				
Molybdenum	ppm	■ <1				
Nickel	ppm	1				
Titanium	ppm	<1				
Silver	ppm	0				
Manganese	ppm	3				
Vanadium	ppm	0				



MAPLE RIDGE HARDWOODS

2270 N DOBLER RD STERLING, MI US 48659 Contact: STEVE BENDER mapleridge.shop@aol.com T: (989)873-8185 F:

Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Depot:	MAPSTE		
Unique No:	9500968		
Signed:	Wes Davis		
Report Date:	12 May 2021		

4318

1614

1390

13


0 145

CONSTRUCTION EQUIPMENT



GRAPHS

VOLVO

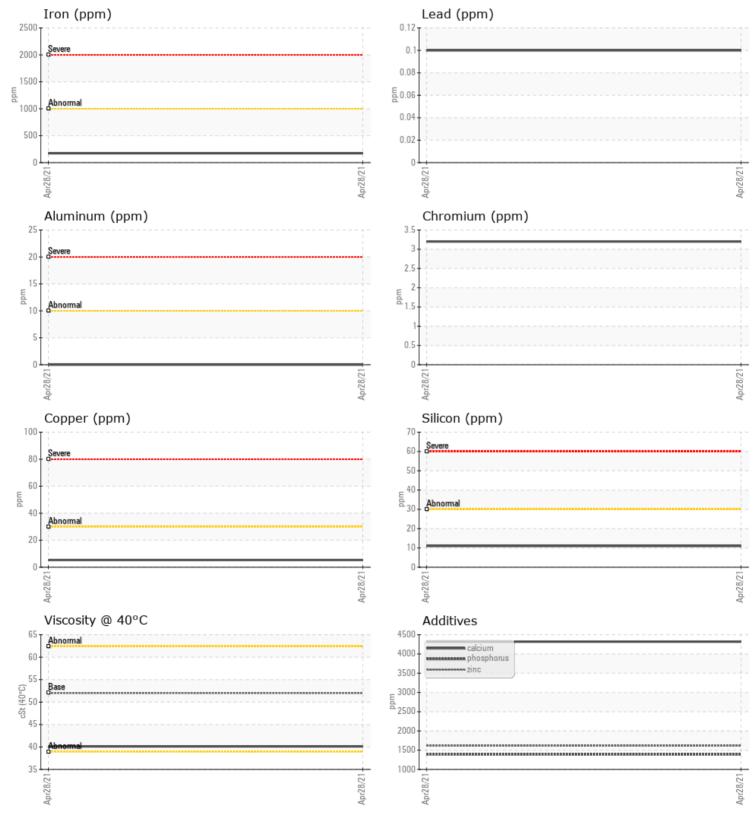

Report Id: MAPSTE [WUSCAR] 05252058 (Generated: 12/05/2023 15:15:38) Rev: 1

Contact/Location: STEVE BENDER - MAPSTE