



CONSTRUCTION EQUIPMENT

642082 TUCKER PAVING VOLVO A25G 740257 - COOLANT



Sample No: VCP310959
Oil Type: VOLVO COOLANT VCS (YELLOW)
Job No: 642082 TUCKER PAVING



SAMPLE INFORMATION

Sample Number	VCP310959	---	---	---
Sample Date	25 Jun 2021	---	---	---
Machine Hours	6077	---	---	---
Sample Status	ABNORMAL	---	---	---

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC
 8418 PALM RIVER ROAD
 TAMPA, FL
 US 33619
 Contact: KC BRASHER
 kc.brasher@altg.com
 T: (813)848-4095
 F: (813)630-2233



COOLANT CONDITION

pH	Scale 0-14	■ 7.49	---	---	---
Reserve Alkalinity	Scale 0-20	---	---	---	---
Nitrites	ppm	■ 0	---	---	---
Percentage Glycol	%	▲ 37	---	---	---
Freezing Point	°C	■ -9	---	---	---

Diagnosis

We recommend drain system, and refill with 50/50 antifreeze water mixture. There is no indication of any contamination in the coolant. The glycol level is lower than acceptable. The carboxylate level of this fluid is acceptable. The pH level of this fluid is within the acceptable limits.



CONTAMINATION

Coolant Appearance	normal	---	---	---
Coolant Color	Orange	---	---	---

Depot: VOLVO0093
Unique No: 9591960
Signed: Doug Bogart
Report Date: 26 Jul 2021



CONSTRUCTION EQUIPMENT




GRAPHS


Iron/Tin/Silver




Reserve Alkalinity

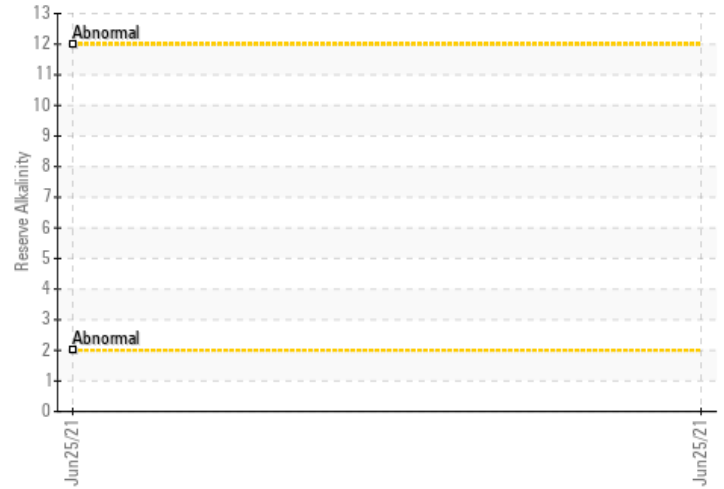


Copper/Aluminum/Lead

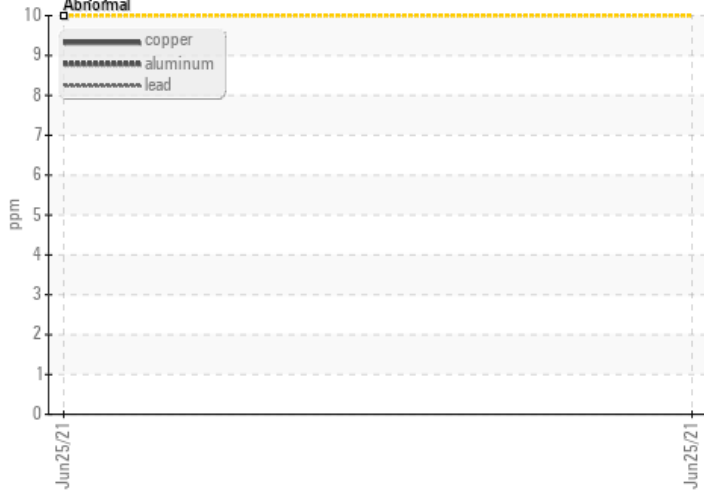

Freeze Point

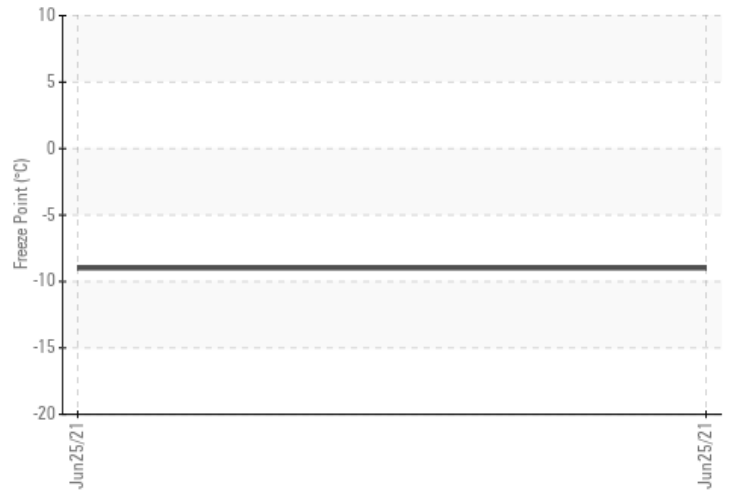

pH

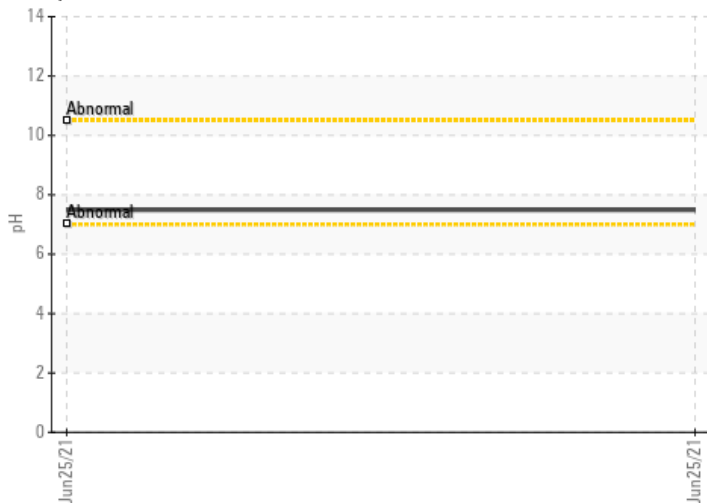

Nitrites

