



CONSTRUCTION EQUIPMENT

VOLVO EC160EL 310364 - COOLANT



Sample No: VCP335945
Oil Type: CHEVRON DELO EXTENDED LIFE COOLANT
Job No:



SAMPLE INFORMATION

| | | | | |
|---------------|-------------|-----|-----|-----|
| Sample Number | VCP335945 | --- | --- | --- |
| Sample Date | 25 Mar 2022 | --- | --- | --- |
| Machine Hours | 3000 | --- | --- | --- |
| Sample Status | NORMAL | --- | --- | --- |

DH FUNK AND SONS LLC
 3995 CONTINENTAL DRIVE
 COLUMBIA, PA
 US 17512
 Contact: GARY SHEPHERD
 GSHEPHERD@DHFUNK.COM
 T:
 F:



COOLANT CONDITION

| | | | | | |
|--------------------|------------|--------|-----|-----|-----|
| pH | Scale 0-14 | ■ 7.71 | --- | --- | --- |
| Reserve Alkalinity | Scale 0-20 | --- | --- | --- | --- |
| Nitrites | ppm | ■ 0 | --- | --- | --- |
| Percentage Glycol | % | ■ 50.3 | --- | --- | --- |
| Freezing Point | °C | ■ -35 | --- | --- | --- |

Diagnosis

The fluid is suitable for further service. There is no indication of any contamination in the coolant. The carboxylate level of this fluid is acceptable. The glycol level is acceptable. The pH level of this fluid is within the acceptable limits.



CONTAMINATION

| | | | | |
|--------------------|--------|-----|-----|-----|
| Coolant Appearance | normal | --- | --- | --- |
| Coolant Color | Orange | --- | --- | --- |

Depot: DHFCOL
Unique No: 9917329
Signed: Doug Bogart
Report Date: 04 Apr 2022



CONSTRUCTION EQUIPMENT




GRAPHS


Iron/Tin/Silver



Reserve Alkalinity

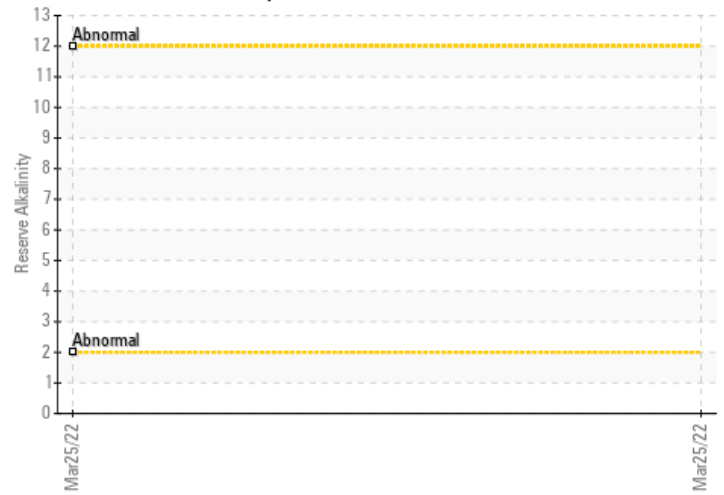


Copper/Aluminum/Lead

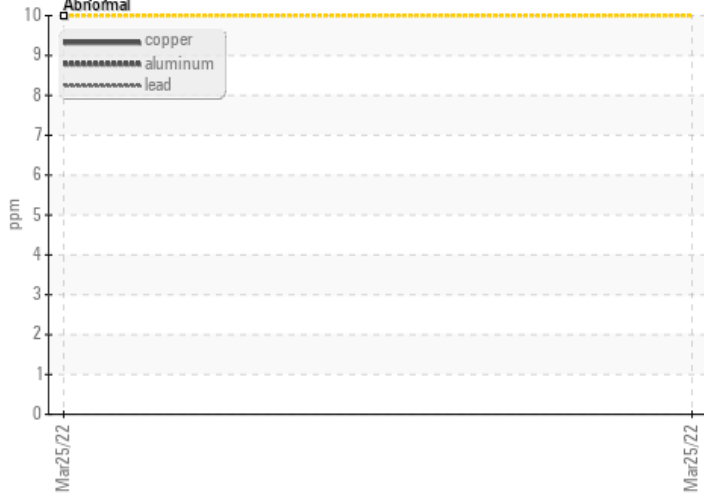

Freeze Point



pH

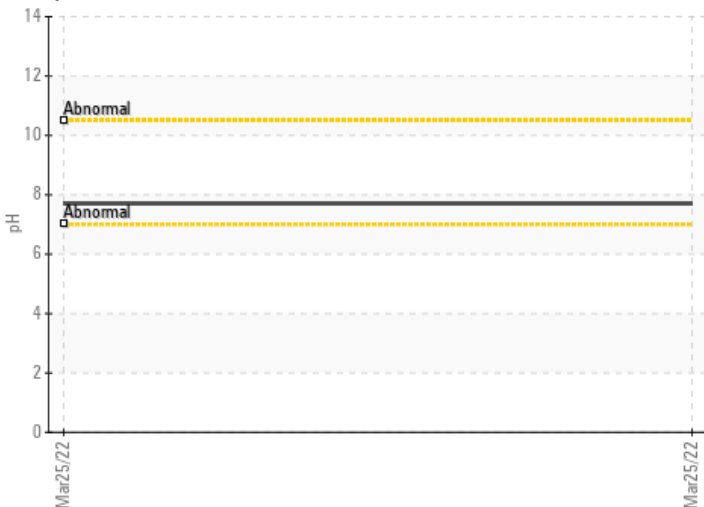

Nitrites

