



CONSTRUCTION EQUIPMENT

SWA14338 VOLVO L110H 632075 - COOLANT



Sample No: VCP370090
Oil Type: EXTENDED LIFE COOLANT
Job No: SWA14338



SAMPLE INFORMATION

Sample Number	VCP370090	VCP354157	---	---
Sample Date	06 Jan 2023	23 Jun 2022	---	---
Machine Hours	2988	1626	---	---
Sample Status	NORMAL	NORMAL	---	---

ALTA EQUIPMENT
 5985 COURT STREET ROAD
 SYRACUSE, NY
 US 13206
 Contact: JIM STRIGLE
 JIM.STRIGLE@ALTG.COM
 T: (315)437-2611
 F: (315)434-9471



COOLANT CONDITION

pH	Scale 0-14	7.59	7.59	---	---
Reserve Alkalinity	Scale 0-20	---	---	---	---
Nitrites	ppm	0	148	---	---
Percentage Glycol	%	42.5	47.4	---	---
Freezing Point	°C	-17	-28	---	---

Diagnosis

No corrective action is recommended at this time. The fluid is suitable for further service. There is no indication of any contamination in the coolant. Carboxylate test failed. The glycol level is acceptable. The pH level of this fluid is within the acceptable limits.



CONTAMINATION

Coolant Appearance	normal	normal	---	---
Coolant Color	Orange	Yllow	---	---

Depot: VOLVO0142
Unique No: 10287142
Signed: Doug Bogart
Report Date: 14 Jan 2023



CONSTRUCTION EQUIPMENT




GRAPHS


Iron/Tin/Silver




Reserve Alkalinity

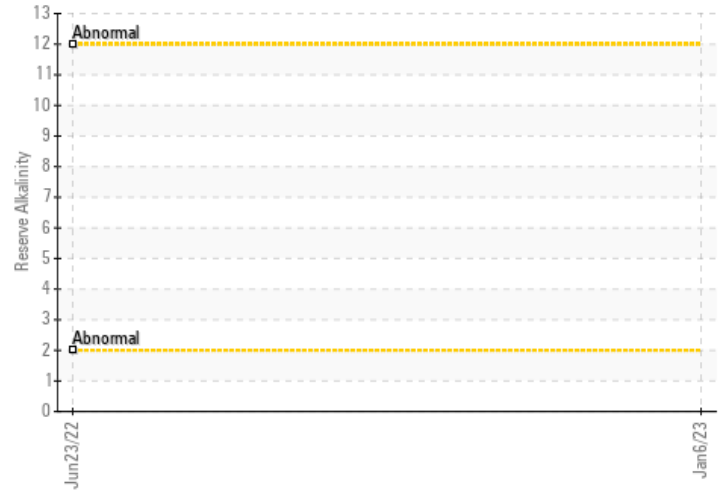


Copper/Aluminum/Lead

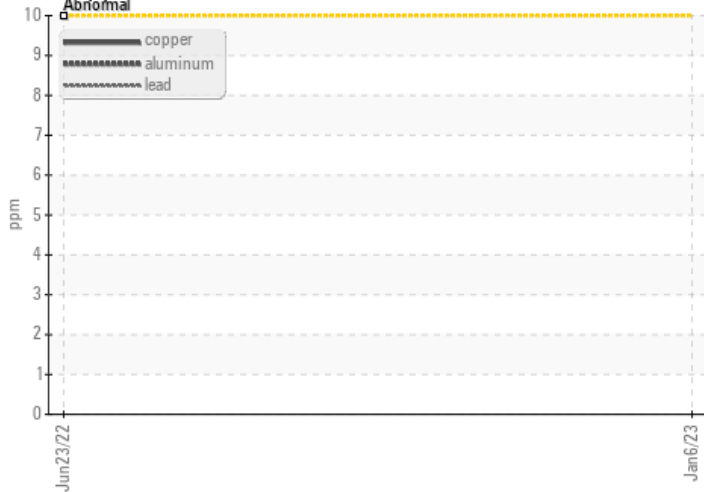

Freeze Point

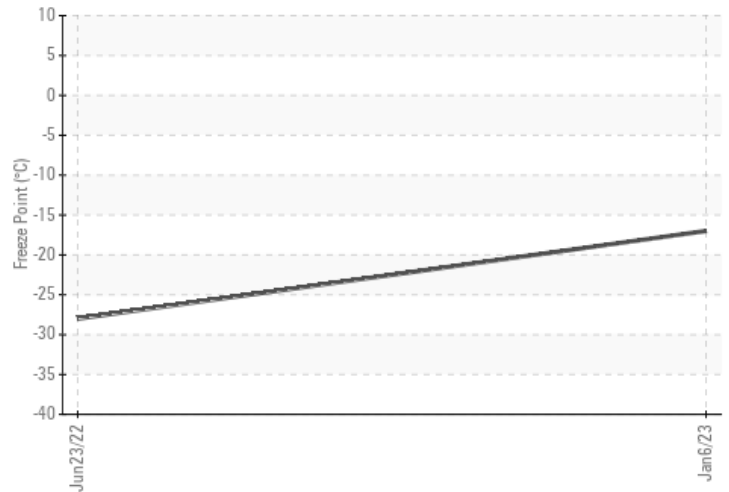

pH

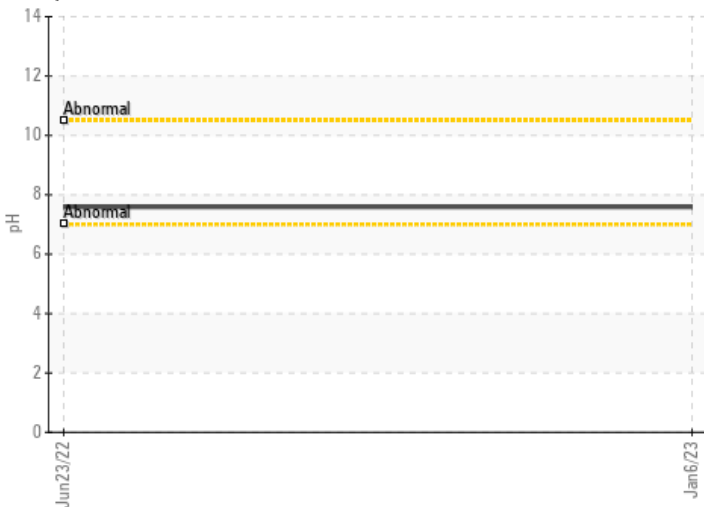

Nitrites

