



CONSTRUCTION EQUIPMENT

SWA150612-10 VOLVO EC220EL 310769 - COOLANT



Sample No: VCP385563
Oil Type: VOLVO COOLANT VCS (YELLOW)
Job No: SWA150612-10



SAMPLE INFORMATION

Sample Number	VCP385563	VCP321788	VCP289224	VCP264660
Sample Date	12 Jan 2023	26 Aug 2021	18 Sep 2020	31 Dec 2019
Machine Hours	6114	4369	3051	2070
Sample Status	NORMAL	NORMAL	NORMAL	NORMAL

ULSTER COUNTY RESOURCE RECOVERY AGENCY
999 FLATBUSH AVE
KINGSTON, NY
US 12401
Contact: CHARLES WHITTAKER
cwhf@ucrra.net
T: (845)399-2686
F:



COOLANT CONDITION

pH	Scale 0-14	6.96	7.18	7.53	7.88
Reserve Alkalinity	Scale 0-20	---	---	---	---
Nitrites	ppm	NT	NT	NT	0
Percentage Glycol	%	53.4	51	51	50
Freezing Point	°C	-43	-42	-40	-38

Diagnosis

The fluid is suitable for further service. There is no indication of any contamination in the coolant. The carboxylate level of this fluid is acceptable. The glycol level is acceptable. The pH level of this fluid is within the acceptable limits.



CONTAMINATION

Coolant Appearance	normal	normal	normal	normal
Coolant Color	Yllow	Green	Yllow	Yllow

Depot: ULSKIN
Unique No: 10332309
Signed: Jonathan Hester
Report Date: 10 Feb 2023




CONSTRUCTION EQUIPMENT




VOLVO GRAPHS


Iron/Tin/Silver

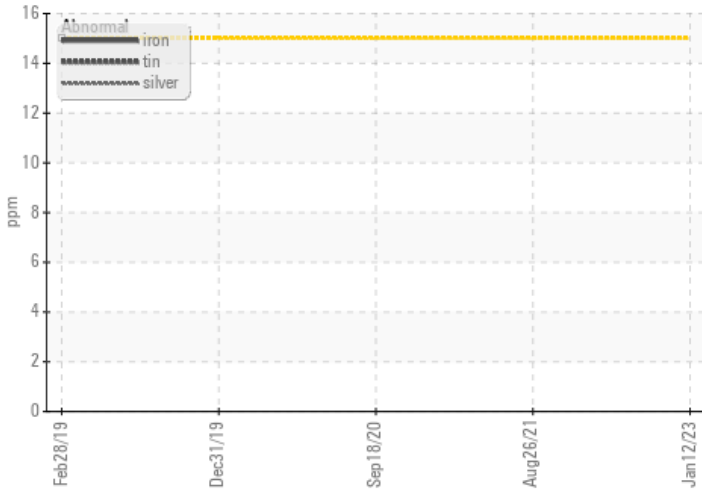


Reserve Alkalinity

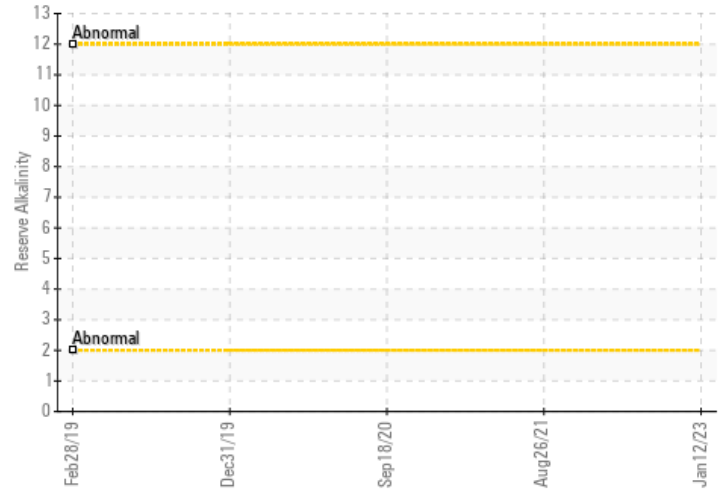


Copper/Aluminum/Lead

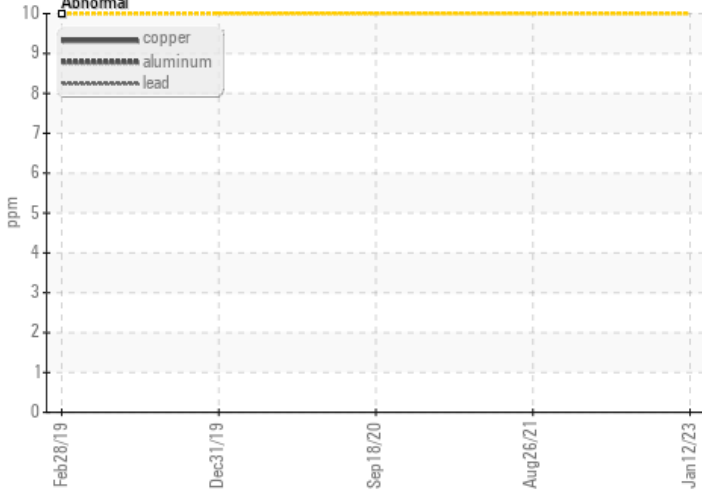

Freeze Point

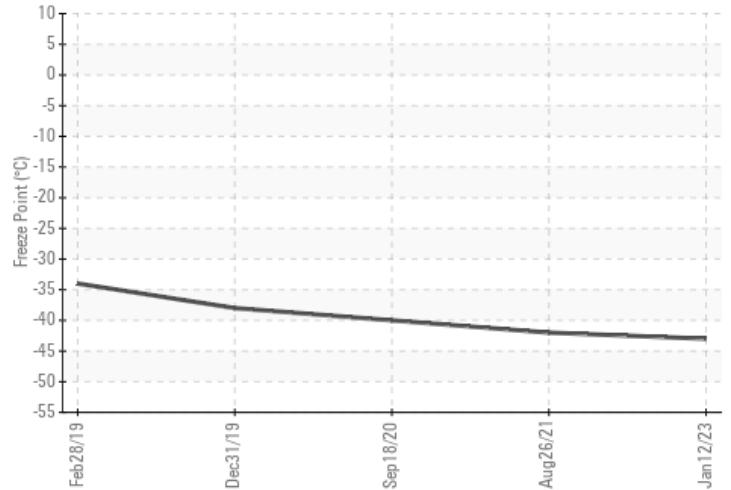

pH

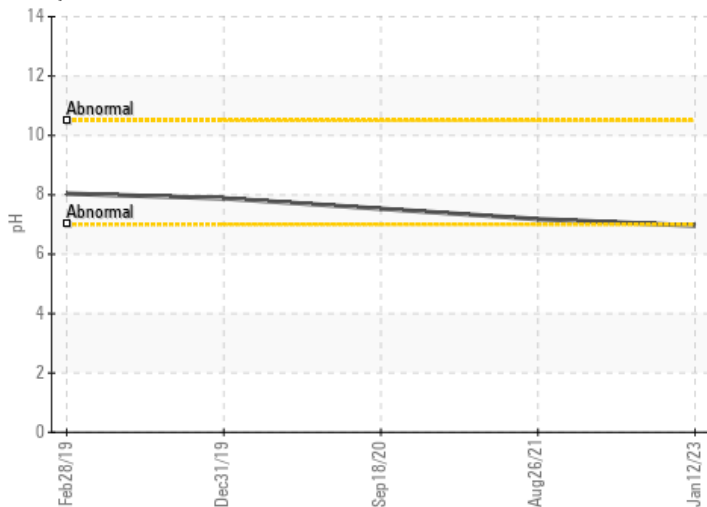

Nitrites

