



# CONSTRUCTION EQUIPMENT

W07012289-1 VOLVO A40G 341458 - REAR LEFT FINAL DRIVE



**Sample No:** VCP399868  
**Oil Type:** TRANSAXLE OIL SAE 75W80  
**Job No:** W07012289-1



## SAMPLE INFORMATION

Sample Number	VCP399868	---	---	---
Sample Date	23 Feb 2023	---	---	---
Machine Hours	6947	---	---	---
Oil Hours	0	---	---	---
Oil Changed	N/A	---	---	---
Sample Status	ABNORMAL	---	---	---

**McClung-Logan Virginia LLC- RICHMOND**  
1345 MOUNTAIN ROAD  
GLEN ALLEN, VA  
US 23060  
Contact: KYLE RATLIFFE  
KRATLIFFE@MCCLUNG-LOGAN.COM  
T:  
F: (804)266-1611



## OIL CONDITION

Visc @ 40°C	cSt	■ 40.7	---	---	---
-------------	-----	--------	-----	-----	-----



## CONTAMINATION

Silicon	ppm	■ 19	---	---	---
Sodium	ppm	■ 5	---	---	---
Potassium	ppm	■ 1	---	---	---

## Diagnosis

Resample at the next service interval to monitor. The copper level is abnormal. All other component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The condition of the oil is acceptable for the time in service.



## WEAR METALS

Iron	ppm	■ 52	---	---	---
Copper	ppm	▲ 320	---	---	---
Lead	ppm	■ 1	---	---	---
Tin	ppm	■ 0	---	---	---
Aluminum	ppm	■ 4	---	---	---
Chromium	ppm	■ 2	---	---	---
Molybdenum	ppm	<1	---	---	---
Nickel	ppm	■ 2	---	---	---
Titanium	ppm	<1	---	---	---
Silver	ppm	<1	---	---	---
Manganese	ppm	■ 2	---	---	---
Vanadium	ppm	■ 0	---	---	---



## ADDITIVES

Calcium	ppm	■ 3911	---	---	---
Magnesium	ppm	■ 15	---	---	---
Zinc	ppm	■ 1532	---	---	---
Phosphorus	ppm	■ 1210	---	---	---
Barium	ppm	<1	---	---	---
Boron	ppm	■ 145	---	---	---

**Depot:** VOLVO8882  
**Unique No:** 10351071  
**Signed:** Angela Borella  
**Report Date:** 27 Feb 2023




# CONSTRUCTION EQUIPMENT




## GRAPHS

### Ferrous Alloys

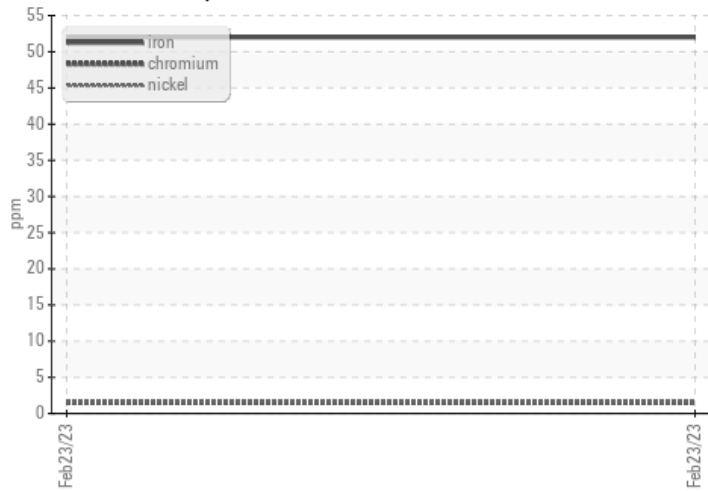

### ▲ Non-ferrous Metals

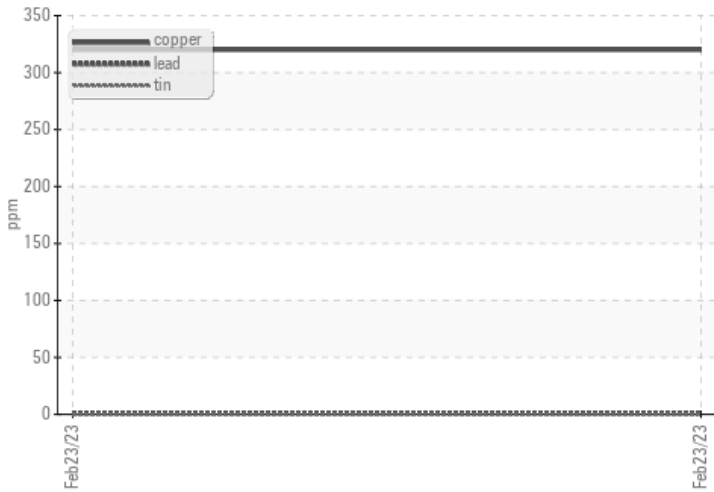

### Viscosity @ 40°C

