CONSTRUCTION EQUIPMENT W0228289 METROPLEX VOLVO EC380E 310236 - HYDRAULICS

Sample No:VCP302884Oil Type:AW HYDRAULIC OIL ISO 46

VOLVO

Job No:

VOLVO

W0228289 METROPLEX

vo	
Ŋ	SAMPLE INFORMATION

Sample Number	-	VCP302884	VCP409723	
Sample Date		02 Jun 2023	19 May 2023	
Machine Hours		10949	14227	
Oil Hours		0	0	
Oil Changed		N/A	Not Changd	
Sample Status		NORMAL	NORMAL	
OIL CONDIT	TION			
Visc @ 40°C	cSt	51.2	51.2	
Acid Number (AN)	mg KOH/g	0.37	0.32	

CONTA	MINATION				
Particles >4µm	-	28226	14676	 	
Particles >6µm		5080	3099	 	
Particles >14µm	1	474	170	 	
ISO 4406:1999 (c)	22/20/16	21/19/15	 	
Silicon	ppm	8	7	 	
Sodium	ppm		<1	 	
Potassium	ppm	0	0	 	

ROMCO INC

1350 NE LOOP 820 FORT WORTH, TX US 76106 Contact: ROB HOLCOMB rholcomb@romco.com T: (817)798-9289 F: (817)626-8983

Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Iron	ppm	6	6	
Copper	ppm	6	5	
Lead	ppm	0	0	
Tin	ppm	0	0	
Aluminum	ppm	 <1	2	
Chromium	ppm	 <1	 <1	
Molybdenum	ppm	 <1	 <1	
Nickel	ppm	0	0	
Titanium	ppm	<1	0	
Silver	ppm	0	0	
Manganese	ppm	 <1	 <1	
Vanadium	ppm	0	0	

VOLVO						
ADDITIVES						
Calcium	ppm	6 1	72			
Magnesium	ppm	2	2			
Zinc	ppm	407	428			
Phosphorus	ppm	303	340			
Barium	ppm	0	0			
Boron	ppm	0	0			

 Depot:
 VOLVO0081

 Unique No:
 10507587

 Signed:
 Wes Davis

 Report Date:
 09 Jun 2023

Report Id: VOLVO0081 [WUSCAR] 05867803 (Generated: 07/10/2023 13:46:52) Rev: 1

Contact/Location: ROB HOLCOMB - VOLVO0081


CONSTRUCTION EQUIPMENT



GRAPHS

Ferrous Alloys

VOLVO

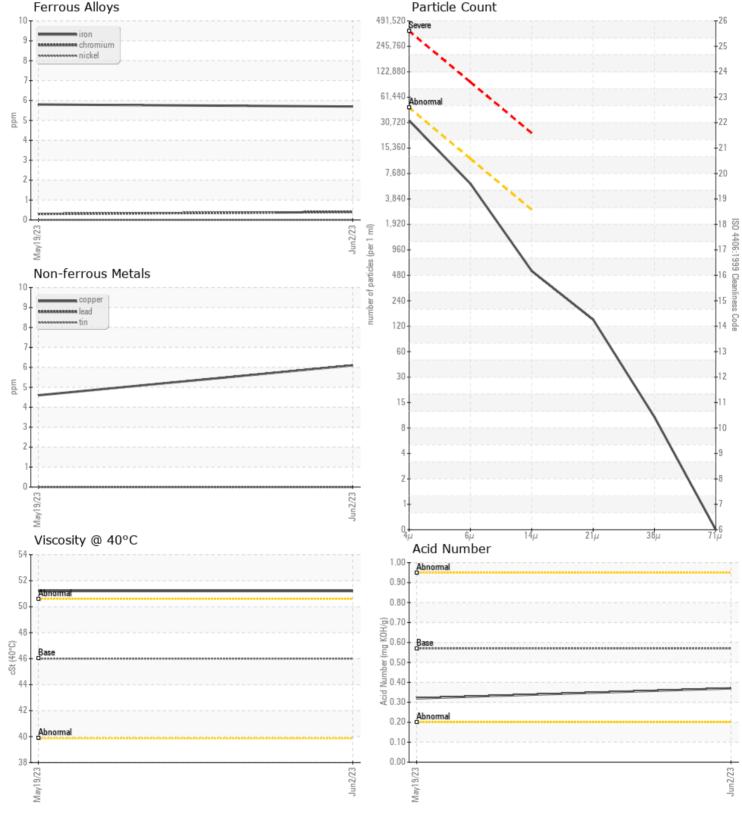

Report Id: VOLVO0081 [WUSCAR] 05867803 (Generated: 07/10/2023 13:46:55) Rev: 1

Contact/Location: ROB HOLCOMB - VOLVO0081