



CONSTRUCTION EQUIPMENT

SWO-063332 VOLVO A30G 752677 - COOLANT



Sample No: VCP424157
Oil Type: VOLVO COOLANT VCS (YELLOW)
Job No: SWO-063332



SAMPLE INFORMATION

Sample Number	VCP424157	VCP368395	VCP363641	---
Sample Date	23 Jun 2023	18 Nov 2022	11 Aug 2022	---
Machine Hours	2405	915	434	---
Sample Status	NORMAL	NORMAL	NORMAL	---



COOLANT CONDITION

pH	Scale 0-14	7.58	7.84	8.32	---
Reserve Alkalinity	Scale 0-20	---	---	---	---
Nitrites	ppm	NT	NT	NT	---
Percentage Glycol	%	48.4	48.9	48.4	---
Freezing Point	°C	-31	-31	-31	---



CONTAMINATION

Coolant Appearance	normal	normal	normal	---
Coolant Color	Yllow	Yllow	Yllow	---

SAIIA CONSTRUCTION LLC

4400 LEWISBURG RD
BIRMINGHAM, AL
US 35207

Contact: STEPHANI BRITTON
sbritton@saiia.com;doug.bogart@wearcheck.com
T: (205)943-2268
F: (205)943-2269

Diagnosis

No corrective action is recommended at this time. The fluid is suitable for further service. There is no indication of any contamination in the coolant. Carboxylate test failed. The glycol level is acceptable. The pH level of this fluid is within the acceptable limits.

Depot: SAIBIR
Unique No: 10536522
Signed: Doug Bogart
Report Date: 02 Jul 2023




CONSTRUCTION EQUIPMENT




GRAPHS


Iron/Tin/Silver

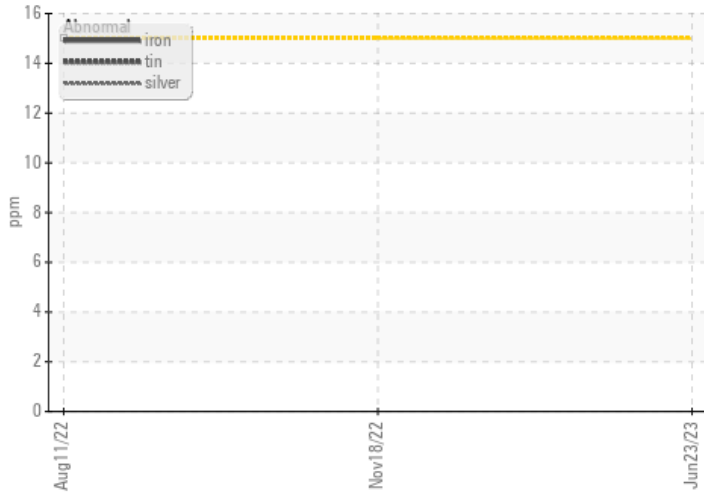


Reserve Alkalinity

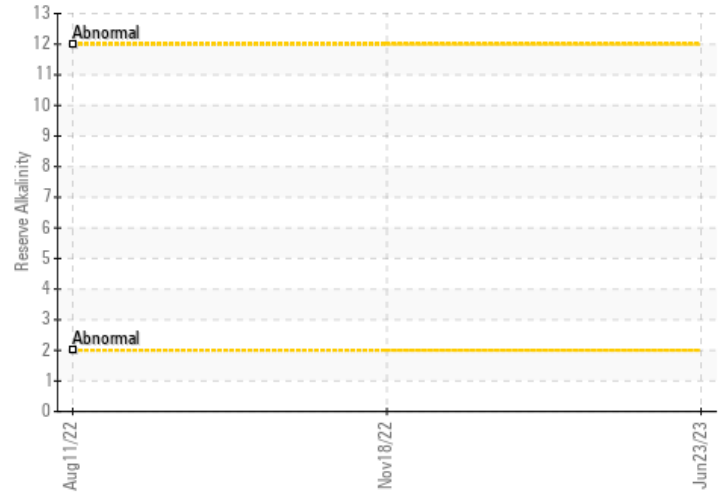


Copper/Aluminum/Lead

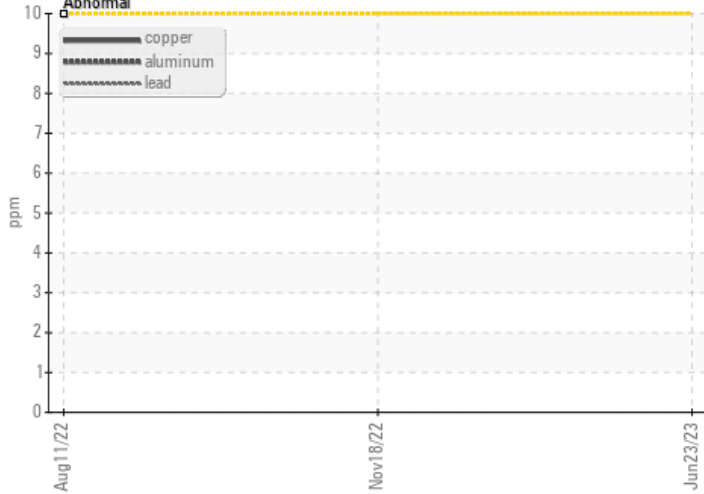

Freeze Point

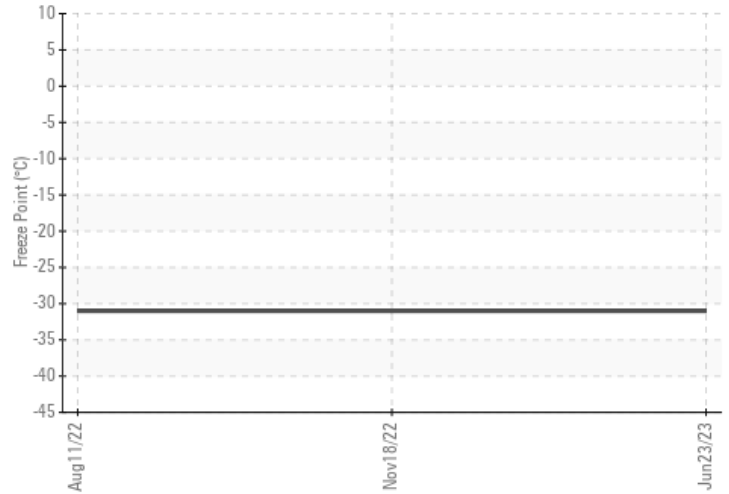

pH

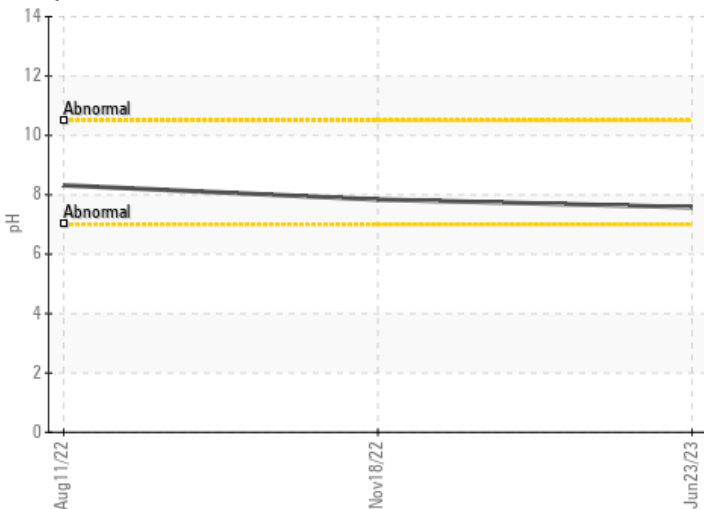

Nitrites

