CONSTRUCTION EQUIPMENT BECKNER CONST VOLVO EC480 315121 - HYDRAULIC SYSTEM

Sample No:VCP422873Oil Type:VOLVO SUPER HYDRAULIC OIL 46

VOLVO

Job No:

BECKNER CONST

SAMPLE INFORMATION

Sample Number		VCP422873			
Sample Date		30 Jun 2023			
Machine Hours		511			
Oil Hours		0			
Oil Changed		Not Changd			
Sample Status		NORMAL			
OIL CONDIT	ION				
Visc @ 40°C	cSt	42.6			
Acid Number (AN)	mg KOH/g	0.45			

Particles >4µm	-	18998	 	
Particles >6µm		2653	 	
Particles >14µm		67	 	
ISO 4406:1999 (d	2)	21/19/13	 	
Silicon	ppm	2	 	
Sodium	ppm	0	 	
Potassium	ppm	0	 	

WEAR METALS

	'IL I ALD			
Iron	ppm	□ <1	 	
Copper	ppm	7	 	
Lead	ppm	0	 	
Tin	ppm	0	 	
Aluminum	ppm	0	 	
Chromium	ppm	0	 	
Molybdenum	ppm	0	 	
Nickel	ppm	0	 	
Titanium	ppm	0	 	
Silver	ppm	0	 	
Manganese	ppm	0	 	
Vanadium	ppm	<1	 	

Calcium	ppm	93			
Magnesium	ppm	0			
Zinc	ppm	538			
Phosphorus	ppm	432			
Barium	ppm	0			
Boron	ppm	0			



ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC

8418 PALM RIVER ROAD TAMPA, FL US 33619 Contact: KENNY HANEY khaney@flaglerce.com T: (813)630-0077 F: (813)630-2233

Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

 Depot:
 VOLVO0093

 Unique No:
 10551884

 Signed:
 Wes Davis

 Report Date:
 13 Jul 2023

Report Id: VOLVO0093 [WUSCAR] 05896074 (Generated: 07/17/2023 23:59:55) Rev: 1


Contact/Location: KENNY HANEY - VOLVO0093

CONSTRUCTION EQUIPMENT



GRAPHS

VOLVO

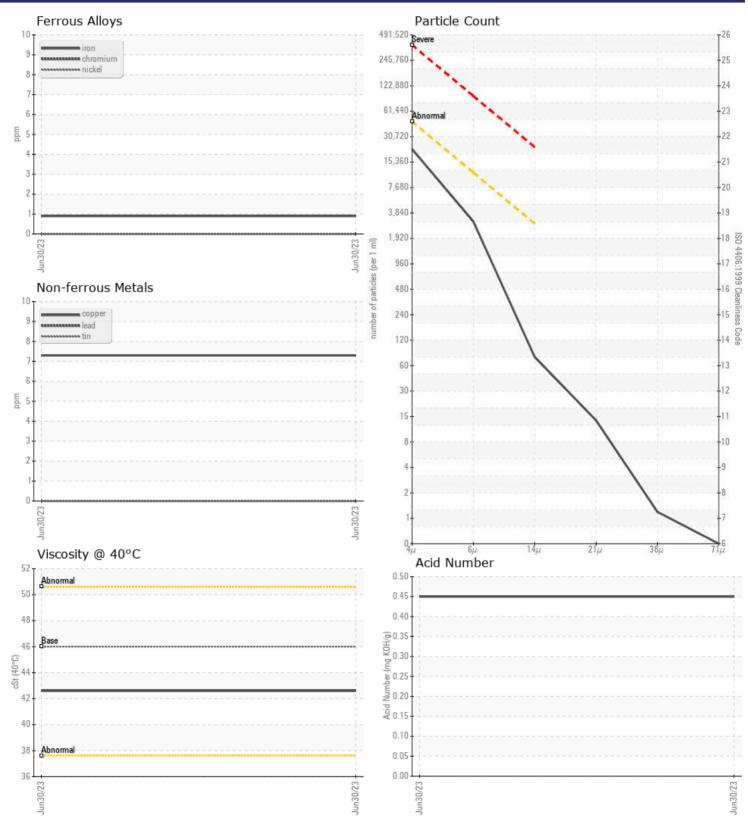

Contact/Location: KENNY HANEY - VOLVO0093