



CONSTRUCTION EQUIPMENT

10658 HERC RENTALS VOLVO L70H 624618 - HYDRAULIC SYSTEM



Sample No: VCP414500
Oil Type: NOT GIVEN
Job No: 10658 HERC RENTALS



SAMPLE INFORMATION

Sample Number	VCP414500	---	---	---
Sample Date	11 Jul 2023	---	---	---
Machine Hours	775	---	---	---
Oil Hours	0	---	---	---
Oil Changed	N/A	---	---	---
Sample Status	ABNORMAL	---	---	---

HOFFMAN EQUIPMENT - LIONVILLE

120 GORDON DRIVE
LIONVILLE, PA
US 19341
Contact: JIM FEHR
jim.fehr@hoffmanequip.com
T: (610)363-9200
F: (610)594-0829



OIL CONDITION

Visc @ 40°C	cSt	█ 42.8	---	---	---
Acid Number (AN)	mg KOH/g	█ 0.37	---	---	---



CONTAMINATION

Silicon	ppm	█ 3	---	---	---
Sodium	ppm	█ 1	---	---	---
Potassium	ppm	█ <1	---	---	---



WEAR METALS

Iron	ppm	█ 3	---	---	---
Copper	ppm	█ 2	---	---	---
Lead	ppm	█ <1	---	---	---
Tin	ppm	█ 0	---	---	---
Aluminum	ppm	█ 0	---	---	---
Chromium	ppm	█ <1	---	---	---
Molybdenum	ppm	<1	---	---	---
Nickel	ppm	█ 0	---	---	---
Titanium	ppm	0	---	---	---
Silver	ppm	0	---	---	---
Manganese	ppm	<1	---	---	---
Vanadium	ppm	<1	---	---	---



ADDITIVES

Calcium	ppm	59	---	---	---
Magnesium	ppm	3	---	---	---
Zinc	ppm	441	---	---	---
Phosphorus	ppm	346	---	---	---
Barium	ppm	0	---	---	---
Boron	ppm	0	---	---	---

Diagnosis

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample. All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Depot: VOLVO8879
Unique No: 10559869
Signed: Jonathan Hester
Report Date: 17 Jul 2023




CONSTRUCTION EQUIPMENT




GRAPHS


Ferrous Alloys

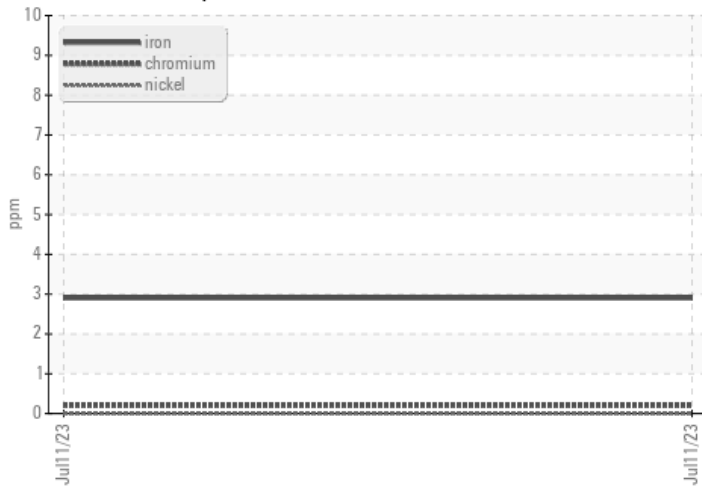

Non-ferrous Metals

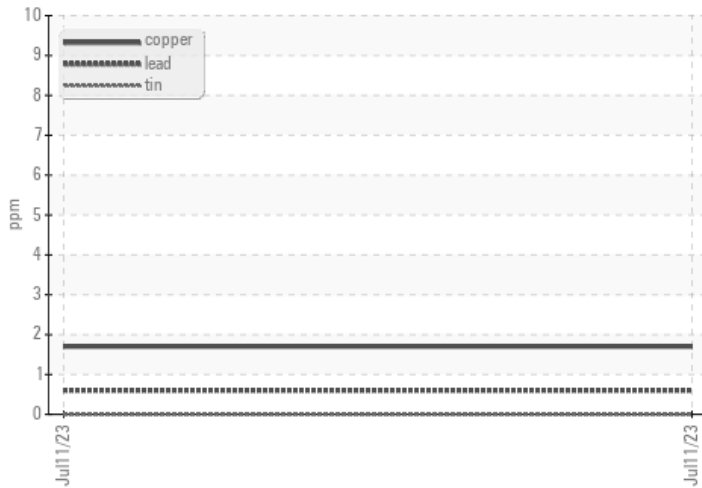

Viscosity @ 40°C

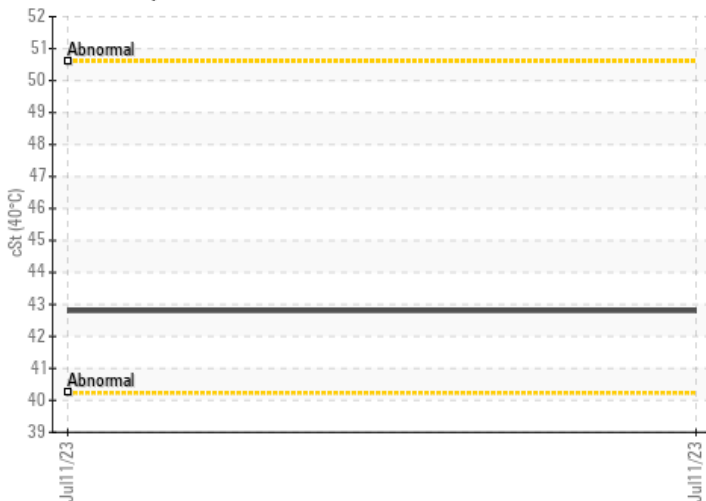

Acid Number

