



CONSTRUCTION EQUIPMENT

SPM579946 VOLVO A25G 752572 - TRANSMISSION (AUTO)



Sample No: VCP418354
Oil Type: VOLVO AUTOMATIC TRANSMISSION FLUID AT102
Job No: SPM579946



ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC
8418 PALM RIVER ROAD
TAMPA, FL
US 33619
Contact: KENNY HANEY
khaney@flaglerce.com
T: (813)630-0077
F: (813)630-2233



SAMPLE INFORMATION

Sample Number	VCP418354	---	---	---
Sample Date	11 Jul 2023	---	---	---
Machine Hours	421	---	---	---
Oil Hours	0	---	---	---
Oil Changed	Not Chngd	---	---	---
Sample Status	NORMAL	---	---	---



OIL CONDITION

Visc @ 40°C	cSt	█ 28.8	---	---	---
-------------	-----	--------	-----	-----	-----



CONTAMINATION

Silicon	ppm	█ 15	---	---	---
Sodium	ppm	█ 4	---	---	---
Potassium	ppm	█ 5	---	---	---



WEAR METALS

Iron	ppm	█ 15	---	---	---
Copper	ppm	█ 14	---	---	---
Lead	ppm	█ <1	---	---	---
Tin	ppm	█ 2	---	---	---
Aluminum	ppm	█ 11	---	---	---
Chromium	ppm	█ <1	---	---	---
Molybdenum	ppm	█ 0	---	---	---
Nickel	ppm	█ <1	---	---	---
Titanium	ppm	█ 0	---	---	---
Silver	ppm	█ 0	---	---	---
Manganese	ppm	█ 3	---	---	---
Vanadium	ppm	█ 0	---	---	---



ADDITIVES

Calcium	ppm	█ 74	---	---	---
Magnesium	ppm	█ 0	---	---	---
Zinc	ppm	█ 26	---	---	---
Phosphorus	ppm	█ 212	---	---	---
Barium	ppm	█ 0	---	---	---
Boron	ppm	█ 90	---	---	---

Diagnosis

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the fluid. The condition of the fluid is acceptable for the time in service.

Depot: VOLVO0093
Unique No: 10564022
Signed: Wes Davis
Report Date: 20 Jul 2023



CONSTRUCTION EQUIPMENT




GRAPHS

Iron (ppm)




Lead (ppm)

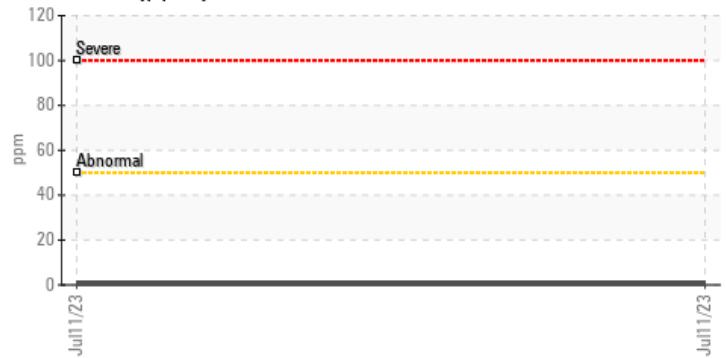

Aluminum (ppm)




Chromium (ppm)

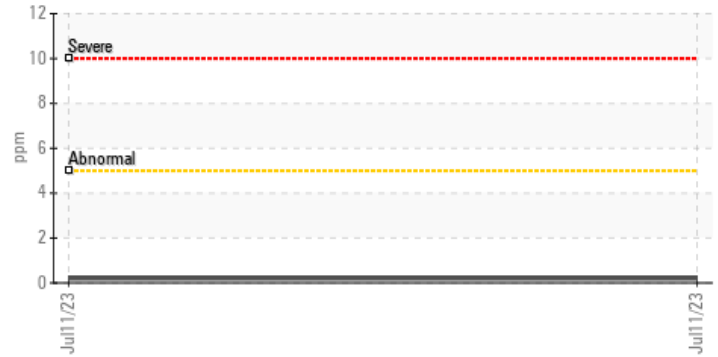

Copper (ppm)



Silicon (ppm)

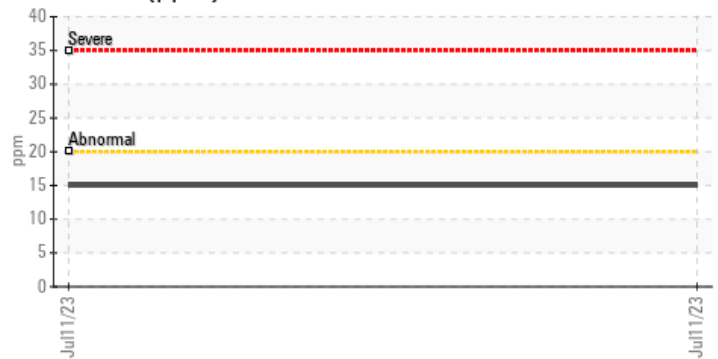

Viscosity @ 40°C



Additives

