CONSTRUCTION EQUIPMENT SPM580766 SENNEBOGEN 825M 825.0.3853 - REAR LEFT FINAL D


 Sample No:
 VCP420182

 Oil Type:
 GEAR OIL SAE 80W90

 Job No:
 SPM580766

VOLVO

## SAMPLE INFORMATION VCP420182 Sample Number Sample Date 25 Jul 2023 Machine Hours 636 Oil Hours 0 Oil Changed Not Changd ATTENTION Sample Status **OIL CONDITION** Visc @ 40°C cSt **64.5** CONTAMINATION Silicon ppm 10 Sodium 16 ppm Potassium **||** <1 ppm WEAR METALS Iron ppm 12 Copper ppm 5 Lead ppm ■ <1 0 Tin ppm Aluminum ppm 0 🔲 Chromium ppm ■ <1 Molybdenum **||** <1 ppm Nickel 0 ppm Titanium <1 ppm Silver 0 ppm Manganese 2 ppm Vanadium ppm <1 **ADDITIVES**





## ALTA EQUIPMENT CO - ORLAND PARK

5000 INDUSTRIAL HWY GARY, IN US 46406 Contact: DAVE ENG DAVE.ENG@ALTG.COM T: (312)350-2560 F:

## Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The oil viscosity is lower than normal. Confirm oil type.

 Depot:
 VOLVO8885

 Unique No:
 10586803

 Signed:
 Don Baldridge


 Report Date:
 04 Aug 2023

## **CONSTRUCTION EQUIPMENT**



GRAPHS

VOLVO

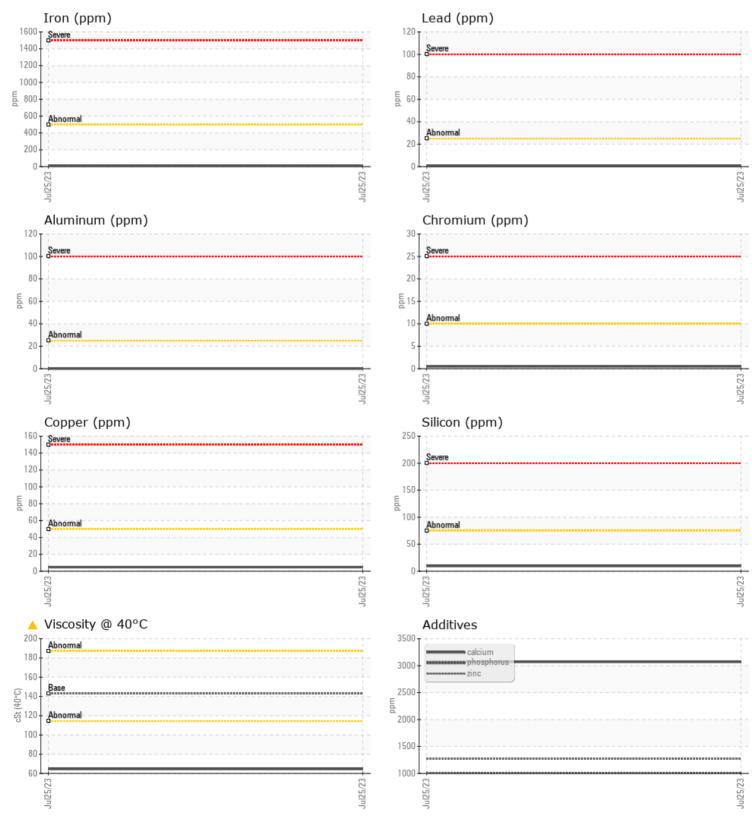

Report Id: VOLVO8885 [WUSCAR] 05914889 (Generated: 08/08/2023 13:36:12) Rev: 1

Contact/Location: DAVE ENG - VOLVO8885