CONSTRUCTION EQUIPMENT 326128 VOLVO A30G 752892 - HYDRAULIC SYSTEM



Sample No: VCP417350 Oil Type: VOLVO SUPER I

326128

VOLVO

pe: VOLVO SUPER HYDRAULIC OIL 46

Job No:

SAMPLE INFORMATION

VCP417350										
10 Aug 2023										
661										
0										
Not Changd										
NORMAL										
OIL CONDITION										
50.1										
H/g 0.62										
0										

CONTAMINATION Particles >4µm 5891 Particles >6µm 1422 Particles >14µm 60 🔲 20/18/13 ISO 4406:1999 (c) Silicon ppm 6 Sodium ppm 3 Potassium ppm ■<1



ALTA EQUIPMENT

5985 COURT STREET ROAD SYRACUSE, NY US 13206 Contact: JIM STRIGLE JIM.STRIGLE@ALTG.COM T: (315)437-2611 F: (315)434-9471

Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

WEAR METALS

Iron	ppm	2	 	
Copper	ppm	2	 	
Lead	ppm	 <1	 	
Tin	ppm	 <1	 	
Aluminum	ppm	 <1	 	
Chromium	ppm	0	 	
Molybdenum	ppm	2	 	
Nickel	ppm	0	 	
Titanium	ppm	<1	 	
Silver	ppm	0	 	
Manganese	ppm	 <1	 	
Vanadium	ppm	<1	 	

Calcium	ppm	735						
Magnesium	ppm	16						
Zinc	ppm	584						
Phosphorus	ppm	462						
Barium	ppm	1						
Boron	ppm	25						

 Depot:
 VOLVO0142

 Unique No:
 10603268

 Signed:
 Wes Davis


 Report Date:
 15 Aug 2023

CONSTRUCTION EQUIPMENT



GRAPHS

VOLVO

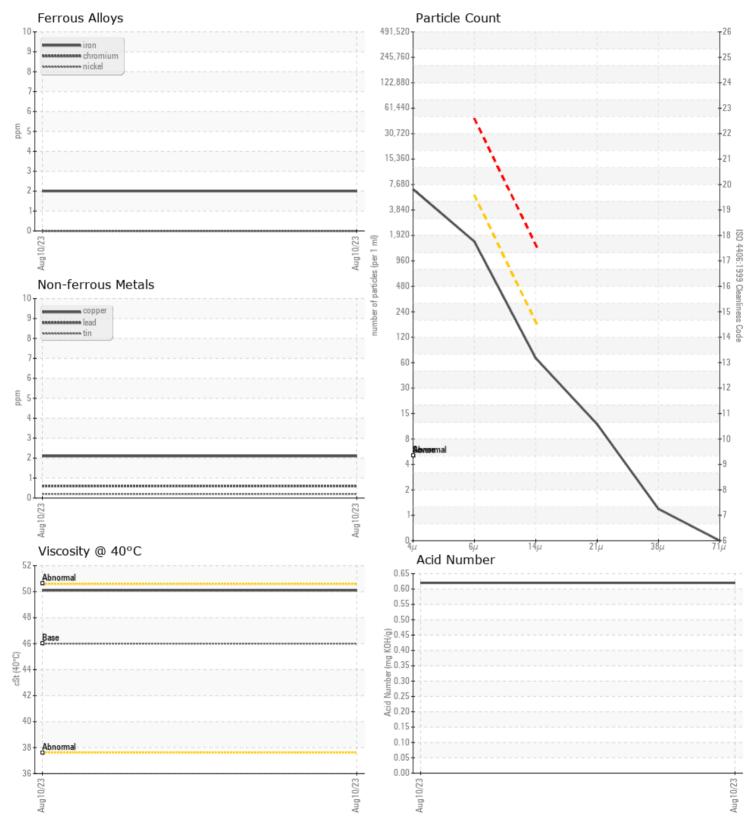

Report Id: VOLVO0142 [WUSCAR] 05923321 (Generated: 08/15/2023 09:37:37) Rev: 1

Contact/Location: JIM STRIGLE - VOLVO0142