CONSTRUCTION EQUIPMENT TITAN AMERICA VOLVO L90H 625035 - HYDRAULIC SYSTEM

Sample No:VCP425801Oil Type:VOLVO SUPE

VOLVO

:	VOLVO SUPER HYDRAULIC OIL 46

Job No:

TITAN AMERICA

SAMPLE IN	FORMATION					
Sample Number		VCP425801				
Sample Date		26 Jul 2023				
Machine Hours		3481				
Oil Hours		0				
Oil Changed		N/A				
Sample Status		ABNORMAL				
Visc @ 40°C	cSt	<b>42.6</b>				
Acid Number (AN)	mg KOH/g	0.31				
CONTAMINATION						
Particles >4µm	-	<u> </u>				

Particles >6µm		🔺 5744	 	
Particles >14µm		<u> </u>	 	
ISO 4406:1999 (c)	)	22/20/15	 	
Silicon	ppm	4	 	
Sodium	ppm	0	 	
Potassium	ppm	∎1	 	

## WEAR METALS

Iron	ppm	<b>1</b> 3	 	
Copper	ppm	3	 	
Lead	ppm	2	 	
Tin	ppm	<b>  </b> <1	 	
Aluminum	ppm	0	 	
Chromium	ppm	3	 	
Molybdenum	ppm	<b></b> <1	 	
Nickel	ppm	0	 	
Titanium	ppm	0	 	
Silver	ppm	0	 	
Manganese	ppm	0	 	
Vanadium	ppm	0	 	

ADDITI	VES			
Calcium	ppm	87	 	
Magnesium	ppm	6	 	
Zinc	ppm	456	 	
Phosphorus	ppm	339	 	
Barium	ppm	□ <1	 	
Boron	ppm	0	 	



ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC 8418 PALM RIVER ROAD TAMPA, FL US 33619 Contact: KENNY HANEY khaney@flaglerce.com T: (813)630-0077

## Diagnosis

F: (813)630-2233

We recommend you service the filters on this component. We recommend an early resample to monitor this condition.All component wear rates are normal. There is a moderate amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

Depot:	VOLVO0093
Unique No:	10606013
Signed:	Wes Davis
Report Date:	17 Aug 2023


Contact/Location: KENNY HANEY - VOLVO0093

## **CONSTRUCTION EQUIPMENT**



GRAPHS

VOLVO

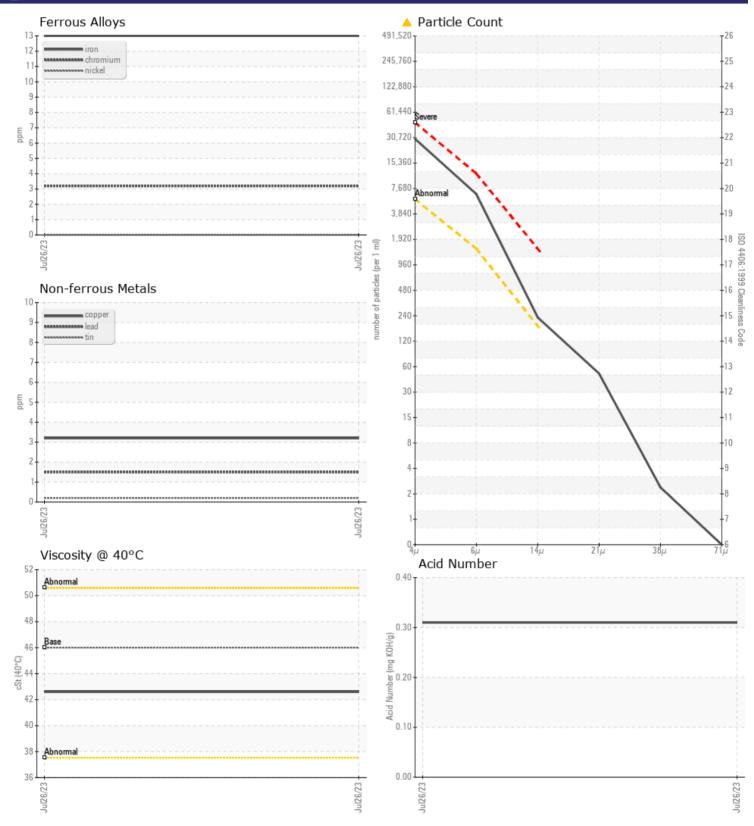

Report Id: VOLVO0093 [WUSCAR] 05926066 (Generated: 08/18/2023 15:37:51) Rev: 1

Contact/Location: KENNY HANEY - VOLVO0093