

# **CONSTRUCTION EQUIPMENT** VOLVO EC200EL 314937 - DIESEL EXHAUST FLUID (DEF)



## Sample No: VCP412374

Oil Type:	DEF (Diesel Exaust Fluid)
•	

Job No:

Sample Number	INFORMATION	VCP412374	 	
Sample Date		08 Aug 2023	 	
Machine Hours		0	 	
Oil Hours		0	 	
Oil Changed		N/A	 	
Sample Status		NORMAL	 	
CONTAM	INATION			
Hydrocarbon	scalar		 	
DEF CONDITION				
Urea Content	%	32.4	 	
Density @ 20°C	g/cm3	1.0880	 	
Refracting Index		1.3822	 	
Appearance	scalar	🔲 Clear & Bright	 	



#### ALTA EQUIPMENT COMPANY

5151 DR MARTIN LUTHER KING BLVD FORT MYERS, FL US 33905 Contact: DEWAYNE BEARD DBeard@flaglerce.com T: (239)481-8554 F: (239)481-3302

### Diagnosis

Fluid meets ISO 22241-2 requirements and is suitable for use. Appearance is acceptable. There is no indication of any contamination in the diesel exhaust fluid (def). Urea content is normal.

 Depot:
 VOLVO0090

 Unique No:
 10606458

 Signed:
 Doug Bogart

 Report Date:
 22 Aug 2023

# **CONSTRUCTION EQUIPMENT**




GRAPHS

#### Urea %

VOLVO

35.0		τ.
34.8-		i.
34.6		
34.4		
34.2		
34.0	Severe	Ì
33.8		
33.6		1
33.4		1
33.2	Abnormal	l
33.0-		1
% oz.o		
Conte		
32.8 32.6 32.4 32.4 32.4 32.2		
		1
32.0	· · · · · · · · · · · · · · · · · · ·	ì
31.8	Abnormal	
31.6		l
31.4		
31.2	Severe	
31.0		1
30.8		i
30.6		
30.4		i i
30.2 -		1
30.0	۲ ۲	+3
	Aug8/23 -	∿∩Bn
	A	Ľ,

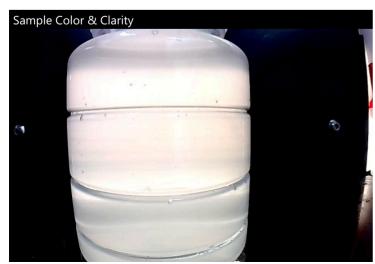

Report Id: VOLVO0090 [WUSCAR] 05926511 (Generated: 08/22/2023 21:34:05) Rev: 1