



CONSTRUCTION EQUIPMENT

VOLVO L120H 631027 - TRANSMISSION (AUTO)



Sample No: VCP396879
Oil Type: VOLVO AUTOMATIC TRANSMISSION FLUID AT102
Job No:



SAMPLE INFORMATION

Sample Number	VCP396879	---	---	---
Sample Date	25 Jul 2023	---	---	---
Machine Hours	1641	---	---	---
Oil Hours	0	---	---	---
Oil Changed	N/A	---	---	---
Sample Status	NORMAL	---	---	---

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC
 8418 PALM RIVER ROAD
 TAMPA, FL
 US 33619
 Contact: KENNY HANEY
 khaney@flaglerce.com
 T: (813)630-0077
 F: (813)630-2233



OIL CONDITION

Visc @ 40°C	cSt	█ 28.2	---	---	---
-------------	-----	--------	-----	-----	-----



CONTAMINATION

Silicon	ppm	█ 11	---	---	---
Sodium	ppm	█ 0	---	---	---
Potassium	ppm	█ 1	---	---	---



WEAR METALS

Iron	ppm	█ 49	---	---	---
Copper	ppm	█ 5	---	---	---
Lead	ppm	█ <1	---	---	---
Tin	ppm	█ 0	---	---	---
Aluminum	ppm	█ 4	---	---	---
Chromium	ppm	█ <1	---	---	---
Molybdenum	ppm	█ <1	---	---	---
Nickel	ppm	█ 0	---	---	---
Titanium	ppm	0	---	---	---
Silver	ppm	█ 0	---	---	---
Manganese	ppm	█ 6	---	---	---
Vanadium	ppm	0	---	---	---



ADDITIVES

Calcium	ppm	█ 85	---	---	---
Magnesium	ppm	█ 3	---	---	---
Zinc	ppm	█ 31	---	---	---
Phosphorus	ppm	█ 191	---	---	---
Barium	ppm	█ 6	---	---	---
Boron	ppm	█ 73	---	---	---

Diagnosis

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Depot: VOLVO0093
Unique No: 10607577
Signed: Sean Felton
Report Date: 18 Aug 2023




CONSTRUCTION EQUIPMENT




GRAPHS


Iron (ppm)

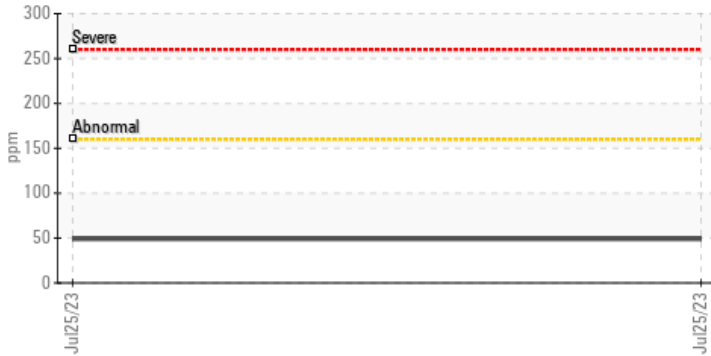


Lead (ppm)

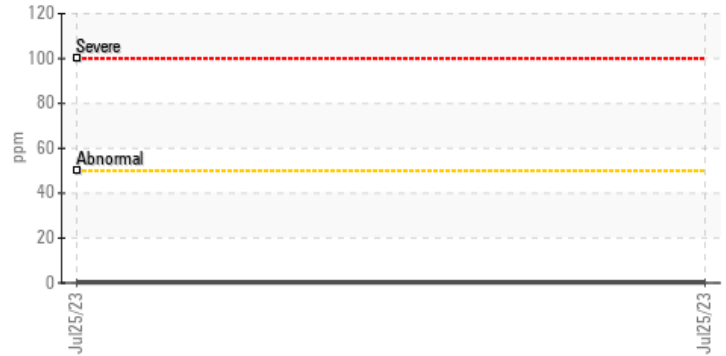

Aluminum (ppm)

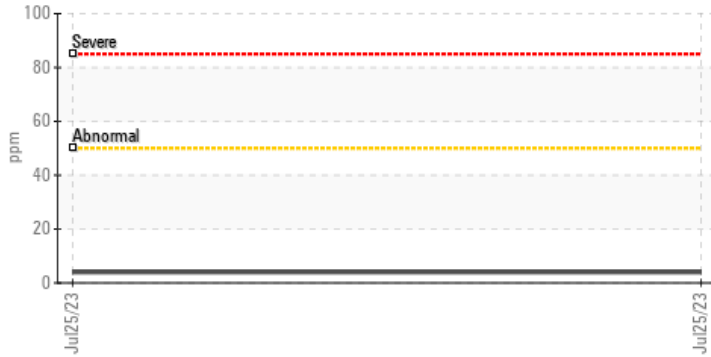


Chromium (ppm)

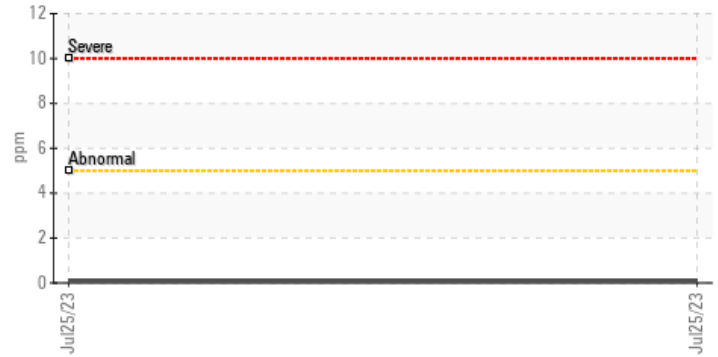

Copper (ppm)



Silicon (ppm)

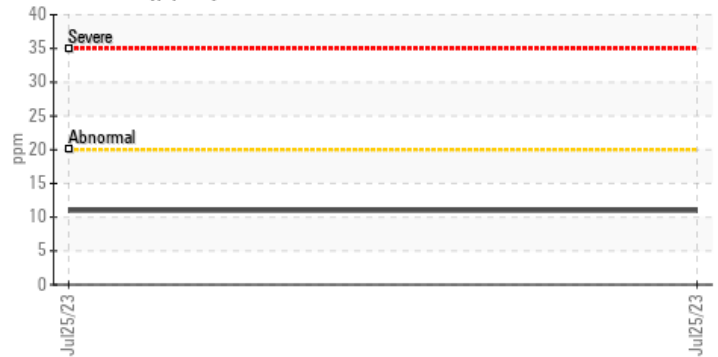

Viscosity @ 40°C



Additives

