**CONSTRUCTION EQUIPMENT** 23853 VOLVO EC350E 314354 - HYDRAULIC SYSTEM



Sample No: VCP426873 <u>оч</u> т

VOLVO

Oil Type:	VOLVO SUPER HYDRAULIC OIL 46
Job No:	23853

## SAMPLE INFORMATION

Sample Number	-	VCP426873	 	
Sample Date		12 Aug 2023	 	
Machine Hours		1796	 	
Oil Hours		0	 	
Oil Changed		N/A	 	
Sample Status		NORMAL	 	
OIL CONDI	TION			
Visc @ 40°C	cSt	<b>42.9</b>	 	
Acid Number (AN)	mg KOH/g	0.63	 	
CONTAMIN	IATION			

Particles >4µm	-	2109	 	
Particles >6µm		234	 	
Particles >14µm	ı	22	 	
ISO 4406:1999 (	(c)	18/15/12	 	
Silicon	ppm	3	 	
Sodium	ppm	0	 	
Potassium	ppm	<b>1</b>	 	

## CAD METAL

WEAK I	METALS			
Iron	ppm	4	 	
Copper	ppm	31	 	
Lead	ppm	<b></b> <1	 	
Tin	ppm	0	 	
Aluminum	ppm	■ <1	 	
Chromium	ppm		 	
Molybdenum	ppm	<b></b> <1	 	
Nickel	ppm	0	 	
Titanium	ppm	0	 	
Silver	ppm	<1	 	
Manganese	ppm	0	 	
Vanadium	ppm	0	 	

### NNITIVES

	AL7			
Calcium	ppm	162	 	
Magnesium	ppm	2	 	
Zinc	ppm	586	 	
Phosphorus	ppm	<b>432</b>	 	
Barium	ppm	0	 	
Boron	ppm	0	 	



#### 218 - ASCENDUM MACHINERY INC - N. CHARLESTON

7235 CROSS COUNTRY RD. NORTH CHARLESTON, SC US 29418 Contact: MATT MITCHAM matt.mitcham@ascendummachinery.com T: F: (843)414-1129

### Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


Depot: VOLVO3387 Unique No: 10608066 Signed: Wes Davis Report Date: 21 Aug 2023

## **CONSTRUCTION EQUIPMENT**



# GRAPHS

VOLVO

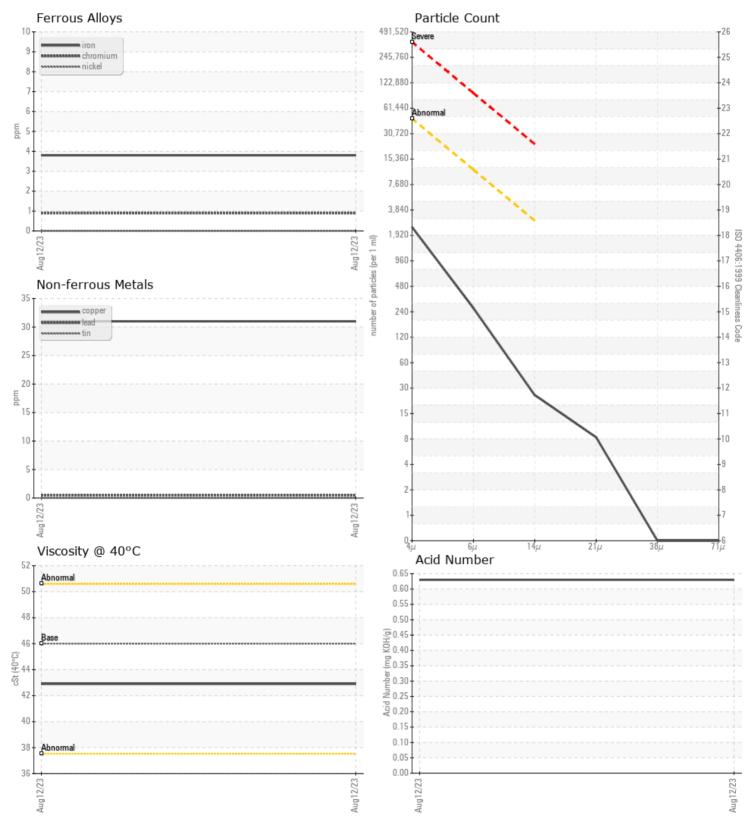

Report Id: VOLVO3387 [WUSCAR] 05928119 (Generated: 08/21/2023 09:12:39) Rev: 1

Contact/Location: MATT MITCHAM - VOLVO3387