



CONSTRUCTION EQUIPMENT

SWA305088-10 VOLVO L220H 3195 - COOLANT



Sample No: VCP419113
Oil Type: VOLVO COOLANT VCS (YELLOW)
Job No: SWA305088-10



SAMPLE INFORMATION

Sample Number	VCP419113	VCP390308	VCP336158	VCP332104
Sample Date	21 Aug 2023	01 Nov 2022	20 Jun 2022	04 Jan 2022
Machine Hours	10636	8642	7636	6556
Sample Status	NORMAL	NORMAL	NORMAL	NORMAL

CALLANAN INDUSTRIES
 93 SULLIVAN RD
 MONTICELLO, NY
 US 12701
 Contact: Service Manager



COOLANT CONDITION

pH	Scale 0-14	7.04	7.07	7.11	7.11
Reserve Alkalinity	Scale 0-20	---	---	---	---
Nitrites	ppm	NT	NT	0	0
Percentage Glycol	%	52.5	51.6	51.3	50.9
Freezing Point	°C	-40	-38	-38	-35

T:
F:



CONTAMINATION

Coolant Appearance	normal	normal	normal	normal
Coolant Color	Yllow	Yllow	Yllow	Yllow

Diagnosis

No corrective action is recommended at this time. The fluid is suitable for further service. There is no indication of any contamination in the coolant. Carboxylate test failed. The glycol level is acceptable. The pH level of this fluid is within the acceptable limits.

Depot: CALMONNY
Unique No: 10617795
Signed: Doug Bogart
Report Date: 26 Aug 2023




CONSTRUCTION EQUIPMENT




VOLVO GRAPHS


Iron/Tin/Silver

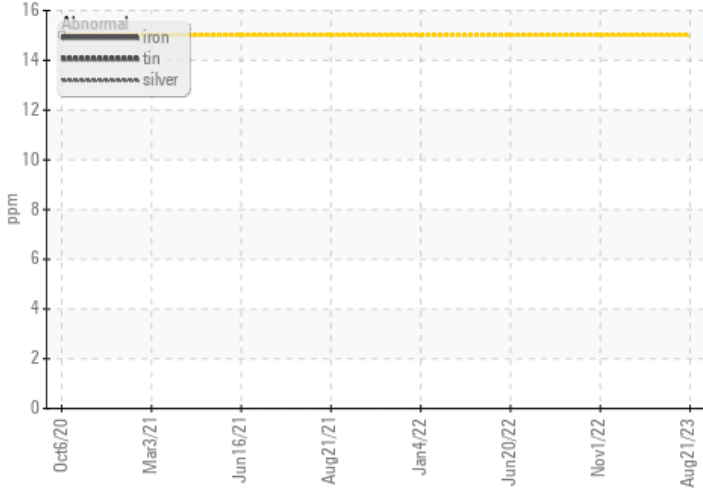


Reserve Alkalinity

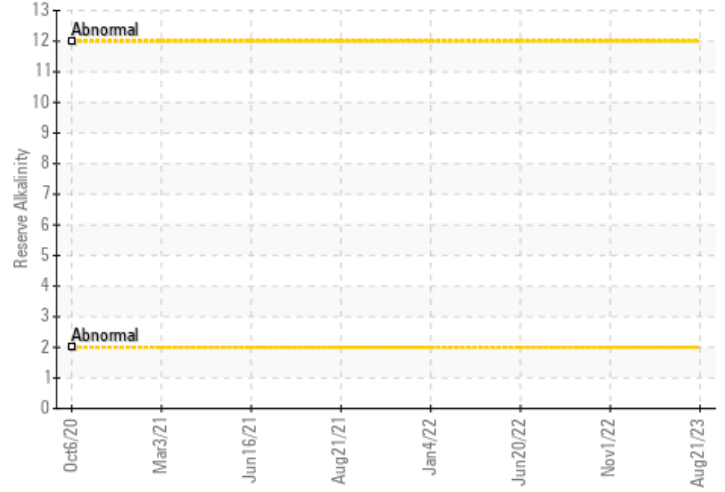


Copper/Aluminum/Lead

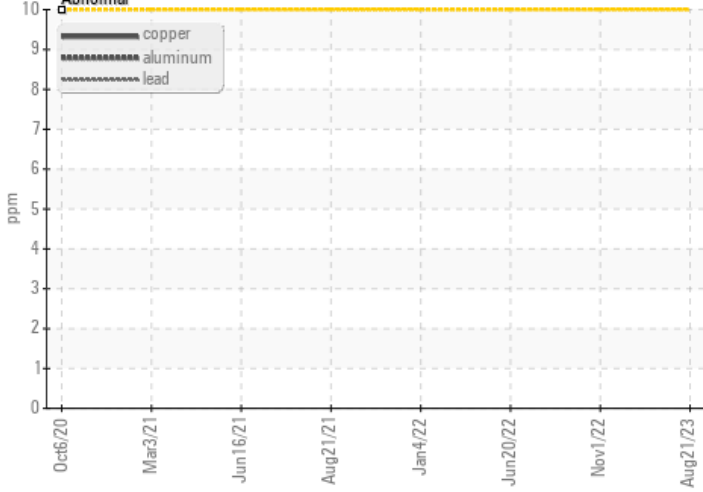

Freeze Point

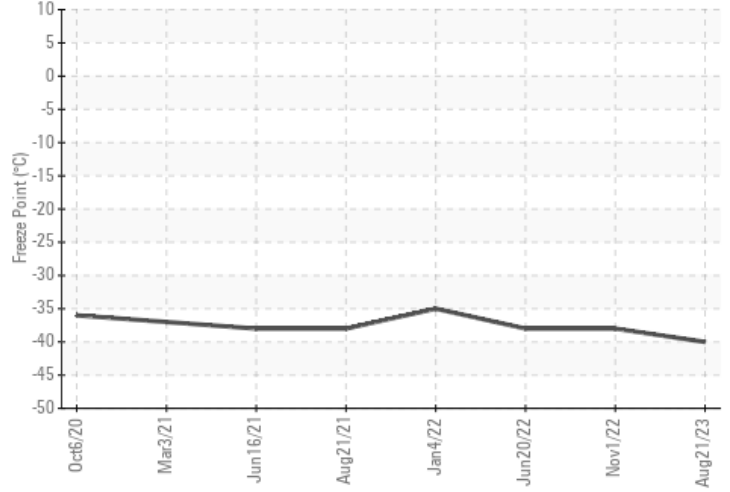

pH

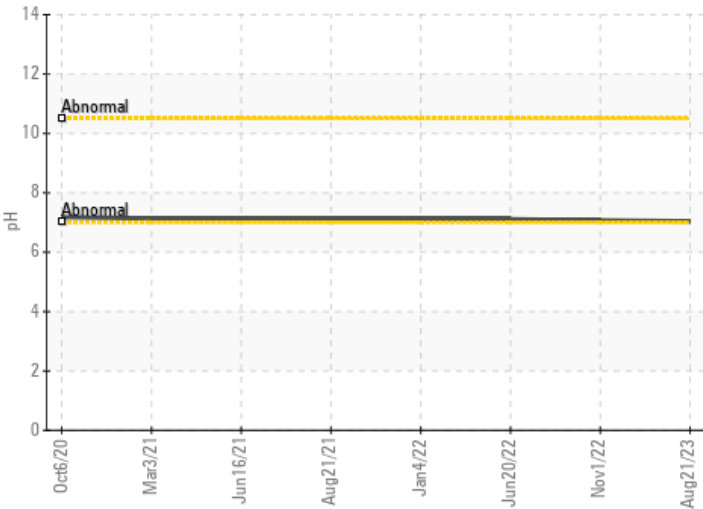

Nitrites

