CONSTRUCTION EQUIPMENT 593983 RYAN GOLF VOLVO A45G 342685 - HYDRAULIC SYSTEM

Sample No:VCP411830Oil Type:VOLVO SUPER HYDRAULIC OIL 46

VOLVO

Job No:

593983 RYAN GOLF

SAMPLE II	NFORMATION					
Sample Number	-	VCP411830				
Sample Date		11 Aug 2023				
Machine Hours		4733				
Oil Hours		4733				
Oil Changed		Changed				
Sample Status		NORMAL				
OIL CONDITION						
Visc @ 40°C	cSt	38.7				
Acid Number (AN)	mg KOH/g	0.46				
VOLVO	-					

CONTAMINATION Particles >4µm 579 Particles >6µm 107 Particles >14µm 34 ISO 4406:1999 (c) 16/14/12 Silicon ppm 10 Sodium ppm 0 Potassium ppm 1

WEAR METALS

Iron	ppm	1 6	 	
Copper	ppm	4	 	
Lead	ppm	4	 	
Tin	ppm	 <1	 	
Aluminum	ppm	3	 	
Chromium	ppm	 <1	 	
Molybdenum	ppm	 <1	 	
Nickel	ppm	0	 	
Titanium	ppm	<1	 	
Silver	ppm	0	 	
Manganese	ppm	0	 	
Vanadium	ppm	0	 	

	IAE2			
Calcium	ppm	50	 	
Magnesium	ppm	2	 	
Zinc	ppm	410	 	
Phosphorus	ppm	303	 	
Barium	ppm	0	 	
Boron	ppm	0	 	



ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC

8418 PALM RIVER ROAD TAMPA, FL US 33619 Contact: KENNY HANEY khaney@flaglerce.com T: (813)630-0077 F: (813)630-2233

Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

 Depot:
 VOLVO0093

 Unique No:
 10620128

 Signed:
 Wes Davis

 Report Date:
 28 Aug 2023


CONSTRUCTION EQUIPMENT



Ferrous Alloys

GRAPHS

VOLVO

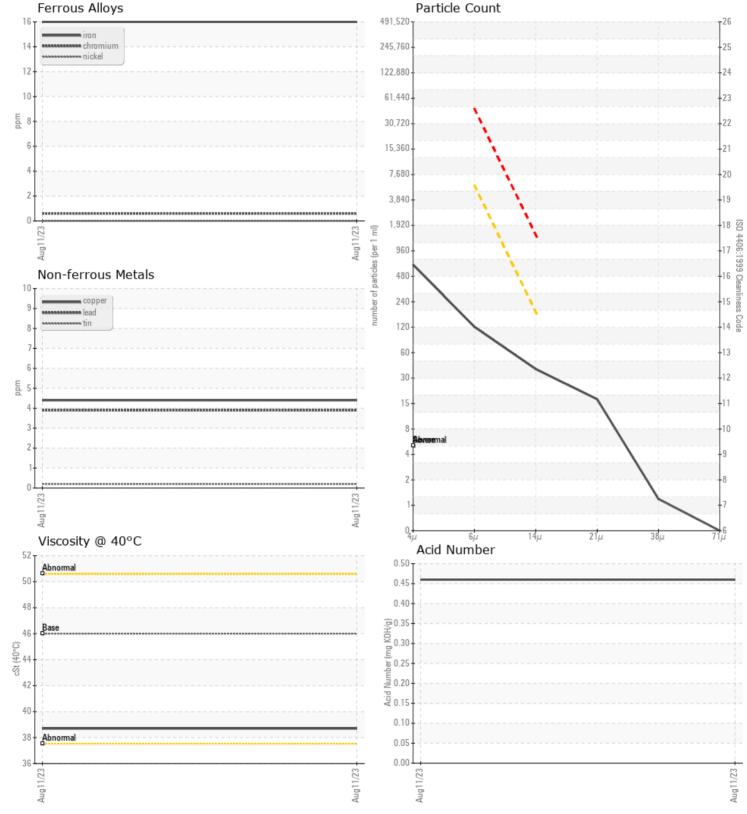

Report Id: VOLVO0093 [WUSCAR] 05934857 (Generated: 08/29/2023 17:42:14) Rev: 1

Contact/Location: KENNY HANEY - VOLVO0093