



CONSTRUCTION EQUIPMENT

VOLVO A25G 740250 - COOLANT



Sample No: VCP412167
Oil Type: VOLVO COOLANT VCS (YELLOW)
Job No:



SAMPLE INFORMATION

Sample Number	VCP412167	---	---	---
Sample Date	28 Aug 2023	---	---	---
Machine Hours	5525	---	---	---
Sample Status	ABNORMAL	---	---	---

ALTA EQUIPMENT COMPANY
 5151 DR MARTIN LUTHER KING BLVD
 FORT MYERS, FL
 US 33905
 Contact: TODD LARK
 tlark@altaequipfl.com
 T:
 F: (239)481-3302



COOLANT CONDITION

pH	Scale 0-14	■ 8.13	---	---	---
Reserve Alkalinity	Scale 0-20	---	---	---	---
Nitrites	ppm	■ 0	---	---	---
Percentage Glycol	%	■ 40.0	---	---	---
Freezing Point	°C	■ -13	---	---	---

Diagnosis

We advise that you check for the source of oil entry. We recommend drain/flush system, and refill with 50/50 antifreeze water mixture. Oil present. Carboxylate test failed. The glycol level is acceptable. The pH level of this fluid is within the acceptable limits.



CONTAMINATION

Coolant Appearance	▲ oil	---	---	---
Coolant Color	Yllow	---	---	---

Depot: VOLVO0090
Unique No: 10633425
Signed: Doug Bogart
Report Date: 08 Sep 2023



CONSTRUCTION EQUIPMENT




GRAPHS


Iron/Tin/Silver




Reserve Alkalinity

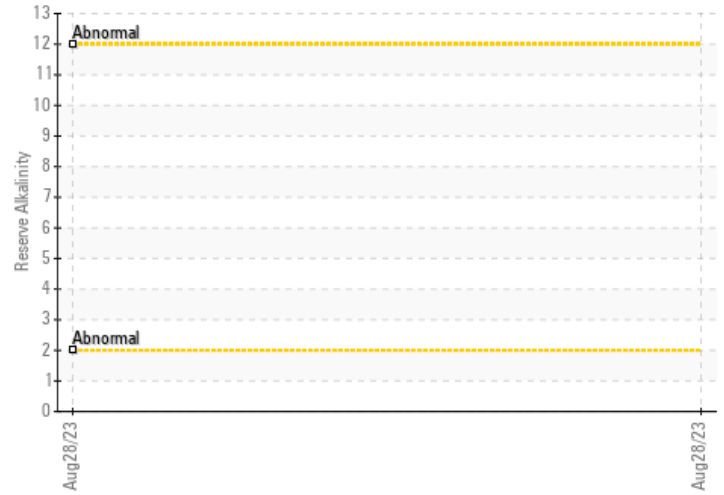


Copper/Aluminum/Lead

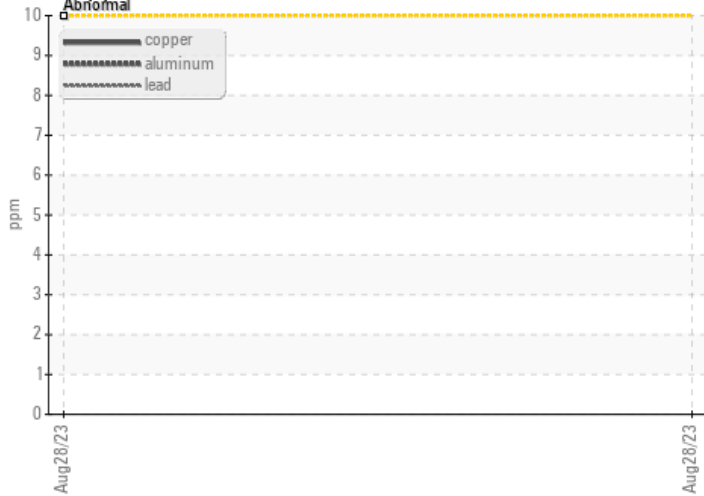

Freeze Point

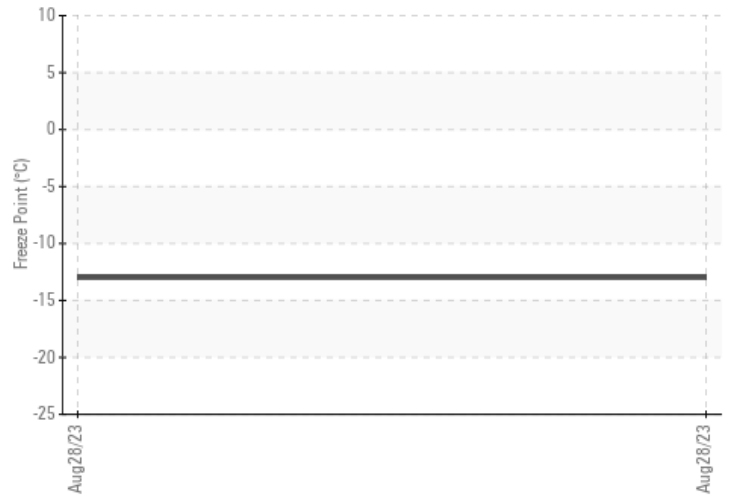

pH

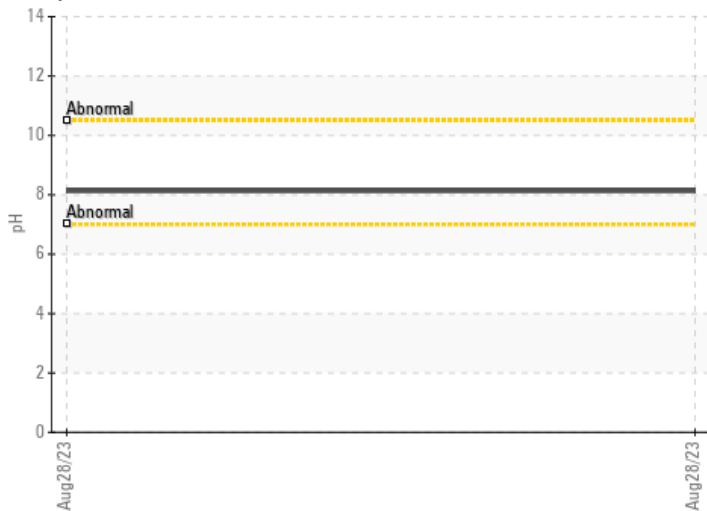

Nitrites

