



# CONSTRUCTION EQUIPMENT

## VOLVO A40G 352236 - COOLANT



**Sample No:** VCP0008033  
**Oil Type:** VOLVO COOLANT VCS (YELLOW)  
**Job No:**



### SAMPLE INFORMATION

Sample Number	<b>VCP0008033</b>	VCP388994	---	---
Sample Date	<b>05 Sep 2023</b>	29 Jul 2022	---	---
Machine Hours	<b>6099</b>	6099	---	---
Sample Status	<b>NORMAL</b>	NORMAL	---	---

**ALTA EQUIPMENT COMPANY**  
 8750 PHILIPS HWY  
 JACKSONVILLE, FL  
 US 32256  
 Contact: SHAWN NORTHCRAFT  
 shawn.northcraft@altg.com  
 T: (904)737-6000  
 F: (904)737-1260



### COOLANT CONDITION

pH	Scale 0-14	<b>8.41</b>	7.20	---	---
Reserve Alkalinity	Scale 0-20	---	---	---	---
Nitrites	ppm	<b>0</b>	0	---	---
Percentage Glycol	%	<b>49.5</b>	44.4	---	---
Freezing Point	°C	<b>-33</b>	-21	---	---

### Diagnosis

No corrective action is recommended at this time. The fluid is suitable for further service. There is no indication of any contamination in the coolant. Carboxylate test failed. The glycol level is acceptable. The pH level of this fluid is within the acceptable limits.



### CONTAMINATION

Coolant Appearance	<b>normal</b>	normal	---	---
Coolant Color	<b>Yllow</b>	Yllow	---	---

**Depot:** VOLVO0092  
**Unique No:** 10635592  
**Signed:** Doug Bogart  
**Report Date:** 11 Sep 2023



# CONSTRUCTION EQUIPMENT




## VOLVO GRAPHS


### Iron/Tin/Silver




### Reserve Alkalinity

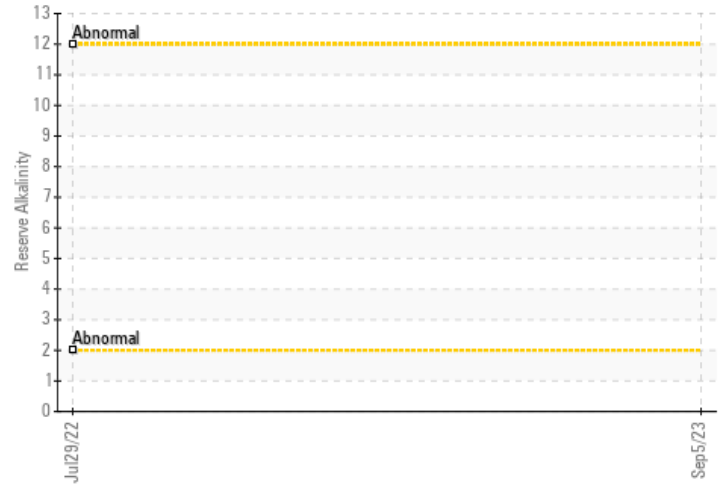


### Copper/Aluminum/Lead

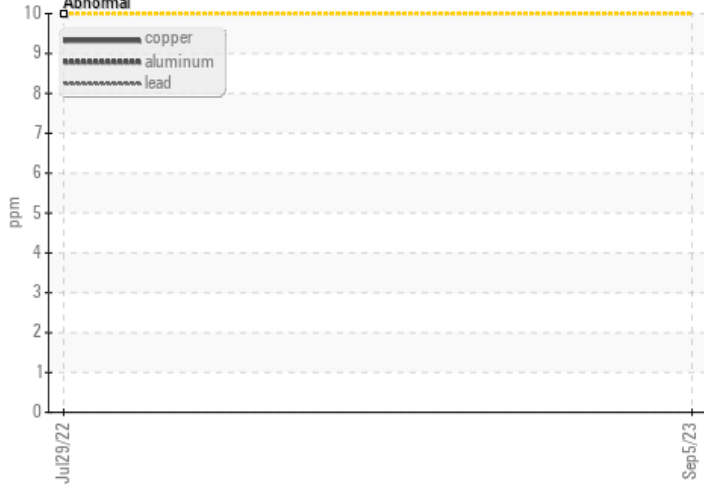

### Freeze Point

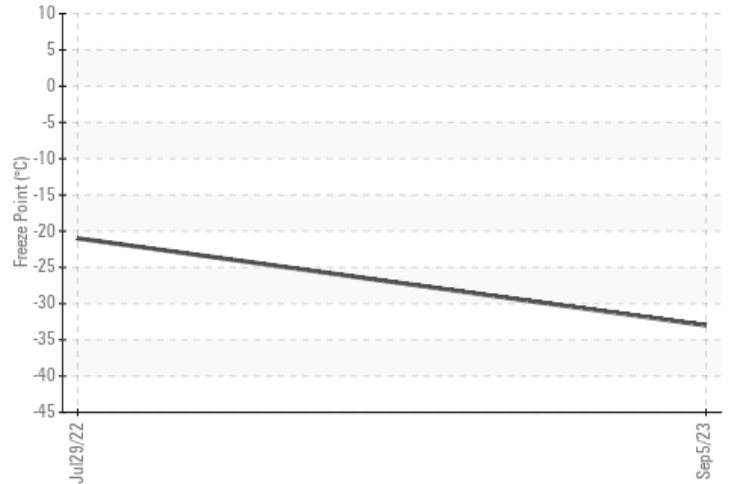

### pH

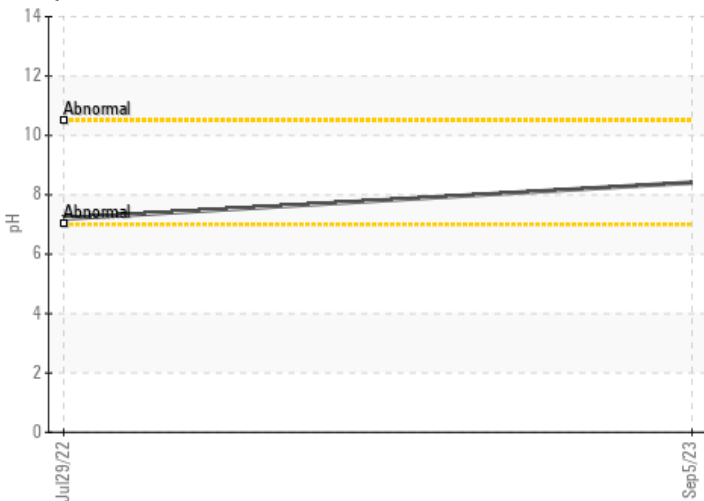

### Nitrites

