



CONSTRUCTION EQUIPMENT

ALJON VOLVO 30002 - COOLANT



Sample No: VCP265274
Oil Type: VOLVO COOLANT VCS (YELLOW)
Job No: ALJON



SAMPLE INFORMATION

Sample Number	VCP265274	---	---	---
Sample Date	18 Aug 2023	---	---	---
Machine Hours	13951	---	---	---
Sample Status	NORMAL	---	---	---

ROMCO INC
 1519 W BELTLINE
 CARROLLTON, TX
 US 75006
 Contact: KEVIN CONNOR
 kconnor@romco.com
 T: (817)980-4947
 F: (214)819-4131



COOLANT CONDITION

pH	Scale 0-14	■ 8.57	---	---	---
Reserve Alkalinity	Scale 0-20	---	---	---	---
Nitrites	ppm	■ NT	---	---	---
Percentage Glycol	%	■ 49.9	---	---	---
Freezing Point	°C	■ -33	---	---	---

Diagnosis

No corrective action is recommended at this time. The fluid is suitable for further service. There is no indication of any contamination in the coolant. Carboxylate test failed. The glycol level is acceptable. The pH level of this fluid is within the acceptable limits.



CONTAMINATION

Coolant Appearance		normal	---	---	---
Coolant Color		LtRed	---	---	---
Sand/Dirt	scalar	■ NONE	---	---	---
Debris	scalar	■ NONE	---	---	---
Precipitate	scalar	■ NONE	---	---	---
Silt	scalar	■ NONE	---	---	---

Depot: VOLVO0015
Unique No: 10645702
Signed: Jonathan Hester
Report Date: 15 Sep 2023



CONSTRUCTION EQUIPMENT




GRAPHS


Iron/Tin/Silver




Reserve Alkalinity

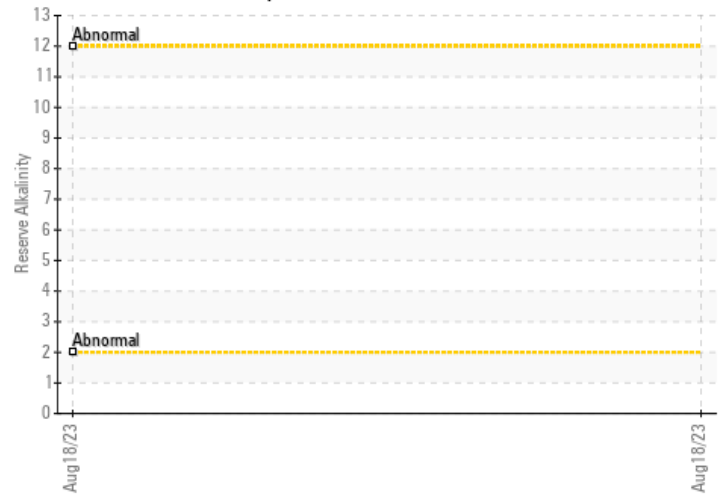


Copper/Aluminum/Lead

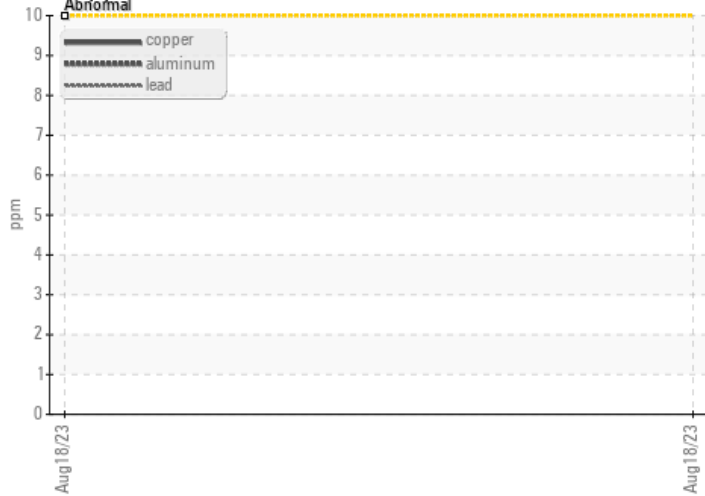

Freeze Point

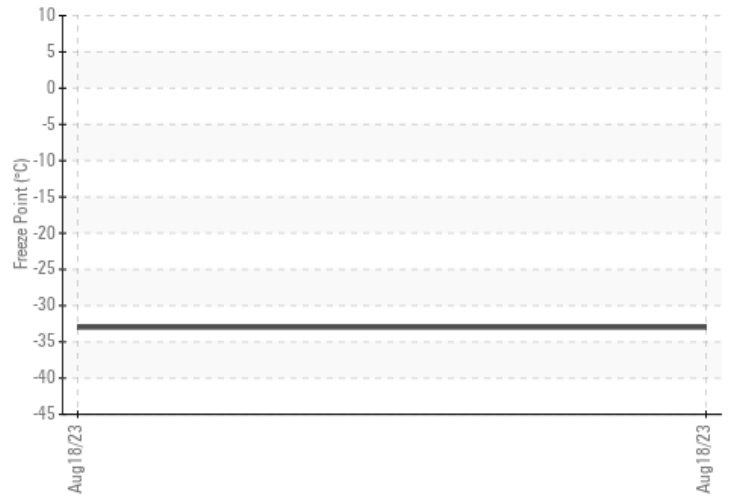

pH

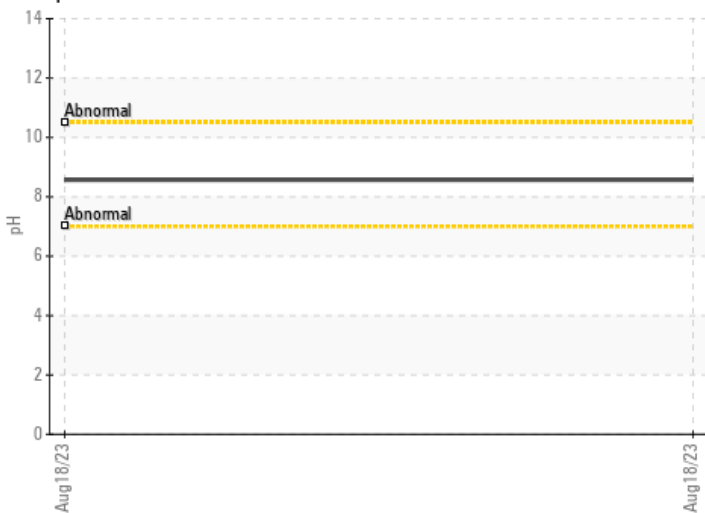

Nitrites

