

## **CONSTRUCTION EQUIPMENT** VOLVO L70H 624677 - TRANSMISSION (AUTO)



TAA

## Sample No: VCP411222

VOLVO AUTOMATIC TRANSMISSION FLUID AT102

## Oil Type: Job No:

VOLVO					
	E INFORMATION		 	<u>_</u>	and the second s
Sample Number	·	VCP411222	 		
Sample Date		23 Oct 2023	 		ALTA EQUIPMENT COMPANY
Machine Hours		1880	 		5151 DR MARTIN LUTHER KING BLVD
Oil Hours		0	 		FORT MYERS, FL
Oil Changed		Not Changd	 		US 33905
Sample Status		NORMAL	 		Contact: TODD LARK
					tlark@altaequipfl.com
	NDITION				T:
Visc @ 40°C	cSt	33.1	 		F: (239)481-3302
VISC @ 40 C	CSL	_ 55.1	 		
VOLVO					Diagnosis
CONTA	MINATION				Resample at the next service interval
Silicon	ppm	8	 		to monitor.All component wear rates
Sodium	ppm	5	 		are normal. There is no indication of
Potassium	ppm	2	 		any contamination in the fluid. The
					condition of the fluid is acceptable
WEAD	METALS				for the time in service.
WEAK	METALS		 		
Iron	ppm	93	 		
Copper	ppm	6	 		
Lead	ppm	0	 		
Tin	ppm	0	 		
Aluminum	ppm	■ <1	 		
Chromium	ppm	■ <1	 		
Molybdenum	ppm	0	 		
Nickel	ppm	<b>  </b> <1	 		
Titanium	ppm	0	 		
Silver	ppm	0	 		
Manganese	ppm	8	 		
Vanadium	ppm	0	 		
ADDITI	VES				
Calcium	ppm	74	 		
Magnesium	ppm	0	 		
Zinc	ppm	24	 		
Phosphorus	ppm	184	 		
Barium	ppm	■ <1	 		
Boron	ppm	64	 		
	PP	_ • .			

 Depot:
 VOLV00090

 Unique No:
 10712224

 Signed:
 Wes Davis


 Report Date:
 26 Oct 2023

## **CONSTRUCTION EQUIPMENT**



GRAPHS

VOLVO

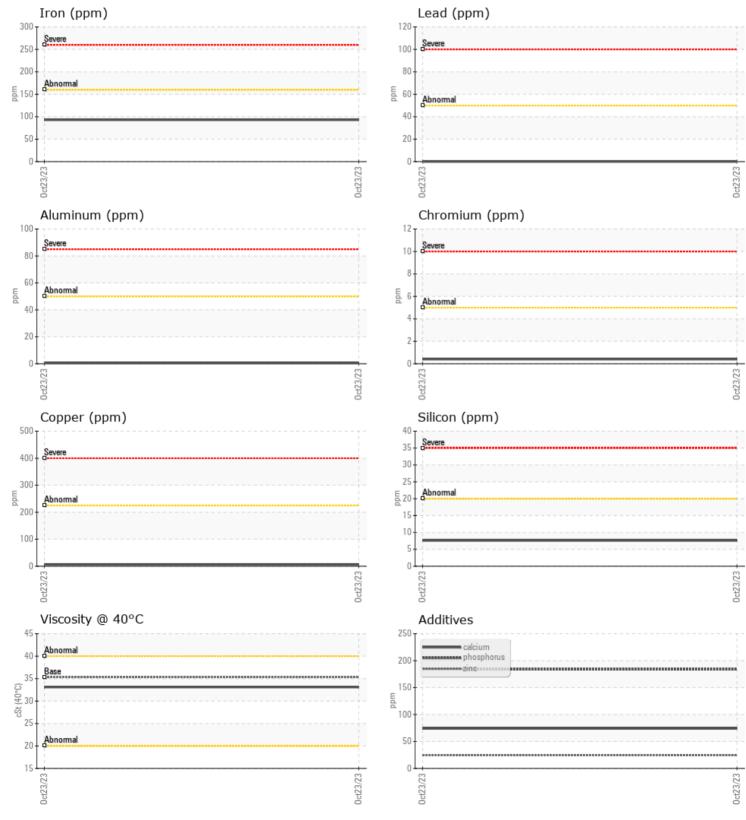

Report Id: VOLVO0090 [WUSCAR] 05989562 (Generated: 10/26/2023 16:32:49) Rev: 1

Contact/Location: TODD LARK - VOLVO0090