CONSTRUCTION EQUIPMENT

SPM621033 SENNEBOGEN 850E 850.0.3183 - REAR LEFT FINAL DRH

Sample No:	VCP429723
Oil Type:	GEAR OIL SAE 80W90
Job No:	SPM621033

VOLVO

Silver

Manganese

Vanadium

Calcium

Zinc

Barium

Boron

Magnesium

Phosphorus

SAMPLE INFORMATION VCP429723 Sample Number Sample Date 20 Oct 2023 Machine Hours 262 Oil Hours 262 Oil Changed Changed NORMAL Sample Status **OIL CONDITION** Visc @ 40°C cSt 138 CONTAMINATION Silicon ppm 4 Sodium 5 ppm Potassium 0 🔲 ppm WEAR METALS Iron ppm 12 Copper ppm **4** Lead ppm 0 🔲 Tin ppm 0 🔲 Aluminum ppm 0 🔲 Chromium ppm 0 Molybdenum ppm 0 🔲 Nickel 0 ppm Titanium <1 ppm



FERROUS PROCESSING AND TRADING

3400 E LAFAYETTE DETROIT, MI US 48207 Contact: KEITH HALL keith.hall@fpt1.com T: F:

Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Depot:	FERDET
Unique No:	10714480
Signed:	Wes Davis
Report Date:	28 Oct 2023

0

<1

0

0 🔲

0

0

147

0

1515

ppm

ppm

ppm

ppm

ppm

ppm

ppm

ppm

ppm

ADDITIVES


Contact/Location: KEITH HALL - FERDET

CONSTRUCTION EQUIPMENT



GRAPHS

VOLVO

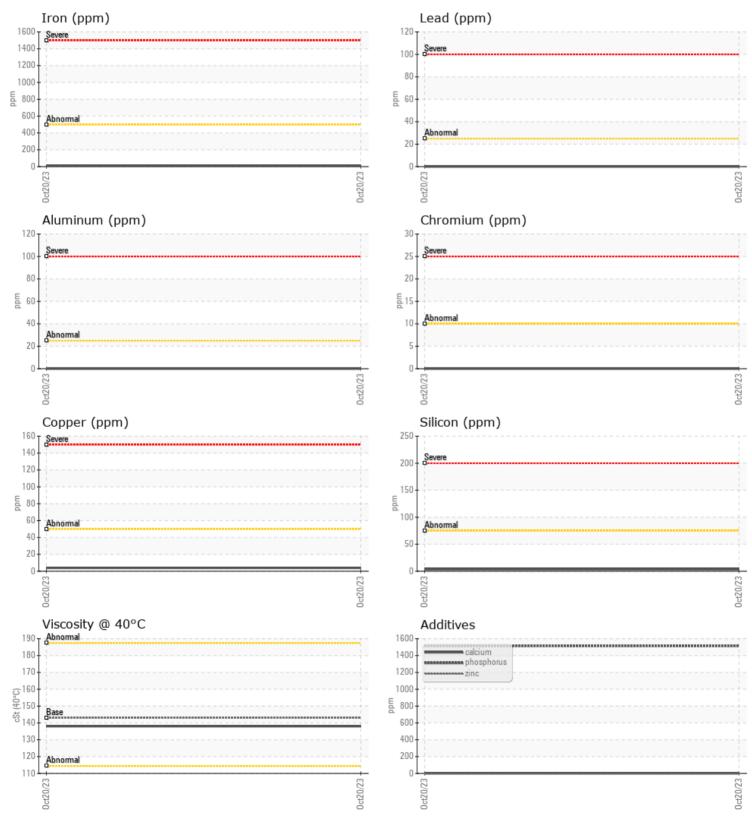

Report Id: FERDET [WUSCAR] 05991818 (Generated: 10/28/2023 05:37:37) Rev: 1

Contact/Location: KEITH HALL - FERDET