




CONSTRUCTION EQUIPMENT

134741 INT TRANSFER ALJON 600 30135 - REAR RIGHT FINAL DRIVE



Sample No: VCP434137
Oil Type: NOT GIVEN
Job No: 134741 INT TRANSFER

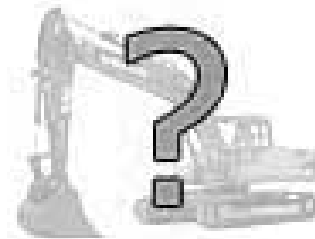

SAMPLE INFORMATION

Sample Number	VCP434137	VCP393303	VCP381212	VCP381211
Sample Date	31 Oct 2023	18 Jan 2023	09 Dec 2022	09 Dec 2022
Machine Hours	2223	512	184	184
Oil Hours	0	0	0	0
Oil Changed	Changed	Not Chngd	Changed	Changed
Sample Status	NORMAL	NORMAL	NORMAL	NORMAL

ROMCO INC
 1350 NE LOOP 820
 FORT WORTH, TX
 US 76106
 Contact: CHRIS BITNER
 CBitner@romco.com
 T:
 F: (817)626-8983



OIL CONDITION

Visc @ 40°C	cSt	294	326	340	309
-------------	-----	------------	-----	-----	-----



CONTAMINATION

Silicon	ppm	5	2	1	1
Sodium	ppm	<1	5	<1	2
Potassium	ppm	0	23	1	8

Diagnosis

Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample. All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.



WEAR METALS

Iron	ppm	139	21	17	82
Copper	ppm	3	1	<1	4
Lead	ppm	0	4	0	0
Tin	ppm	0	1	0	0
Aluminum	ppm	0	0	0	<1
Chromium	ppm	<1	1	<1	1
Molybdenum	ppm	0	<1	0	<1
Nickel	ppm	0	<1	0	0
Titanium	ppm	0	<1	0	0
Silver	ppm	0	<1	0	0
Manganese	ppm	1	<1	<1	1
Vanadium	ppm	0	<1	0	0



ADDITIVES

Calcium	ppm	99	16	2	10
Magnesium	ppm	0	11	0	0
Zinc	ppm	28	13	3	13
Phosphorus	ppm	897	260	915	917
Barium	ppm	0	0	0	0
Boron	ppm	186	23	168	154

Depot: VOLVO0081
Unique No: 10726664
Signed: Wes Davis
Report Date: 06 Nov 2023



CONSTRUCTION EQUIPMENT



GRAPHS

