CONSTRUCTION EQUIPMENT

Sample No:VCP365199Oil Type:AW HYDRAULIC OIL ISO 46Job No:CENTRAL SITE

SAMPLE INFORMATION

VOLVO

Sample Number		VCP365199			
Sample Date		16 Oct 2023			
Machine Hours		650			
Oil Hours		0			
Oil Changed		Not Changd			
Sample Status		NORMAL			
OIL CONDITIO	DN				
Visc @ 40°C	St	42.3			
Acid Number (AN) r	ng KOH/g	0.43			
CONTAMINA	TION	0 Not Changd NORMAL t 42.3 t 42.3 t 0.43			
Wator		NEC			

Water	%	NEG	 	
Particles >4µm		11457	 	
Particles >6µm		1245	 	
Particles >14µm		93	 	
ISO 4406:1999 (c)		21/17/14	 	
Silicon	ppm	3	 	
Sodium	ppm	1	 	
Potassium	ppm	0	 	

🎾 WEAR METALS

Iron	ppm	2	 	
Copper	ppm	26	 	
Lead	ppm	0	 	
Tin	ppm	0	 	
Aluminum	ppm	0	 	
Chromium	ppm	0	 	
Molybdenum	ppm	0	 	
Nickel	ppm	0	 	
Titanium	ppm	0	 	
Silver	ppm	0	 	
Manganese	ppm	 <1	 	
Vanadium	ppm	0	 	

VOLVO

Calcium	ppm	65			
Magnesium	ppm	0			
Zinc	ppm	434			
Phosphorus	ppm	374			
Barium	ppm	0			
Boron	ppm	0			



ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC

8418 PALM RIVER ROAD TAMPA, FL US 33619 Contact: KENNY HANEY khaney@flaglerce.com T: (813)630-0077 F: (813)630-2233

Diagnosis

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) AW HYDRAULIC OIL ISO 46. Please confirm.

All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

 Depot:
 VOLVO0093

 Unique No:
 10776125

 Signed:
 Wes Davis


 Report Date:
 07 Dec 2023

CONSTRUCTION EQUIPMENT



GRAPHS

VOLVO

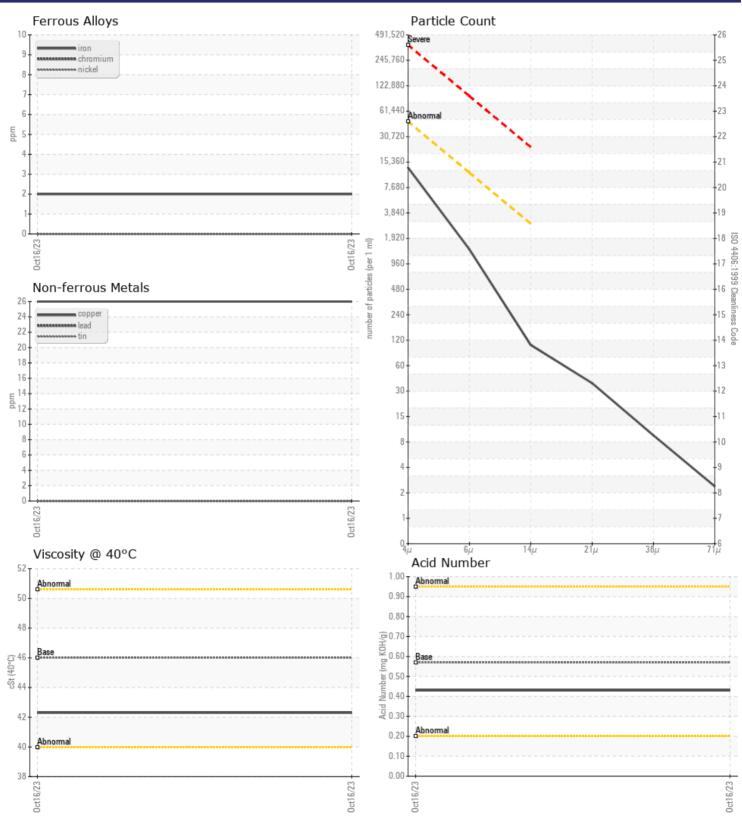

Report Id: VOLVO0093 [WUSCAR] 06026334 (Generated: 12/07/2023 15:31:42) Rev: 1

Contact/Location: KENNY HANEY - VOLVO0093