CONSTRUCTION EQUIPMENT ALTA RENTS VOLVO L70H 624830 - HYDRAULIC SYSTEM

Sample No:VCP440738Oil Type:VOLVO SUPER HYDRAULIC OIL 46Job No:ALTA RENTS

SAMPLE INFORMATION

VOLVO

Sample Number		VCP440738				
Sample Date		06 Dec 2023				
Machine Hours		1366				
Oil Hours		0				
Oil Changed		Not Changd				
Sample Status		NORMAL				
OIL CONDITION						
Visc @ 40°C	cSt	49.0				
Acid Number (AN)	mg KOH/g	0.31				
VOLVO	-					

CONTAMINATION NEG % Water 2635 Particles >4µm Particles >6µm 665 Particles >14µm 42 ISO 4406:1999 (c) 19/17/13 Silicon ppm 4 Sodium ppm ■ <1 2 Potassium ppm

🎾 WEAR METALS

Iron	ppm	1	 	
Copper	ppm	1	 	
Lead	ppm	1	 	
Tin	ppm		 	
Aluminum	ppm	□<1	 	
Chromium	ppm	0	 	
Molybdenum	ppm	0	 	
Nickel	ppm		 	
Titanium	ppm	0	 	
Silver	ppm	0	 	
Manganese	ppm	□<1	 	
Vanadium	ppm	0	 	

VOLVO

ADDITI	VES			
Calcium	ppm	62	 	
Magnesium	ppm	9	 	
Zinc	ppm	467	 	
Phosphorus	ppm	356	 	
Barium	ppm	0	 	
Boron	ppm	0	 	



ALTA EQUIPMENT/FLAGLER EQUIPMENT LLC

9601 BOGGY CREEK RD ORLANDO, FL US 32824 Contact: Robert LaPlante robert.laplante@altg.com T: (407)508-9736 F: (407)659-8720

Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

 Depot:
 VOLVO0096

 Unique No:
 10790464

 Signed:
 Wes Davis


 Report Date:
 15 Dec 2023

CONSTRUCTION EQUIPMENT



🥜 GRAPHS

VOLVO

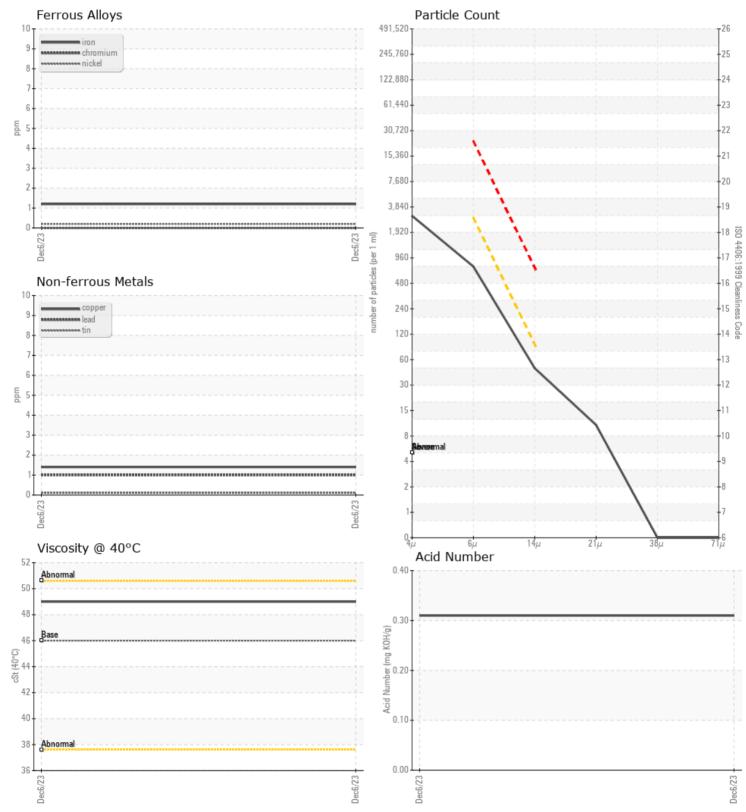

Contact/Location: Robert LaPlante - VOLVO0096