



# CONSTRUCTION EQUIPMENT

## VOLVO L90H 625855 - REAR AXLE



**Sample No:** VCP416377  
**Oil Type:** VOLVO WET BRAKE TRANSAXLE OIL  
**Job No:**



### SAMPLE INFORMATION

Sample Number	VCP416377	---	---	---
Sample Date	11 Dec 2023	---	---	---
Machine Hours	2920	---	---	---
Oil Hours	0	---	---	---
Oil Changed	Changed	---	---	---
Sample Status	NORMAL	---	---	---

**ALTA EQUIPMENT COMPANY**  
 5151 DR MARTIN LUTHER KING BLVD  
 FORT MYERS, FL  
 US 33905  
 Contact: TODD LARK  
 tlark@altaequipfl.com  
 T:  
 F: (239)481-3302



### OIL CONDITION

Visc @ 40°C	cSt	█41.9	---	---	---
-------------	-----	-------	-----	-----	-----



### CONTAMINATION

Water	%	NEG	---	---	---
Silicon	ppm	█12	---	---	---
Sodium	ppm	█7	---	---	---
Potassium	ppm	█2	---	---	---



### WEAR METALS

Iron	ppm	█34	---	---	---
Copper	ppm	█0	---	---	---
Lead	ppm	█<1	---	---	---
Tin	ppm	█<1	---	---	---
Aluminum	ppm	█1	---	---	---
Chromium	ppm	█1	---	---	---
Molybdenum	ppm	█2	---	---	---
Nickel	ppm	█<1	---	---	---
Titanium	ppm	0	---	---	---
Silver	ppm	0	---	---	---
Manganese	ppm	█4	---	---	---
Vanadium	ppm	0	---	---	---



### ADDITIVES

Calcium	ppm	█3821	---	---	---
Magnesium	ppm	36	---	---	---
Zinc	ppm	█1590	---	---	---
Phosphorus	ppm	█1283	---	---	---
Barium	ppm	█0	---	---	---
Boron	ppm	█133	---	---	---

### Diagnosis

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

**Depot:** VOLVO0090  
**Unique No:** 10790654  
**Signed:** Wes Davis  
**Report Date:** 15 Dec 2023



# CONSTRUCTION EQUIPMENT



## GRAPHS

### Iron (ppm)



### Lead (ppm)




### Aluminum (ppm)




### Chromium (ppm)




### Copper (ppm)

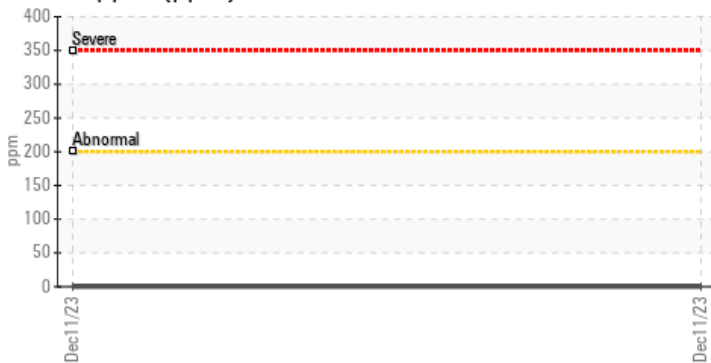

### Silicon (ppm)

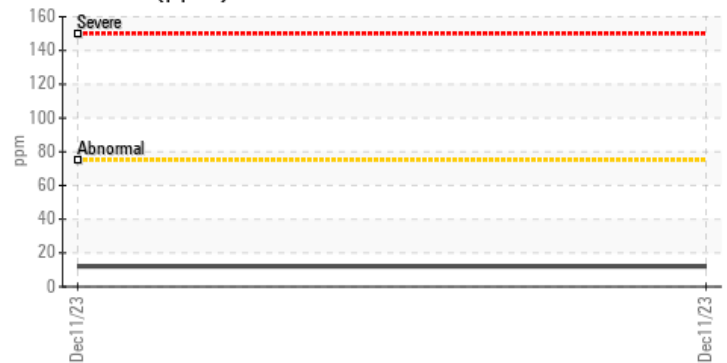

### Viscosity @ 40°C

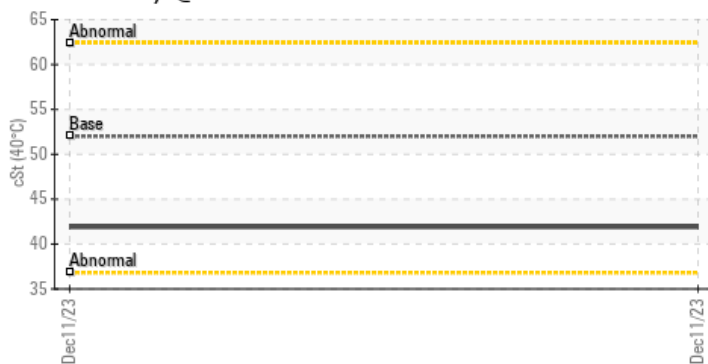

### Additives

