## **CONSTRUCTION EQUIPMENT** 1260 VULCAN MADISON VOLVO L220G 12034 - REAR AXLE



VOLVO

Oil Type:	VOLVO SUPER WET BRAKE TRANSAXLE OIL WB102
Job No:	1260 VULCAN MADISON

## SAMPLE INFORMATION VCP424155 Sample Number Sample Date 30 Nov 2023 **VCES- VOLVO CONSTRUCTION EQUIPMENT** Machine Hours 6891 8594 FRUITRIDGE ROAD Oil Hours SACRAMENTO, CA 0 Oil Changed Changed US 95826 NORMAL Contact: RAY KRANZUSCH Sample Status rav.kranzusch@vcesvolvo.com T: **OIL CONDITION** F: Visc @ 40°C cSt 39.8 Diagnosis CONTAMINATION Water % NEG Silicon ppm 9 Sodium 0 🔲 ppm Potassium ppm 1 the time in service. WEAR METALS Iron ppm 86 Copper ppm 14 Lead ppm 0 🔲 Tin ppm 0 🔲 Aluminum ppm 2 Chromium 1 ppm Molybdenum ppm 2 Nickel 0 ppm Titanium 0 ppm Silver 0 ppm Manganese ppm 1 Vanadium ppm 0 101 **ADDITIVES** Calcium 3065 ppm Magnesium 6 ppm Zinc ppm 1351



Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for

Depot:	VOLVO4485
Unique No:	10794966
Signed:	Wes Davis
Report Date:	20 Dec 2023

1188

0 🔲

97

Phosphorus

Barium

Boron

ppm

ppm

ppm


Contact/Location: RAY KRANZUSCH - VOLVO4485

## **CONSTRUCTION EQUIPMENT**



GRAPHS

VOLVO

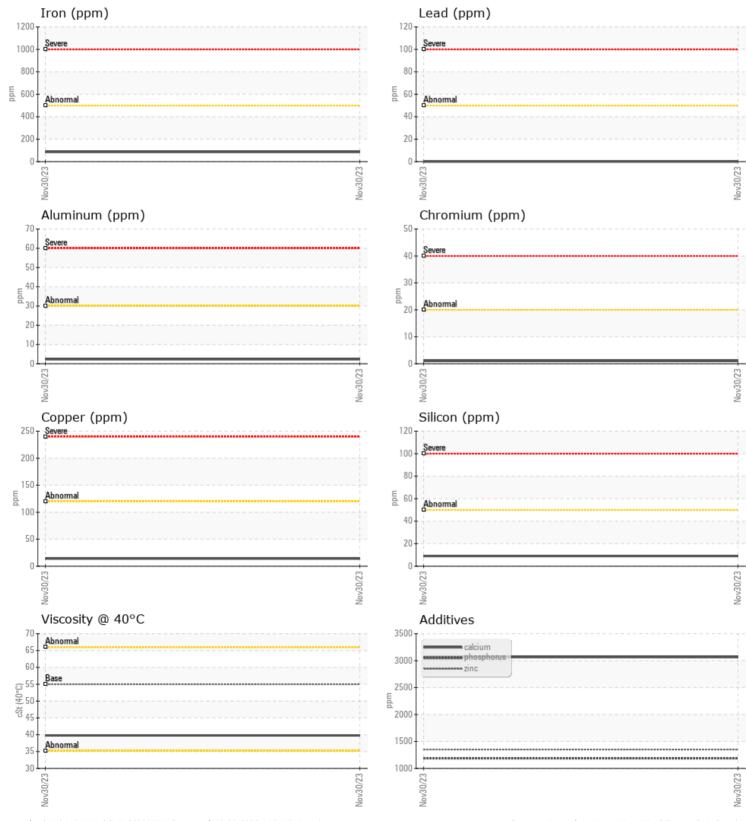

Report Id: VOLVO4485 [WUSCAR] 06039737 (Generated: 12/20/2023 14:34:53) Rev: 1

Contact/Location: RAY KRANZUSCH - VOLVO4485