



CONSTRUCTION EQUIPMENT

SWO-068559 VOLVO A40G 341023 - COOLANT



Sample No: VCP447544
Oil Type: VOLVO COOLANT VCS (YELLOW)
Job No: SWO-068559



SAMPLE INFORMATION

Sample Number	VCP447544	VCP428980	VCP408952	VCP369002
Sample Date	27 Dec 2023	20 Sep 2023	13 Jun 2023	03 Nov 2022
Machine Hours	8960	8472	7952	6919
Sample Status	NORMAL	NORMAL	NORMAL	NORMAL



COOLANT CONDITION

pH	Scale 0-14	7.82	7.67	7.75	7.53
Reserve Alkalinity	Scale 0-20	---	---	---	---
Nitrites	ppm	NT	NT	NT	NT
Percentage Glycol	%	48.8	48.4	48.3	47.9
Freezing Point	°C	-31	-31	-31	-28



CONTAMINATION

Coolant Appearance	normal	normal	normal	normal
Coolant Color	Yllow	Yllow	Yllow	Yllow

SAIIA CONSTRUCTION LLC

4400 LEWISBURG RD
BIRMINGHAM, AL
US 35207

Contact: STEPHANI BRITTON
sbritton@saiia.com;doug.bogart@wearcheck.com
T: (205)943-2268
F: (205)943-2269

Diagnosis

No corrective action is recommended at this time. The fluid is suitable for further service. There is no indication of any contamination in the coolant. Carboxylate test failed. The glycol level is acceptable. The pH level of this fluid is within the acceptable limits.

Depot: SAIBIR
Unique No: 10809941
Signed: Jonathan Hester
Report Date: 04 Jan 2024




CONSTRUCTION EQUIPMENT




VOLVO GRAPHS


Iron/Tin/Silver

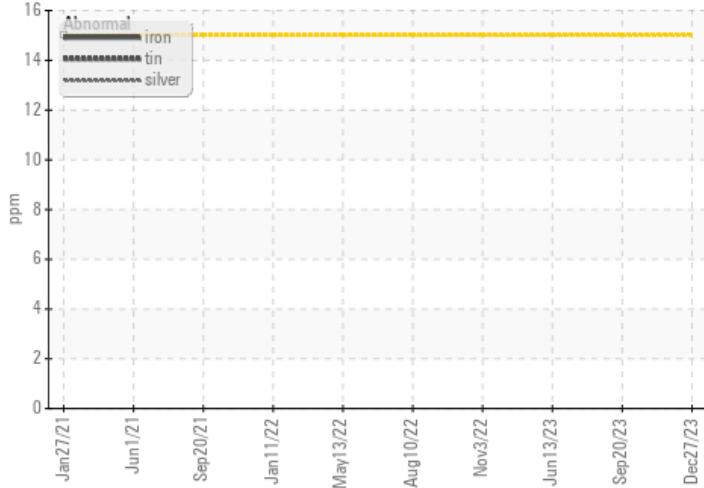


Reserve Alkalinity

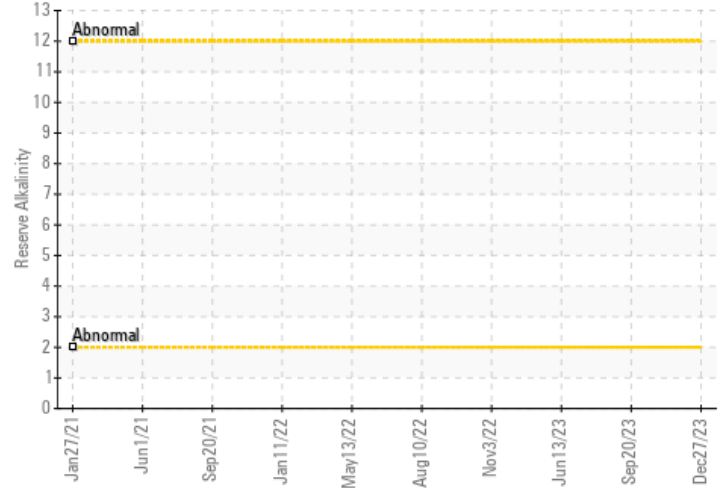


Copper/Aluminum/Lead

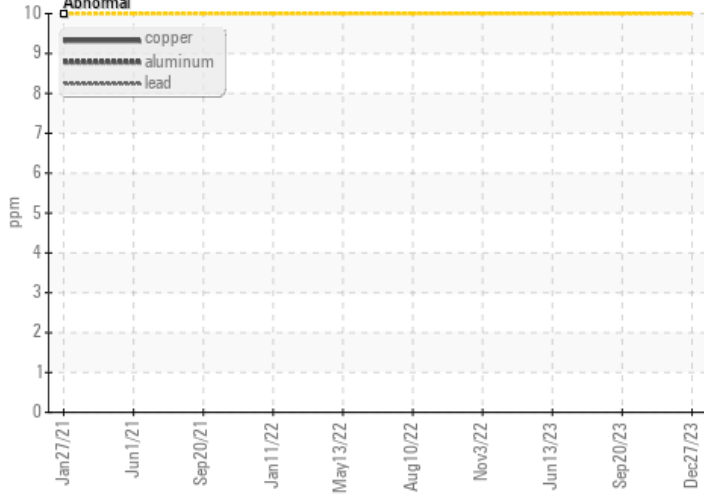

Freeze Point

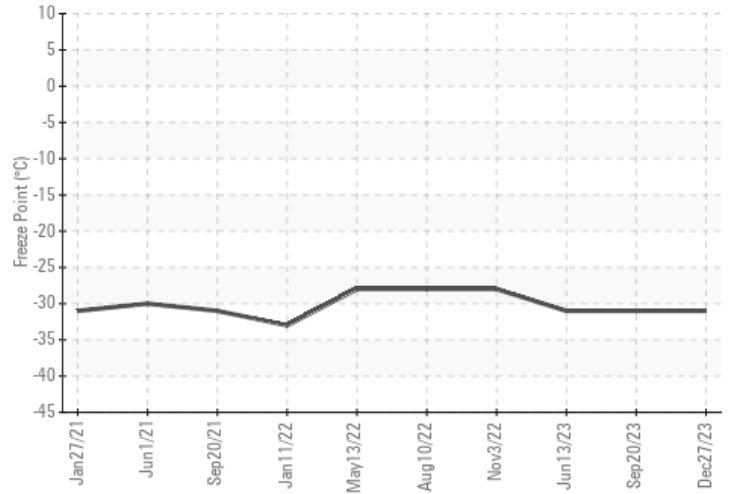

pH

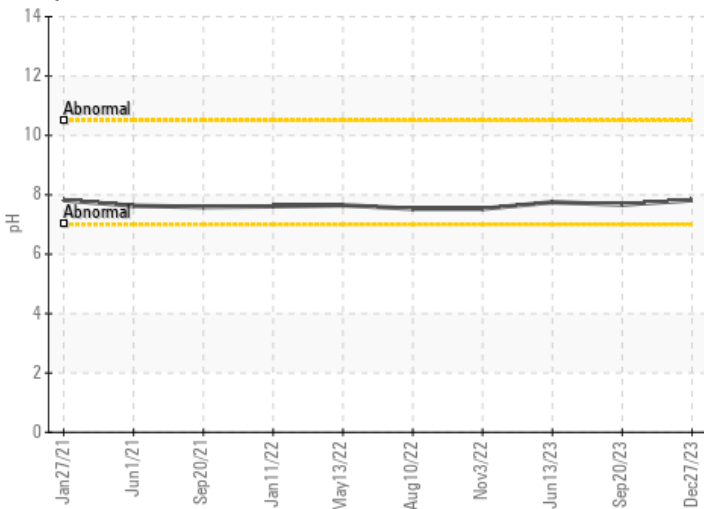

Nitrites

