



# CONSTRUCTION EQUIPMENT

## VOLVO L110H 05631970 - COOLANT



**Sample No:** VCP439471  
**Oil Type:** VOLVO COOLANT VCS (YELLOW)  
**Job No:**



### SAMPLE INFORMATION

Sample Number	VCP439471	---	---	---
Sample Date	27 Dec 2023	---	---	---
Machine Hours	4896	---	---	---
Sample Status	NORMAL	---	---	---

**CITY CARTING**  
 221 OLD GATE LN  
 MILFORD, CT  
 US 06460  
 Contact: TAVINS BANKS  
 tavins@citycart.net  
 T: (203)223-3885  
 F:



### COOLANT CONDITION

pH	Scale 0-14	■ 7.23	---	---	---
Reserve Alkalinity	Scale 0-20	---	---	---	---
Nitrites	ppm	■ NT	---	---	---
Percentage Glycol	%	■ 51.1	---	---	---
Freezing Point	°C	■ -38	---	---	---

### Diagnosis

No corrective action is recommended at this time. The fluid is suitable for further service. There is no indication of any contamination in the coolant. Carboxylate test failed. The glycol level is acceptable. The pH level of this fluid is within the acceptable limits.



### CONTAMINATION

Coolant Appearance	normal	---	---	---
Coolant Color	Yllow	---	---	---

**Depot:** CITMILCON  
**Unique No:** 10820478  
**Signed:** Jonathan Hester  
**Report Date:** 10 Jan 2024



# CONSTRUCTION EQUIPMENT




## GRAPHS


### Iron/Tin/Silver




### Reserve Alkalinity

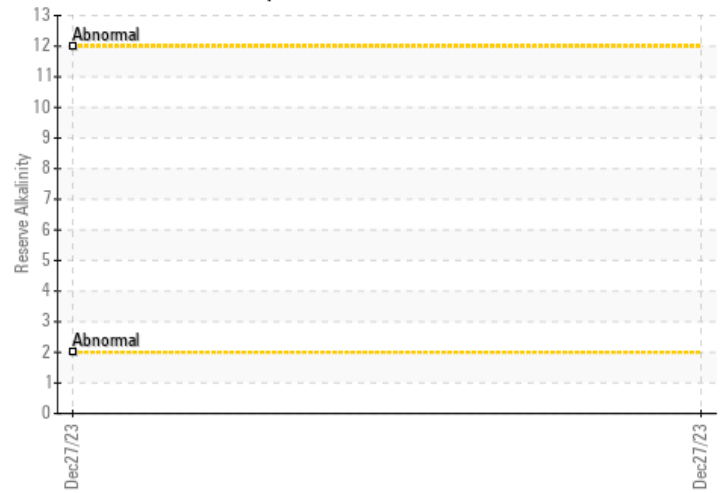


### Copper/Aluminum/Lead

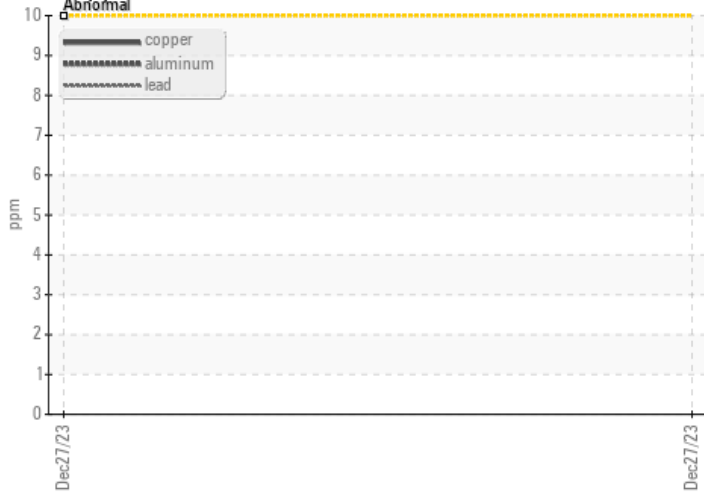

### Freeze Point

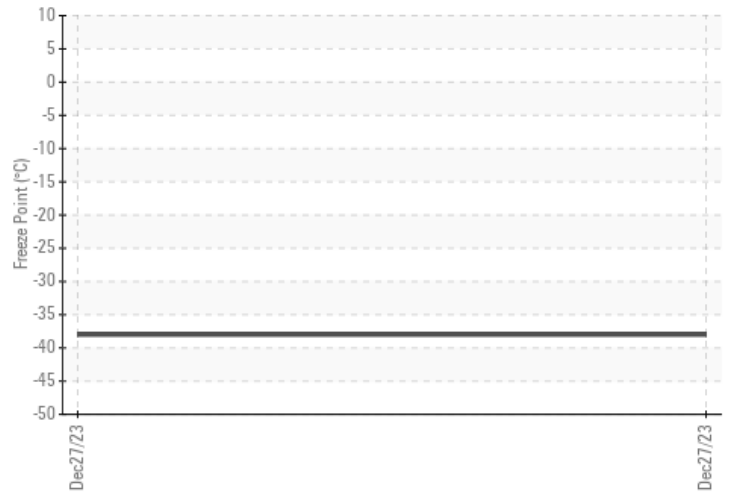

### pH

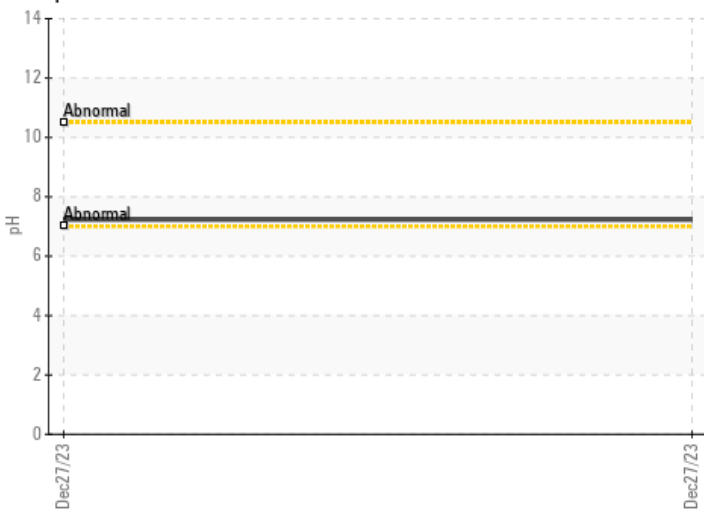

### Nitrites

