



CONSTRUCTION EQUIPMENT

VOLVO A40G 342685 - DROP BOX



Sample No: VCP0008135

Oil Type: {unknown}

Job No:



SAMPLE INFORMATION

Sample Number	VCP0008135	---	---	---
Sample Date	05 Jan 2024	---	---	---
Machine Hours	0	---	---	---
Oil Hours	0	---	---	---
Oil Changed	N/A	---	---	---
Sample Status	NORMAL	---	---	---

ALTA EQUIPMENT COMPANY
 8750 PHILIPS HWY
 JACKSONVILLE, FL
 US 32256
 Contact: TECHNICIAN ACCOUNT
 catherine.anastasio@wearcheck.com
 T:
 F: (904)737-1260



OIL CONDITION

Visc @ 40°C	cSt	81.9	---	---	---
-------------	-----	------	-----	-----	-----



CONTAMINATION

Water	%	NEG	---	---	---
Silicon	ppm	7	---	---	---
Sodium	ppm	2	---	---	---
Potassium	ppm	3	---	---	---



WEAR METALS

Iron	ppm	21	---	---	---
Copper	ppm	14	---	---	---
Lead	ppm	<1	---	---	---
Tin	ppm	<1	---	---	---
Aluminum	ppm	<1	---	---	---
Chromium	ppm	<1	---	---	---
Molybdenum	ppm	49	---	---	---
Nickel	ppm	0	---	---	---
Titanium	ppm	0	---	---	---
Silver	ppm	0	---	---	---
Manganese	ppm	<1	---	---	---
Vanadium	ppm	0	---	---	---



ADDITIVES

Calcium	ppm	845	---	---	---
Magnesium	ppm	632	---	---	---
Zinc	ppm	931	---	---	---
Phosphorus	ppm	984	---	---	---
Barium	ppm	0	---	---	---
Boron	ppm	73	---	---	---

Diagnosis

Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample. All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Depot: VOLVO0092
Unique No: 10821601
Signed: Jonathan Hester
Report Date: 10 Jan 2024



CONSTRUCTION EQUIPMENT




GRAPHS


Iron (ppm)



Lead (ppm)

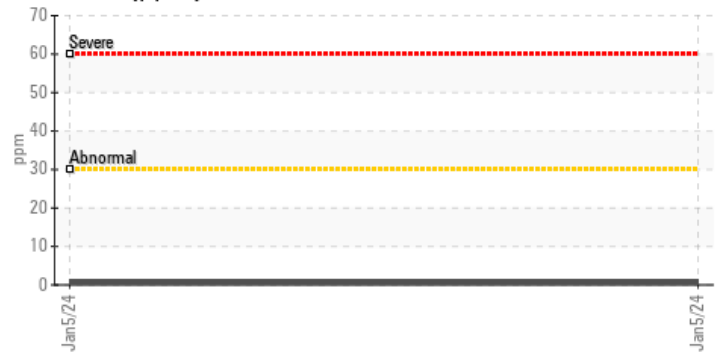


Aluminum (ppm)

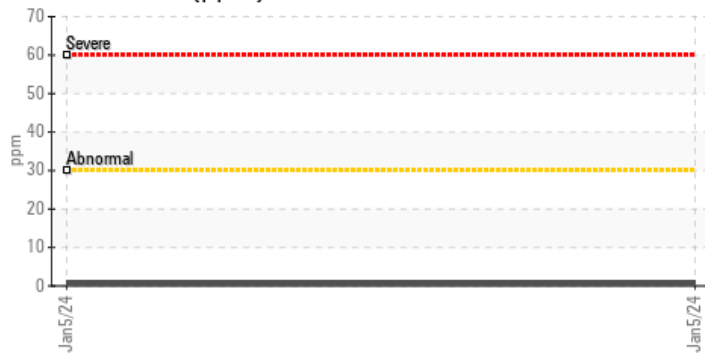

Chromium (ppm)



Copper (ppm)

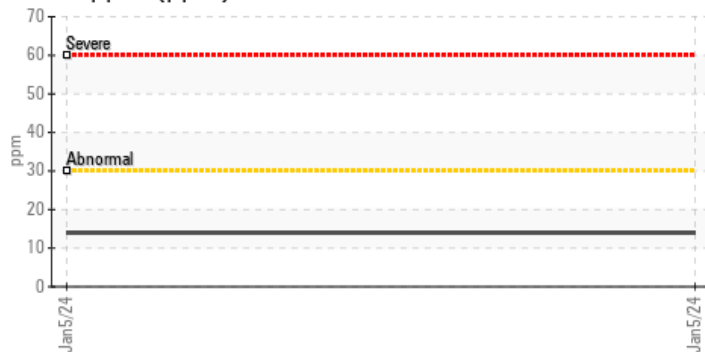

Silicon (ppm)



Viscosity @ 40°C



Additives

