## **CONSTRUCTION EQUIPMENT** CMC


SENNEBOGEN 850 850.0.3 186 - REAR RIGHT FINAL DRIVE

#### Sample No: VCP438012

VOLVO

Oil Type:	VOLVO PREMIUM GEAR OIL 80W-90 GL-5
Job No:	СМС

#### SAMPLE INFORMATION VCP438012 Sample Number Sample Date 02 Jan 2024 1899 Machine Hours Oil Hours 1000 Oil Changed Changed NORMAL Sample Status **OIL CONDITION** Visc @ 40°C cSt 143 CONTAMINATION Water % NEG Silicon 2 ppm Sodium 0 🔲 ppm Potassium ppm ■ <1 WEAR METALS Iron ppm 22 Copper ppm 5 Lead ppm 0 🔲 Tin ppm 0 🔲 Aluminum 2 ppm Chromium **||** <1 ppm Molybdenum ppm <1 Nickel 0 ppm Titanium 0 ppm Silver 0 ppm Manganese ppm 0 Vanadium ppm 0 101 **ADDITIVES**





### **GREEN MACHINE SERVICES LLC**

**13 SPYROS DRIVE** SOUTH AMBOY, NJ US 08879 Contact: JOE GRZANKOWSKI JOE@GREENMSRV.COM T: (732)673-5920 F:

## Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.


Depot:	GRESOUNJ
Unique No:	10835983
Signed:	Don Baldridge
Report Date:	21 Jan 2024

# **CONSTRUCTION EQUIPMENT**



GRAPHS

VOLVO

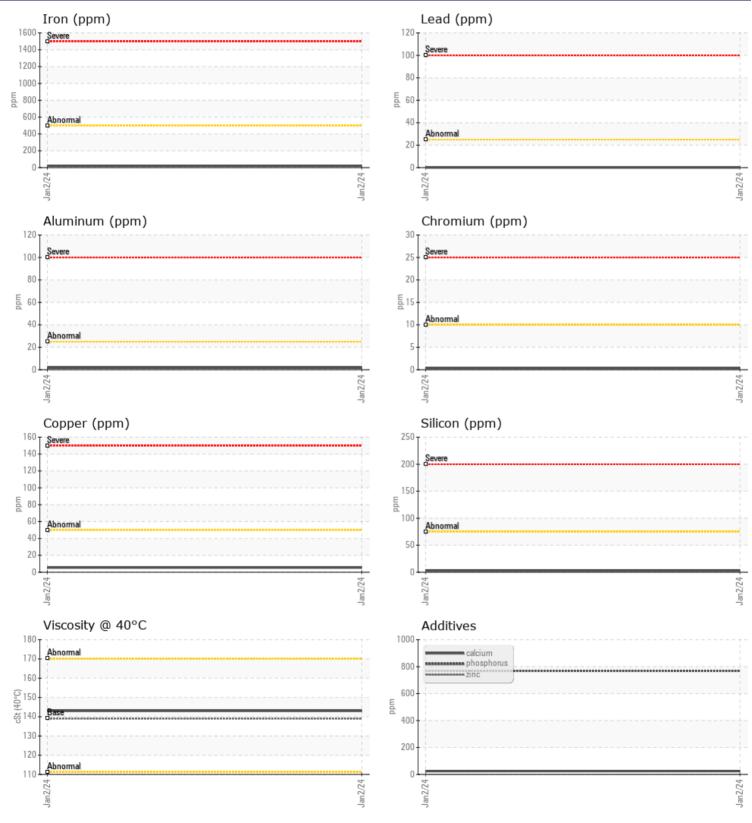

Report Id: GRESOUNJ [WUSCAR] 06064601 (Generated: 01/21/2024 13:17:16) Rev: 1

Contact/Location: JOE GRZANKOWSKI - GRESOUNJ