
VOLVO

CONSTRUCTION EQUIPMENT SENNEBOGEN 850 850.0.3186 - FRONT AXLE CMC



VCP438016 Sample No:

Oil Type:	VOLVO PREMIUM GEAR OIL 80W-90 GL-5
Job No:	СМС

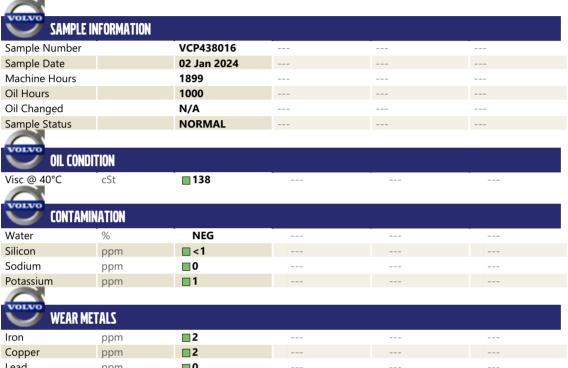



GREEN MACHINE SERVICES LLC

13 SPYROS DRIVE SOUTH AMBOY, NJ US 08879 Contact: JOE GRZANKOWSKI JOE@GREENMSRV.COM T: (732)673-5920 F:

Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

WEAR METALS							
Iron	ppm	2					
Copper	ppm	2					
Lead	ppm	0					
Tin	ppm	0					
Aluminum	ppm	2					
Chromium	ppm						
Molybdenum	ppm	4					
Nickel	ppm	0					
Titanium	ppm	0					
Silver	ppm	0					
Manganese	ppm	0					
Vanadium	ppm	0					

VOL **ADDITIVES** Calcium 63 ppm Magnesium 27 ppm Zinc ppm **||** <1 Phosphorus 695 ppm Barium 3 ppm Boron 23 ppm


> Depot: GRESOUNJ Unique No: 10835990 Signed: Don Baldridge Report Date: 21 Jan 2024

CONSTRUCTION EQUIPMENT



GRAPHS

VOLVO

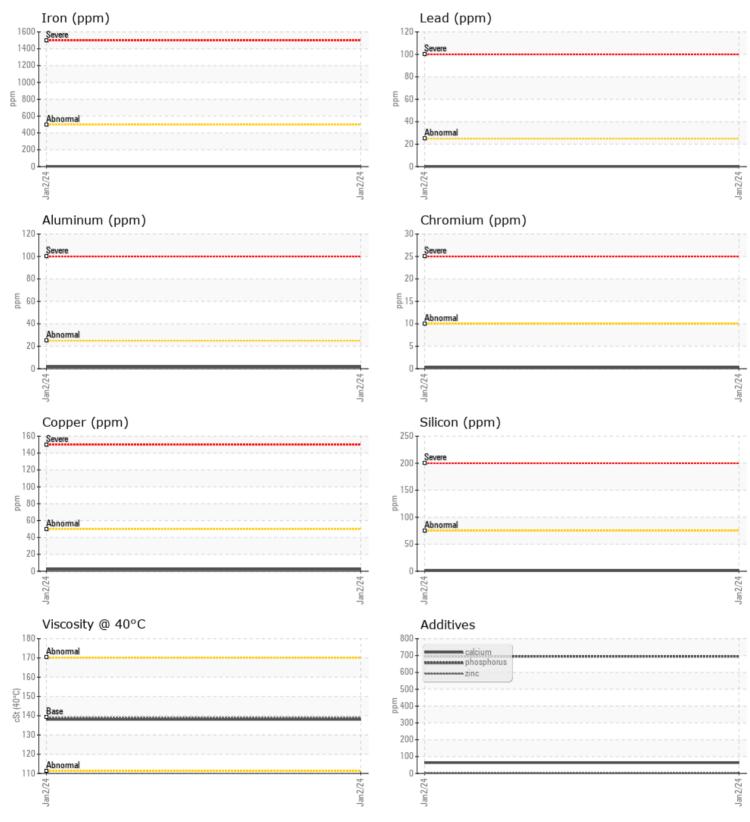

Report Id: GRESOUNJ [WUSCAR] 06064608 (Generated: 01/21/2024 13:21:36) Rev: 1

Contact/Location: JOE GRZANKOWSKI - GRESOUNJ