



CONSTRUCTION EQUIPMENT

660009 GFL VOLVO L120H 632695 - COOLANT



Sample No: VCP440446
Oil Type: VOLVO COOLANT VCS (YELLOW)
Job No: 660009 GFL



SAMPLE INFORMATION

Sample Number	VCP440446	VCP382492	---	---
Sample Date	18 Jan 2024	05 Jan 2023	---	---
Machine Hours	8515	6203	---	---
Sample Status	NORMAL	NORMAL	---	---

ALTA EQUIPMENT COMPANY - METRO WEST
 56195 PONTIAC TRAIL
 NEW HUDSON, MI
 US 48165
 Contact: PAUL ELZERMAN
 paul.elzerman@altaequipment.com
 T: (248)356-5200
 F: (248)356-2029



COOLANT CONDITION

pH	Scale 0-14	7.77	7.36	---	---
Reserve Alkalinity	Scale 0-20	---	---	---	---
Nitrites	ppm	NT	0	---	---
Percentage Glycol	%	51.9	50.7	---	---
Freezing Point	°C	-38	-35	---	---

Diagnosis

No corrective action is recommended at this time. The fluid is suitable for further service. There is no indication of any contamination in the coolant. Carboxylate test failed. The glycol level is acceptable. The pH level of this fluid is within the acceptable limits.



CONTAMINATION

Coolant Appearance	normal	normal	---	---
Coolant Color	Yllow	Yllow	---	---

Depot: VOLVO2990
Unique No: 10846491
Signed: Jonathan Hester
Report Date: 26 Jan 2024




CONSTRUCTION EQUIPMENT




GRAPHS


Iron/Tin/Silver

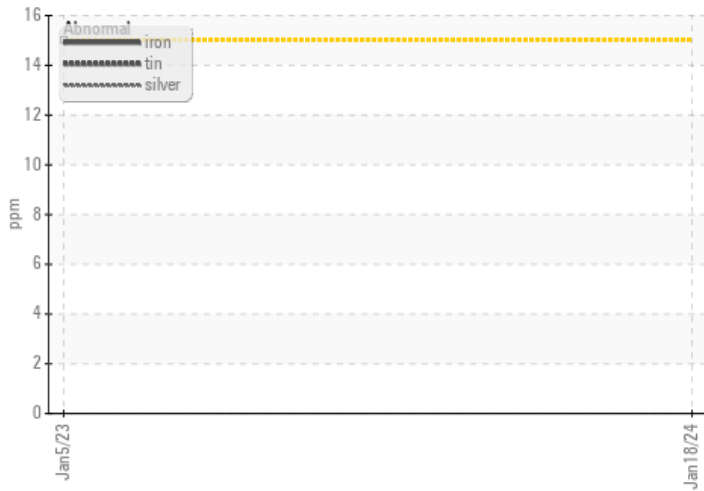


Reserve Alkalinity

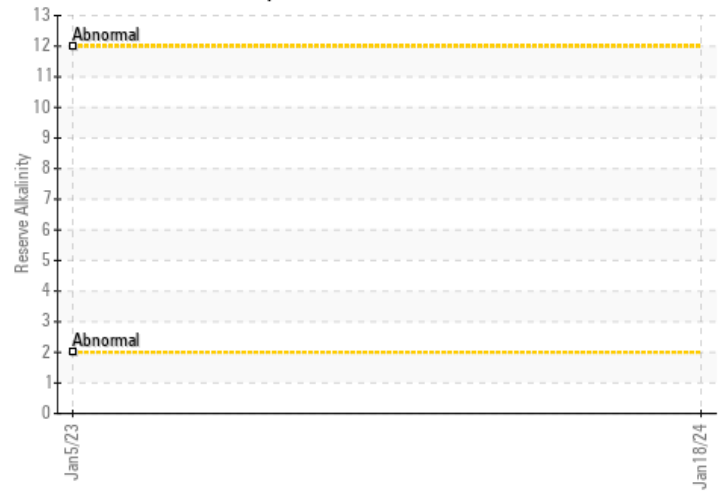


Copper/Aluminum/Lead

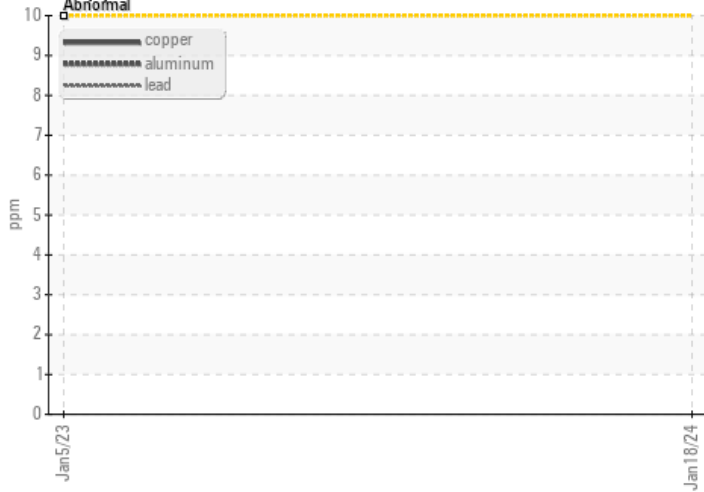

Freeze Point

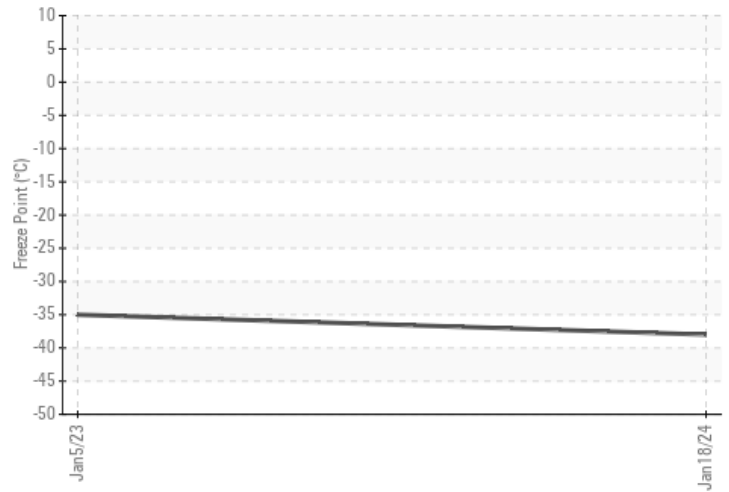

pH

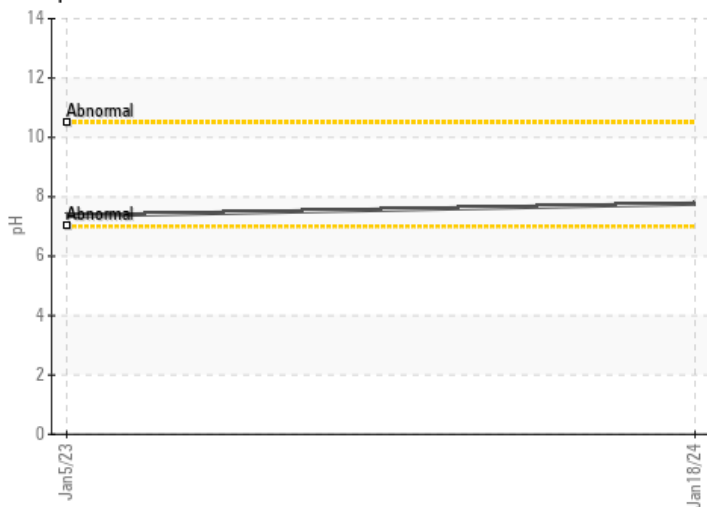

Nitrites

