CONSTRUCTION EQUIPMENT HERC RENTALS VOLVO L70H 624598 - FRONT AXLE



Sample No:VCP449226Oil Type:TRANSAXLE OIL SAE 75W80Job No:HERC RENTALS

VOLVO

SAMPLE INFORMATION VCP449226 Sample Number Sample Date 26 Jan 2024 2796 Machine Hours Oil Hours 0 Oil Changed Changed NORMAL Sample Status **OIL CONDITION** Visc @ 40°C cSt 40.3 CONTAMINATION Water % NEG Silicon ppm 11 Sodium 9 🔲 ppm Potassium ppm 0 WEAR METALS Iron ppm 72 Copper ppm 0 Lead ppm **||** <1 Tin ppm **||** <1 Aluminum ■<1 ppm Chromium 3 ppm Molybdenum ppm 15 Nickel 0 ppm Titanium 0 ppm Silver 0 ppm Manganese ppm 11 Vanadium ppm 0 01 **ADDITIVES** Calcium 3695 mag

calcium	PPIII			
Magnesium	ppm	9	 	
Zinc	ppm	1548	 	
Phosphorus	ppm	1356	 	
Barium	ppm	 <1	 	
Boron	ppm	124	 	



ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC 8418 PALM RIVER ROAD TAMPA, FL US 33619 Contact: KENNY HANEY khaney@flaglerce.com

T: (813)630-0077 F: (813)630-2233

Diagnosis

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) TRANSAXLE OIL SAE 75W80. Please confirm. All component wear rates are normal. There is no indication of any

contamination in the oil. The condition of the oil is acceptable for the time in service.

 Depot:
 VOLVO0093

 Unique No:
 10871401

 Signed:
 Wes Davis


 Report Date:
 09 Feb 2024

CONSTRUCTION EQUIPMENT



GRAPHS

VOLVO

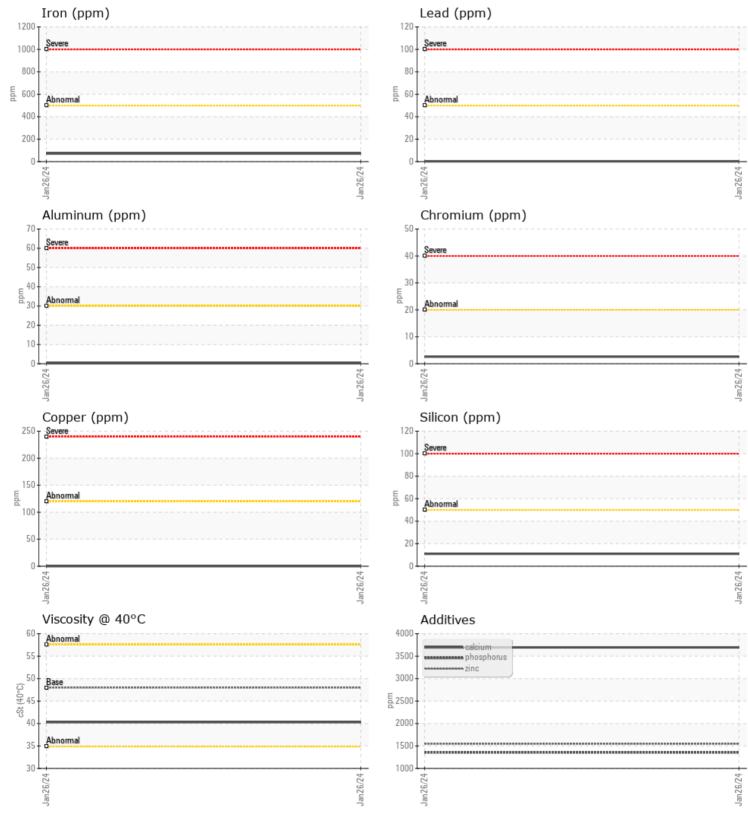

Report Id: VOLVO0093 [WUSCAR] 06083956 (Generated: 02/09/2024 16:22:22) Rev: 1

Contact/Location: KENNY HANEY - VOLVO0093