CONSTRUCTION EQUIPMENT SPM673171-10 VOLVO L90E 66648 - DIESEL ENGINE



 Sample No:
 VCP408608

 Oil Type:
 DIESEL ENGINE OIL SAE 30

 Job No:
 SPM673171-10

VOLVO

SAMPLE INFORMATION VCP408608 Sample Number Sample Date 09 Feb 2024 Machine Hours 14126 Oil Hours 0 Oil Changed N/A NORMAL Sample Status **OIL CONDITION** Visc @ 100°C cSt 12.3 Base Number (BN) mg KOH/g 7.2 Oxidation (PA) % 57 CONTAMINATION % NEG Water % Soot % 0.3 Nitration (PA) % 53 % 56 Sulfation (PA) Glycol % NEG Fuel % <1.0 Silicon ppm **4**



ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC 8418 PALM RIVER ROAD TAMPA, FL

US 33619 Contact: KENNY HANEY khaney@flaglerce.com T: (813)630-0077 F: (813)630-2233

Diagnosis

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) DIESEL ENGINE OIL SAE 30. Please confirm.

All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

OLVO	WEAR MET	AL
	-	

ppm

ppm

1

■ <1

Sodium

Potassium

Iron	ppm	6	 	
Copper	ppm	■ <1	 	
Lead	ppm	0	 	
Tin	ppm	0	 	
Aluminum	ppm	3	 	
Chromium	ppm	0	 	
Molybdenum	ppm	73	 	
Nickel	ppm	0	 	
Titanium	ppm	0	 	
Silver	ppm	0	 	
Manganese	ppm	 <1	 	
Vanadium	ppm	0	 	

ADDITIVES							
Calcium	ppm	1280					
Magnesium	ppm	363					
Zinc	ppm	1183					
Phosphorus	ppm	1006					
Barium	ppm	0					
Boron	ppm	367					

 Depot:
 VOLVO0093

 Unique No:
 10875366

 Signed:
 Wes Davis

 Report Date:
 14 Feb 2024

Report Id: VOLVO0093 [WUSCAR] 06087921 (Generated: 02/14/2024 14:33:15) Rev: 1


Contact/Location: KENNY HANEY - VOLVO0093

CONSTRUCTION EQUIPMENT



GRAPHS

VOLVO

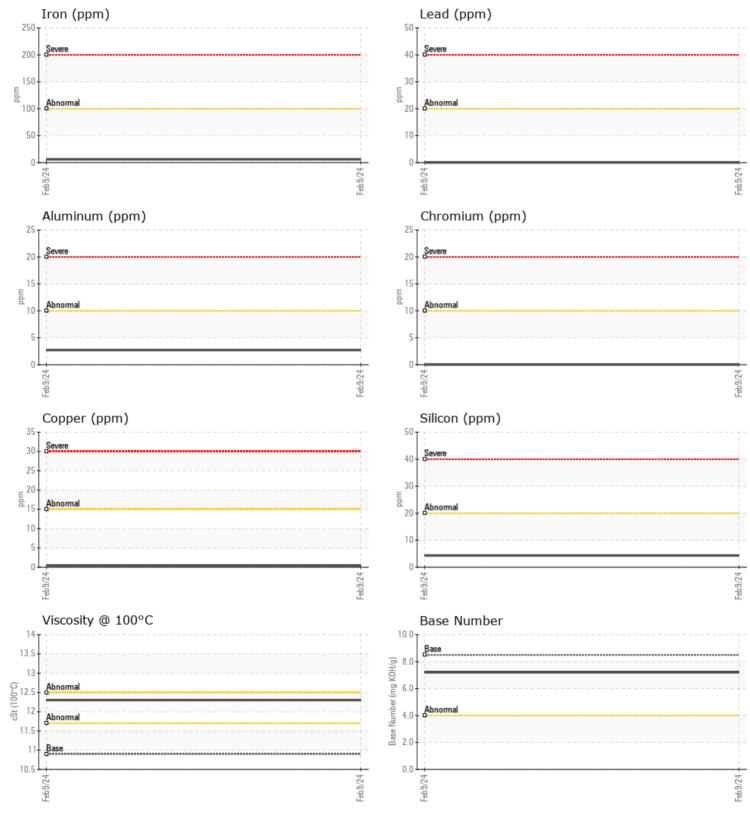

Report Id: VOLVO0093 [WUSCAR] 06087921 (Generated: 02/14/2024 14:33:18) Rev: 1

Contact/Location: KENNY HANEY - VOLVO0093