CONSTRUCTION EQUIPMENT SPM621972 VOLVO A25G 752521 - HYDRAULIC SYSTEM

Sample No:VCP429787Oil Type:VOLVO SUPER HYDRAULIC OIL 46Job No:SPM621972

SAMPLE INFORMATION

VOLVO

Sample Number	-	VCP429787	 	
Sample Date		13 Dec 2023	 	
Machine Hours		3895	 	
Oil Hours		0	 	
Oil Changed		Changed	 	
Sample Status		ATTENTION	 	
OIL CONDI	FION			
Visc @ 40°C	cSt	42.2	 	
Acid Number (AN)	mg KOH/g	0.29	 	
CONTAMIN	IATION			

Water	%	NEG	 	
Particles >4µm		36009	 	
Particles >6µm		5940	 	
Particles >14µm		108	 	
ISO 4406:1999 (c)		22/20/14	 	
Silicon	ppm	5	 	
Sodium	ppm	2	 	
Potassium	ppm	0	 	

WFAR M

WEAR M	IE I ALS			
Iron	ppm	1 4	 	
Copper	ppm	7	 	
Lead	ppm	□<1	 	
Tin	ppm		 	
Aluminum	ppm	0	 	
Chromium	ppm	2	 	
Molybdenum	ppm	□<1	 	
Nickel	ppm	0	 	
Titanium	ppm	0	 	
Silver	ppm	0	 	
Manganese	ppm	□<1	 	
Vanadium	ppm	0	 	

VOLVO

ADDITI	VES			
Calcium	ppm	324	 	
Magnesium	ppm	1	 	
Zinc	ppm	476	 	
Phosphorus	ppm	412	 	
Barium	ppm	0	 	
Boron	ppm	10	 	



ALTA EQUIPMENT CO - ORLAND PARK

5000 INDUSTRIAL HWY GARY, IN US 46406 Contact: DAVE ENG DAVE.ENG@ALTG.COM T: (312)350-2560 F:

Diagnosis

The filter change at the time of sampling has been noted. Resample at the next service interval to monitor.All component wear rates are normal. There is a light amount of silt (particulates < 14 microns in size) present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

 Depot:
 VOLVO8885

 Unique No:
 10882920

 Signed:
 Wes Davis

 Report Date:
 16 Feb 2024


CONSTRUCTION EQUIPMENT



Forroug Allos

GRAPHS

VOLVO

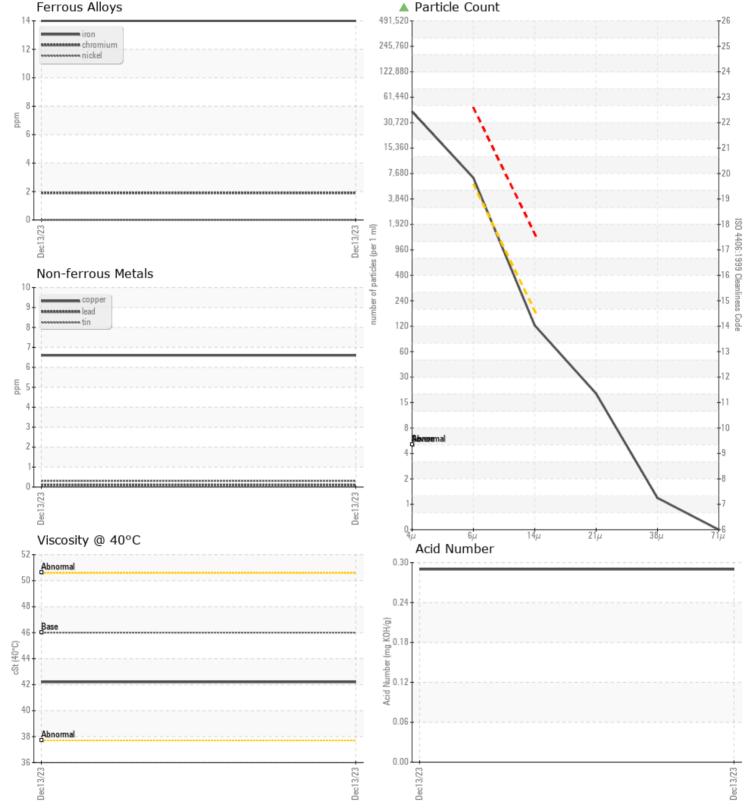

Report Id: VOLVO8885 [WUSCAR] 06090067 (Generated: 02/17/2024 13:15:39) Rev: 1

Contact/Location: DAVE ENG - VOLVO8885