## CONSTRUCTION EQUIPMENT 675483 MACK CONST TAKEUCHI TL8 408006479 - REAR RIGHT FINAL

Sample No: VCP446619

VOLVO

**Oil Type:** VOLVO PREMIUM GEAR OIL 80W-90 GL-5 Job No: 675483 MACK CONST



Tin

Aluminum

Chromium

Nickel

Silver

Titanium

Manganese

Vanadium

Calcium

Zinc

Barium

Boron

Magnesium

Phosphorus

Molybdenum

ppm

**ADDITIVES** 

**||** <1

■<1

5

0

■ <1

<1

0

0

10

2 🔲

29

18

0

278

8 🔲

NFORMATION				
	VCP446619			
	26 Feb 2024			
	97			
	0			
	Not Changd			
	NORMAL			
ITION				
cSt	<b>160</b>			
NATION				
%	NEG			
ppm	<b>1</b> 4			
ppm	3			
ppm	2			
TALS				
ppm	<b>419</b>			
ppm	2			
	NATION % ppm ppm	VCP446619   26 Feb 2024   97   0   Not Changd   NORMAL	VCP446619      26 Feb 2024      97      0      Not Changd      NORMAL      TION      cSt   160      %   NEG      ppm   14      ppm   2	VCP446619       26 Feb 2024       97       0       Not Changd       NORMAL       rtion       xcSt   160       %   NEG       ppm   14       ppm   2



## ALTA EQUIPMENT/FLAGLER EQUIPMENT LLC

9601 BOGGY CREEK RD ORLANDO, FL US 32824 Contact: Robert LaPlante robert.laplante@altg.com T: (407)508-9736 F: (407)659-8720

## Diagnosis

Resample at the next service interval to monitor.Metal levels are typical for a new component breaking in. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.


Depot:	VOLVO0096
Unique No:	10902866
Signed:	Sean Felton
Report Date:	04 Mar 2024

## **CONSTRUCTION EQUIPMENT**



GRAPHS

VOLVO

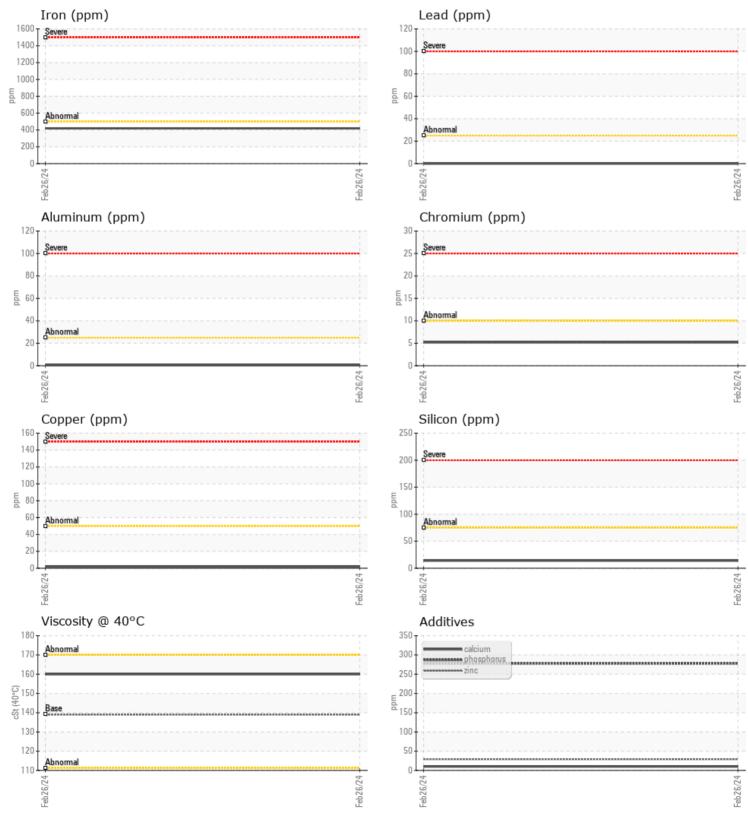

Report Id: VOLVO0096 [WUSCAR] 06104636 (Generated: 03/04/2024 17:19:39) Rev: 1

Contact/Location: Robert LaPlante - VOLVO0096