



CONSTRUCTION EQUIPMENT

VOLVO A40G 342659 - TRANSMISSION (AUTO)



Sample No: VCP0007818

Oil Type: DEXRON III

Job No:



SAMPLE INFORMATION

Sample Number	VCP0007818	---	---	---
Sample Date	29 Mar 2024	---	---	---
Machine Hours	0	---	---	---
Oil Hours	0	---	---	---
Oil Changed	N/A	---	---	---
Sample Status	NORMAL	---	---	---

ALTA EQUIPMENT COMPANY
 8750 PHILIPS HWY
 JACKSONVILLE, FL
 US 32256
 Contact: TECHNICIAN ACCOUNT
 catherine.anastasio@wearcheck.com
 T:
 F: (904)737-1260



OIL CONDITION

Visc @ 40°C	cSt	█ 28.9	---	---	---
-------------	-----	--------	-----	-----	-----



CONTAMINATION

Water	%	NEG	---	---	---
Silicon	ppm	█ 3	---	---	---
Sodium	ppm	█ 4	---	---	---
Potassium	ppm	█ 0	---	---	---

Diagnosis

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the fluid. The condition of the fluid is acceptable for the time in service.



WEAR METALS

Iron	ppm	█ 15	---	---	---
Copper	ppm	█ 20	---	---	---
Lead	ppm	█ 0	---	---	---
Tin	ppm	█ 3	---	---	---
Aluminum	ppm	█ 10	---	---	---
Chromium	ppm	█ 0	---	---	---
Molybdenum	ppm	█ 0	---	---	---
Nickel	ppm	█ 2	---	---	---
Titanium	ppm	0	---	---	---
Silver	ppm	█ 0	---	---	---
Manganese	ppm	█ <1	---	---	---
Vanadium	ppm	0	---	---	---



ADDITIVES

Calcium	ppm	█ 59	---	---	---
Magnesium	ppm	█ 0	---	---	---
Zinc	ppm	█ 0	---	---	---
Phosphorus	ppm	█ 188	---	---	---
Barium	ppm	█ 0	---	---	---
Boron	ppm	█ 95	---	---	---

Depot: VOLVO0092
Unique No: 10962630
Signed: Sean Felton
Report Date: 05 Apr 2024



CONSTRUCTION EQUIPMENT




GRAPHS


Iron (ppm)




Lead (ppm)

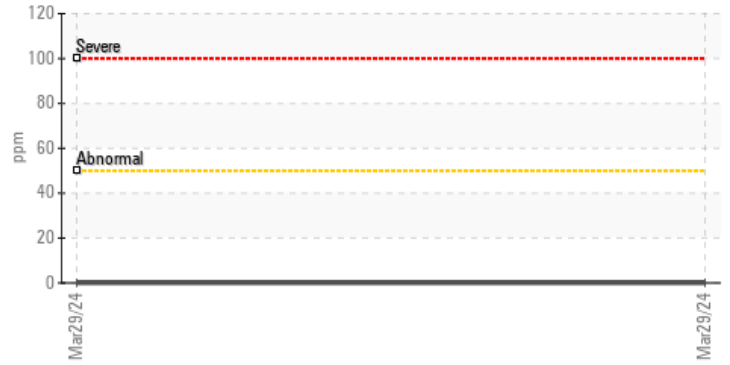

Aluminum (ppm)

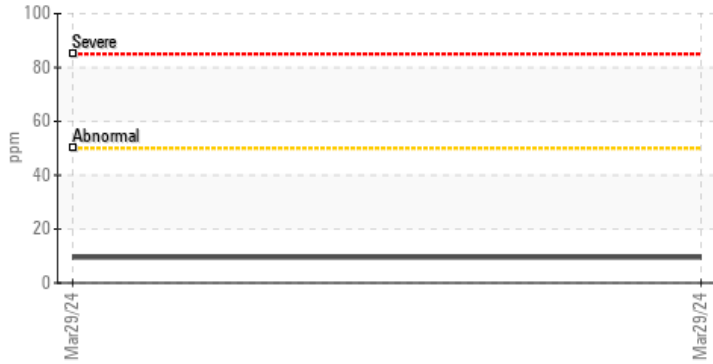


Chromium (ppm)

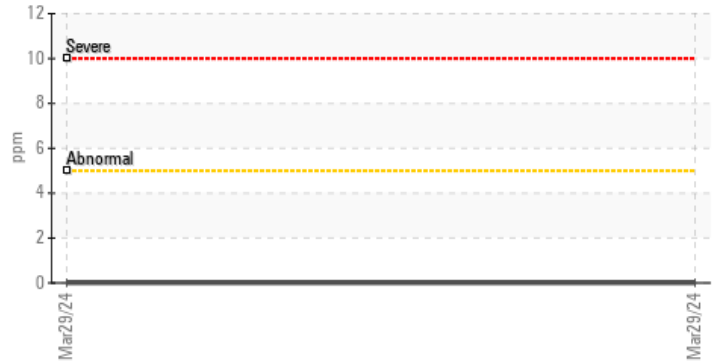

Copper (ppm)



Silicon (ppm)

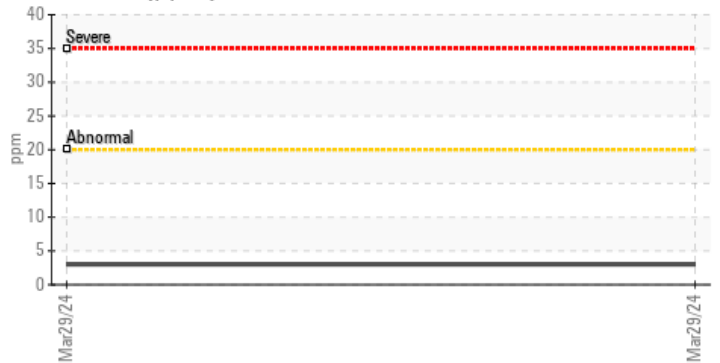

Viscosity @ 40°C



Additives

