



CONSTRUCTION EQUIPMENT

700681 ALTA RENTS VOLVO A25G 752784 - TRANSMISSION (AUTO)



Sample No: VCP443733
Oil Type: VOLVO AUTOMATIC TRANSMISSION FLUID AT102
Job No: 700681 ALTA RENTS



SAMPLE INFORMATION

Sample Number	VCP443733	---	---	---
Sample Date	04 Apr 2024	---	---	---
Machine Hours	914	---	---	---
Oil Hours	0	---	---	---
Oil Changed	Not Chngd	---	---	---
Sample Status	NORMAL	---	---	---

ALTA EQUIPMENT/FLAGLER EQUIPMENT LLC
 9601 BOGGY CREEK RD
 ORLANDO, FL
 US 32824
 Contact: Robert LaPlante
 robert.laplante@altg.com
 T: (407)508-9736
 F: (407)659-8720



OIL CONDITION

Visc @ 40°C	cSt	█ 28.3	---	---	---
-------------	-----	--------	-----	-----	-----



CONTAMINATION

Water	%	NEG	---	---	---
Silicon	ppm	█ 14	---	---	---
Sodium	ppm	█ 4	---	---	---
Potassium	ppm	█ 4	---	---	---

Diagnosis

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the fluid. The condition of the fluid is acceptable for the time in service.



WEAR METALS

Iron	ppm	█ 26	---	---	---
Copper	ppm	█ 19	---	---	---
Lead	ppm	█ 0	---	---	---
Tin	ppm	█ 4	---	---	---
Aluminum	ppm	█ 17	---	---	---
Chromium	ppm	█ <1	---	---	---
Molybdenum	ppm	█ 0	---	---	---
Nickel	ppm	█ 2	---	---	---
Titanium	ppm	<1	---	---	---
Silver	ppm	█ 0	---	---	---
Manganese	ppm	█ 3	---	---	---
Vanadium	ppm	<1	---	---	---



ADDITIVES

Calcium	ppm	█ 76	---	---	---
Magnesium	ppm	█ 1	---	---	---
Zinc	ppm	█ 7	---	---	---
Phosphorus	ppm	█ 198	---	---	---
Barium	ppm	█ <1	---	---	---
Boron	ppm	█ 76	---	---	---

Depot: VOLVO0096
Unique No: 10966663
Signed: Don Baldrige
Report Date: 10 Apr 2024



CONSTRUCTION EQUIPMENT



GRAPHS


Iron (ppm)




Lead (ppm)




Aluminum (ppm)

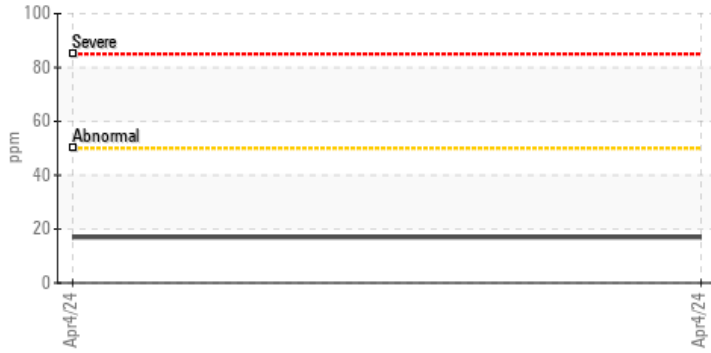


Chromium (ppm)

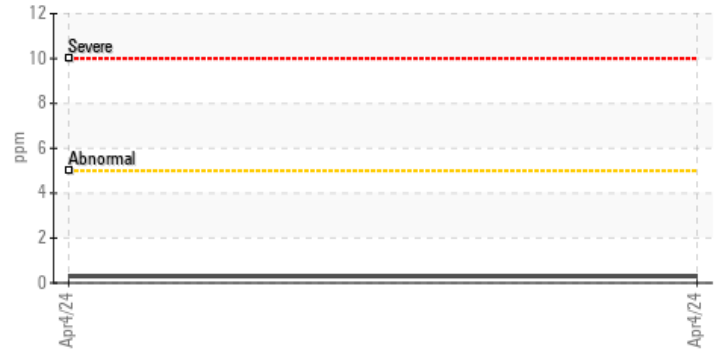


Copper (ppm)

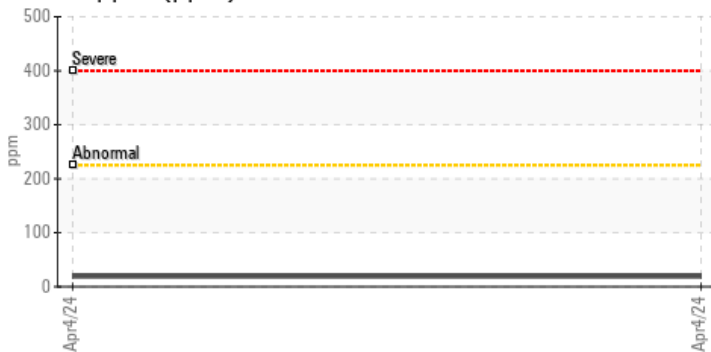

Silicon (ppm)

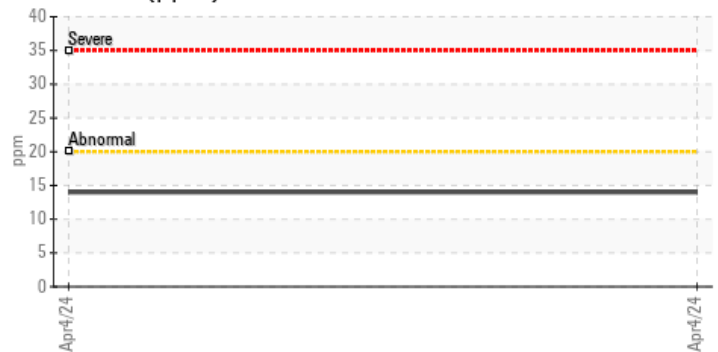

Viscosity @ 40°C

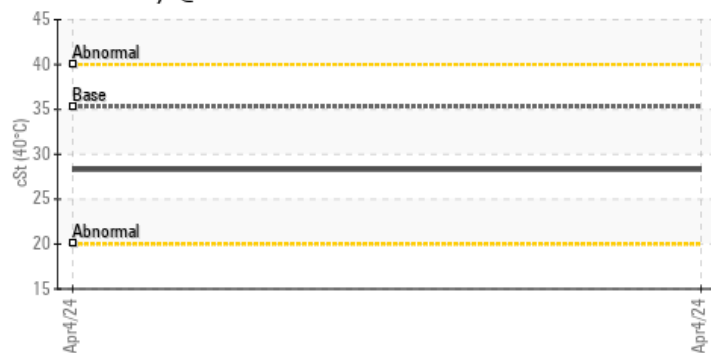

Additives

