



CONSTRUCTION EQUIPMENT

X18458 APAC-GREENVIL VOLVO L180H 55 18 - DIESEL ENGINE



Sample No: VCP445337
Oil Type: VOLVO ULTRA DIESEL ENGINE OIL 15W40 VDS-3
Job No: X18458 APAC-GREENVIL



SCOTT EQUIPMENT COMPANY LLC - Jackson
 3860 I-55 South
 JACKSON, MS
 US 39212
 Contact: DWIGHT MCDUGAL
 DMCDUGAL@SCOTTCOMPANIES.COM
 T:
 F: (601)326-3359



SAMPLE INFORMATION

Sample Number	VCP445337	---	---	---
Sample Date	02 Apr 2024	---	---	---
Machine Hours	4008	---	---	---
Oil Hours	0	---	---	---
Oil Changed	Changed	---	---	---
Sample Status	NORMAL	---	---	---



OIL CONDITION

Visc @ 100°C	cSt	█ 12.6	---	---	---
Base Number (BN)	mg KOH/g	█ 8.9	---	---	---
Oxidation (PA)	%	79	---	---	---



CONTAMINATION

Water	%	NEG	---	---	---
Soot %	%	█ 0.1	---	---	---
Nitration (PA)	%	66	---	---	---
Sulfation (PA)	%	60	---	---	---
Glycol	%	NEG	---	---	---
Fuel	%	<1.0	---	---	---
Silicon	ppm	█ 6	---	---	---
Sodium	ppm	█ 2	---	---	---
Potassium	ppm	█ 3	---	---	---



WEAR METALS

Iron	ppm	█ 6	---	---	---
Copper	ppm	█ 2	---	---	---
Lead	ppm	█ <1	---	---	---
Tin	ppm	█ 2	---	---	---
Aluminum	ppm	█ 2	---	---	---
Chromium	ppm	█ <1	---	---	---
Molybdenum	ppm	█ 49	---	---	---
Nickel	ppm	█ <1	---	---	---
Titanium	ppm	<1	---	---	---
Silver	ppm	█ 0	---	---	---
Manganese	ppm	█ 1	---	---	---
Vanadium	ppm	<1	---	---	---



ADDITIVES

Calcium	ppm	█ 1624	---	---	---
Magnesium	ppm	█ 530	---	---	---
Zinc	ppm	█ 1159	---	---	---
Phosphorus	ppm	█ 1041	---	---	---
Barium	ppm	█ <1	---	---	---
Boron	ppm	█ 74	---	---	---

Diagnosis

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Depot: VOLVO8771
Unique No: 10968327
Signed: Wes Davis
Report Date: 10 Apr 2024



CONSTRUCTION EQUIPMENT



GRAPHS

Iron (ppm)



Lead (ppm)




Aluminum (ppm)



Chromium (ppm)



Copper (ppm)

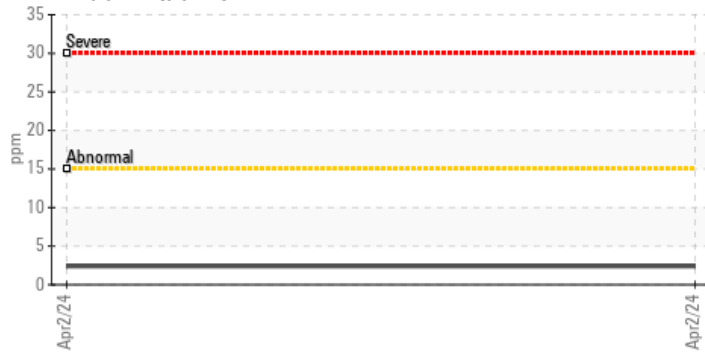

Silicon (ppm)



Viscosity @ 100°C



Base Number

