CONSTRUCTION EQUIPMENT VOLVO A45G 353380 - HYDRAULIC SYSTEM 29249



Sample No: VCP455250 **Oil Type:**

29249

VOLVO

VOLVO SUPER HYDRAULIC OIL 46

VCD455250

Job No:

SAMPLE INFORMATION

Sample Number	VCP455250	 	
Sample Date	06 Apr 2024	 	
Machine Hours	3883	 	
Oil Hours	0	 	
Oil Changed	Changed	 	
Sample Status	NORMAL	 	
OIL CONDITION			
Visc @ 40°C cSt	42.3	 	
Acid Number (AN) mg KOH/g	0.38	 	

CONTAMINATION NEG % Water 6436 Particles >4µm Particles >6µm 761 Particles >14µm 29 ISO 4406:1999 (c) 20/17/12 Silicon ppm 10 Sodium ppm 0

1

ppm

Potassium

WEAR N	AFIAL2			
Iron	ppm	10	 	
Copper	ppm	3	 	
Lead	ppm	3	 	
Tin	ppm	1	 	
Aluminum	ppm	2	 	
Chromium	ppm	1	 	
Molybdenum	ppm	1	 	
Nickel	ppm		 	
Titanium	ppm	<1	 	
Silver	ppm	0	 	
Manganese	ppm	 <1	 	
Vanadium	ppm	<1	 	

Calcium	ppm	117				
Magnesium	ppm	2				
Zinc	ppm	424				
Phosphorus	ppm	360				
Barium	ppm	0				
Boron	ppm	0				



218 - ASCENDUM MACHINERY INC - N. CHARLESTON

7235 CROSS COUNTRY RD. NORTH CHARLESTON, SC US 29418 Contact: MATT MITCHAM matt.mitcham@ascendummachinery.com T: F: (843)414-1129

Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


Depot: VOLVO3387 Unique No: 10977333 Signed: Wes Davis Report Date: 15 Apr 2024

CONSTRUCTION EQUIPMENT



GRAPHS

VOLVO

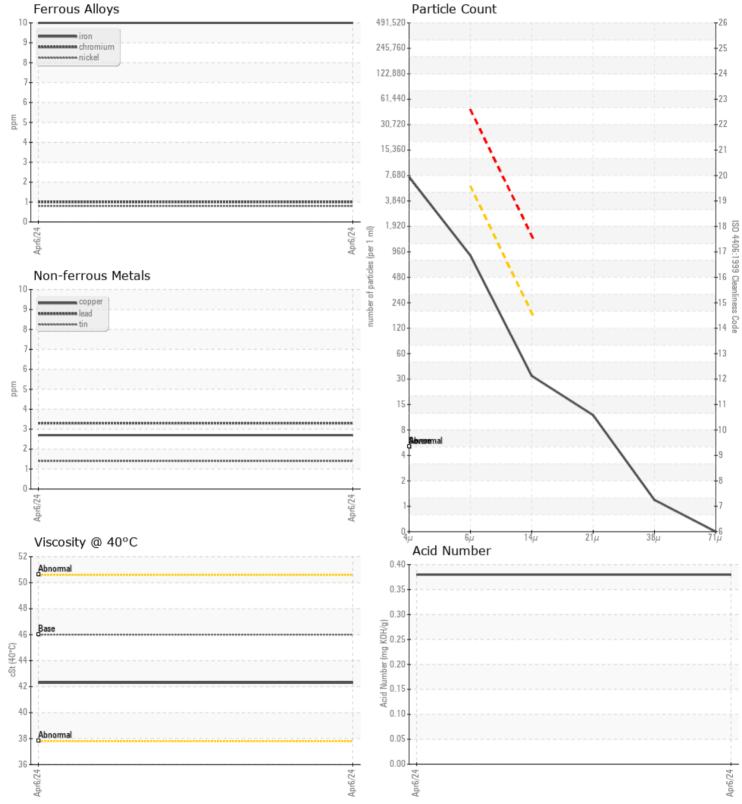

Report Id: VOLVO3387 [WUSCAR] 06147255 (Generated: 04/15/2024 12:21:45) Rev: 1

Contact/Location: MATT MITCHAM - VOLVO3387