
CONSTRUCTION EQUIPMENT SPM688695 SCORIA SENNEBOGEN 835

SENNEBOGEN 835 835.0.533 - REAR RIGHT FIN

Sample No: VCP427267 **Oil Type:** GEAR OIL SAE 80W90 Job No: SPM688695 SCORIA

VOLVO

SAMPLE INFORMATION					
Sample Number		VCP427267			
Sample Date		21 Mar 2024			
Machine Hours		11673			
Oil Hours		0			
Oil Changed		Changed			
Sample Status		NORMAL			
Sample Status		NORMAL			
			_		
Visc @ 40°C	cSt	158			
CONTAMINATION					
Water	%	NEG			
Silicon	ppm	2			
Sodium	ppm	2			
Potassium	ppm	0			
	14 14 T				
WEAR METALS					
Iron		83			
	ppm	■ 85			
Copper Lead	ppm				
	ppm	0			
Tin Aluminum	ppm	□ <1			
	ppm	0			
Chromium	ppm	0			
Molybdenum	ppm	0			
Nickel	ppm	0			
Titanium	ppm	0			
Silver	ppm	0			
Manganese	ppm	2			
Vanadium	ppm	0			
VOLVO					
ADDITIVES					

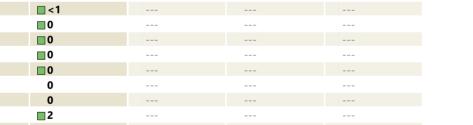



Depot: VOLVO8885 Unique No: 10990265 Signed: Wes Davis Report Date: 22 Apr 2024 Contact/Location: DAVE ENG - VOLVO8885

29 2

8

0 🔲

7

393

Calcium

Zinc

Barium

Boron

Magnesium

Phosphorus

ppm

ppm

ppm

ppm

ppm

ppm



ALTA EQUIPMENT CO - ORLAND PARK

5000 INDUSTRIAL HWY GARY, IN US 46406 Contact: DAVE ENG DAVE.ENG@ALTG.COM T: (312)350-2560 F:


Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

CONSTRUCTION EQUIPMENT



VOLVO

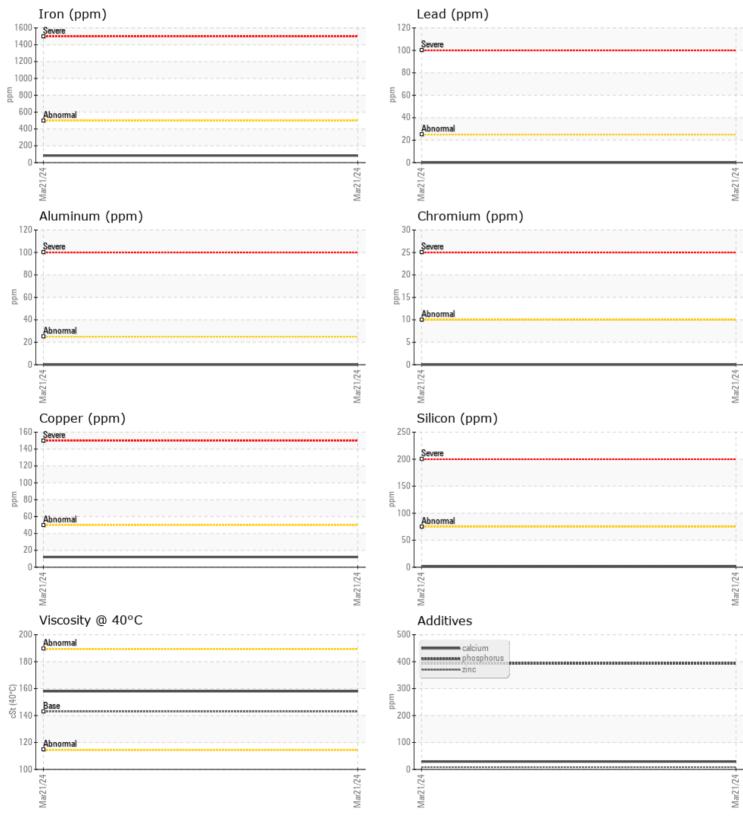

Report Id: VOLVO8885 [WUSCAR] 06154842 (Generated: 04/22/2024 15:34:43) Rev: 1

Contact/Location: DAVE ENG - VOLVO8885