




CONSTRUCTION EQUIPMENT

SPM688695 SCORIA SENNEBOGEN 835 835.0.533 - FRONT AXLE



Sample No: VCP427261
Oil Type: TDTO FLUID SAE 50
Job No: SPM688695 SCORIA

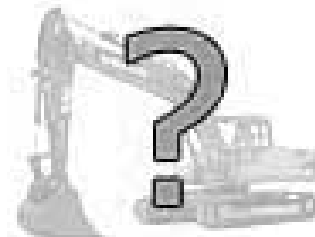

SAMPLE INFORMATION

Sample Number	VCP427261	---	---	---
Sample Date	21 Mar 2024	---	---	---
Machine Hours	11673	---	---	---
Oil Hours	0	---	---	---
Oil Changed	Changed	---	---	---
Sample Status	NORMAL	---	---	---

ALTA EQUIPMENT CO - ORLAND PARK
5000 INDUSTRIAL HWY
GARY, IN
US 46406
Contact: DAVE ENG
DAVE.ENG@ALTG.COM
T: (312)350-2560
F:



OIL CONDITION

Visc @ 40°C	cSt	█ 141	---	---	---
-------------	-----	-------	-----	-----	-----



CONTAMINATION

Water	%	NEG	---	---	---
Silicon	ppm	█ 2	---	---	---
Sodium	ppm	█ <1	---	---	---
Potassium	ppm	█ 0	---	---	---

Diagnosis

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.



WEAR METALS

Iron	ppm	█ 45	---	---	---
Copper	ppm	█ 8	---	---	---
Lead	ppm	█ 0	---	---	---
Tin	ppm	█ 0	---	---	---
Aluminum	ppm	█ <1	---	---	---
Chromium	ppm	█ 0	---	---	---
Molybdenum	ppm	█ 0	---	---	---
Nickel	ppm	█ 0	---	---	---
Titanium	ppm	0	---	---	---
Silver	ppm	0	---	---	---
Manganese	ppm	█ 2	---	---	---
Vanadium	ppm	0	---	---	---



ADDITIVES

Calcium	ppm	█ 3	---	---	---
Magnesium	ppm	█ 0	---	---	---
Zinc	ppm	█ 0	---	---	---
Phosphorus	ppm	█ 319	---	---	---
Barium	ppm	█ 0	---	---	---
Boron	ppm	█ 7	---	---	---

Depot: VOLVO8885
Unique No: 10990297
Signed: Sean Felton
Report Date: 24 Apr 2024



CONSTRUCTION EQUIPMENT



GRAPHS

