CONSTRUCTION EQUIPMENT 702216 RENTAL VOLVO A30G 753623 - HYDRAULIC SYSTEM

Sample No:VCP446164Oil Type:VOLVO SUPER HYDRAULIC OIL 46

VOLVO

rype.	VOEVO SOI EIXT
No:	702216 RENTAL

Job No: 7022

SAMPLE INFORMATION VCP446164 Sample Number Sample Date 17 Apr 2024 Machine Hours 749 Oil Hours 0 Oil Changed Not Changd NORMAL Sample Status **OIL CONDITION** Visc @ 40°C cSt 44.9 Acid Number (AN) mg KOH/g 0.48 CONTAMINATION % NEG Water

Water	/0	INEG	 	
Particles >4µm		3127	 	
Particles >6µm		1063	 	
Particles >14µm		123	 	
ISO 4406:1999 (c)		19/17/14	 	
Silicon	ppm	2	 	
Sodium	ppm	0	 	
Potassium	ppm		 	

WEAR METAL

Iron	ppm	2	 	
Copper	ppm	2	 	
Lead	ppm	■ <1	 	
Tin	ppm	0	 	
Aluminum	ppm	0	 	
Chromium	ppm	0	 	
Molybdenum	ppm	0	 	
Nickel	ppm	0	 	
Titanium	ppm	<1	 	
Silver	ppm	0	 	
Manganese	ppm	0	 	
Vanadium	ppm	<1	 	

VOLVO

🔰 ADDITIV	ES			
Calcium	ppm	96	 	
Magnesium	ppm		 	
Zinc	ppm	437	 	
Phosphorus	ppm	325	 	
Barium	ppm	0	 	
Boron	ppm	0	 	



ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC

8418 PALM RIVER ROAD TAMPA, FL US 33619 Contact: KENNY HANEY khaney@flaglerce.com T: (813)630-0077 F: (813)630-2233

Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

 Depot:
 VOLVO0093

 Unique No:
 10991257

 Signed:
 Wes Davis


 Report Date:
 23 Apr 2024

CONSTRUCTION EQUIPMENT



GRAPHS

VOLVO

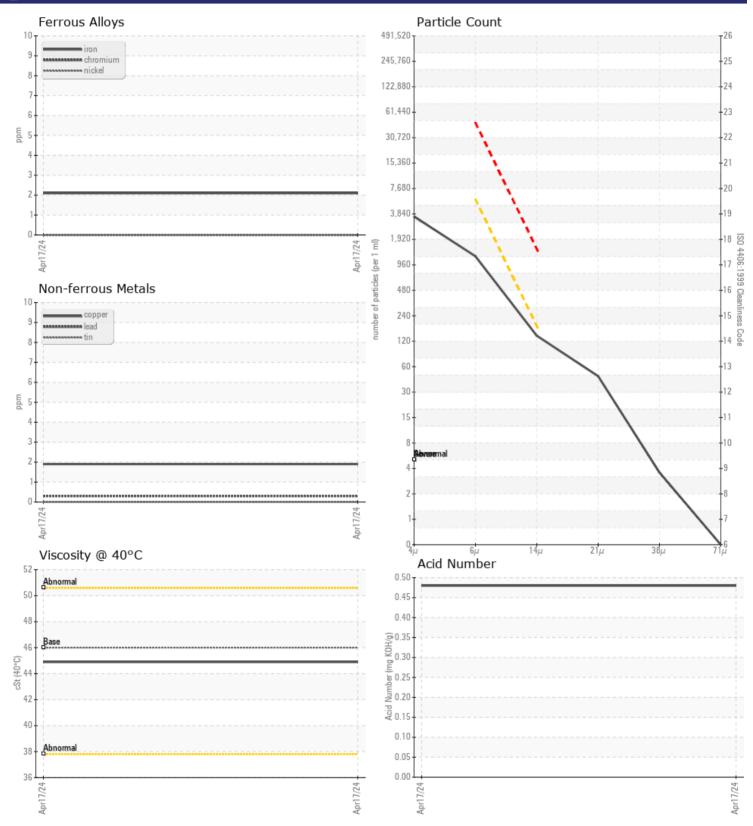

Report Id: VOLVO0093 [WUSCAR] 06155834 (Generated: 04/23/2024 12:33:26) Rev: 1

Contact/Location: KENNY HANEY - VOLVO0093